

# 1961 AC Aceca Bristol Coupe

BEX740



LEFT COAST CLASSICS

**2003**



BAR #: AB 198303  
EPA # CAL 000194101  
5830 Paradise Drive  
Corte Madera, CA 94925  
Phone: 415-927-2995 FAX: 415-927-2996

*SALES \* SERVICE \* RESTORATIONS*

**Job02 Labor detail**

8/4/03 Remove leaking water pump from engine, strip down water pump clean and glass bead all parts rebuild water pump  
8/5/03 Drill out tap and timesert thermostat stud holes make 3 thermostat housing studs. Fit water pump to engine and test.  
Remove seat extensions off drivers seat. Fit bonett as required  
Road test vehicle

**Job Subtotal: \$4,950.00**

<b>Payments to British Car Company</b>	<b>Cost Summary</b>	
Status: New Work Order	Labor	4,950.00
Payments:	Parts	1,385.94
	Haz Waste	5.25
	Tax	100.48
	<b>Total</b>	<b>\$6,441.67</b>
	Payments	0.00
	<b>Bal Due</b>	<b>6,441.67</b>

Thank you for choosing British Car Company

7/03

6,441.67

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control. A storage fee of \$25.00 per day will be added to repair bill if vehicle is not picked up within 3 working days of completion of work.

(Signature) \_\_\_\_\_

**2004**

**British Car Company**

**Invoice No.**  
**000005119**

Order Date 02/02/04 02:24 pm  
Completed: 02/02/04 02:27 pm

BAR #: AB 198303  
EPA # CAL 000194101  
5830 Paradise Drive  
Corte Madera, CA 94925  
Phone: 415-927-2995 FAX: 415-927-2996

*SALES \* SERVICE \* RESTORATIONS*

TIBURON CA 94920 Hm: 415-927-2995/ Wk:	<b>59 AC ACECA GREEN</b> 53040 Mi. Lic: NONE 4Cyl 2.5 Eng Vin: BEX 740 Equipment: Profile:
--	---

**Quotes**  
1 03/03/04 04:02pm 224.00  
in person.

**Job01 labour detail for february** **Labor: \$224.00**

Tuesday 27th January 2004-  
Take out ignition lock. Locate correct keys for all locks. Test blower motor and heater controls.

**Job Subtotal: \$224.00**

**Payments to British Car Company** **Cost Summary**

Status: Completed Work Order

Payments:

Labor	224.00
Parts	0.00
Tax	0.00
Total	\$224.00
Payments	0.00
Bal Due	224.00

Thank you for choosing British Car Company

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control. A storage fee of \$25.00 per day will be added to repair bill if vehicle is not picked up within 3 working days of completion of work.

(Signature) \_\_\_\_\_

BAR #: AB 198303  
EPA # CAL 000194101  
5830 Paradise Drive  
Corte Madera, CA 94925  
Phone: 415-927-2995 FAX: 415-927-2996

*SALES \* SERVICE \* RESTORATIONS*

<p>TIBURON CA 94920</p>	<p><b>59 AC ACECA GREEN</b> 53040 Mi. Lic: NONE 4Cyl 2.5 Eng Vin: BEX 740 Equipment: Profile:</p>
-------------------------	---

Quotes  
1 07/07/04 03:10pm 0.00  
n person.

**Job01 labour billing for june Labor: \$4,284.00**

thursday 24th june:

Rack car and remove both seats.remove runners. Remove wood and top dash panel. Remove rear spring, and remaining parts of rear suspension.

friday 25th june:

Remove carb linkage, fuel hoses,drain cooling system remove headers, remove oil temp and water temp gauges. Remove glove box and extract dash. Remove trunk floor both side panels, rear diff cover. Remove rear hatch and side glass. Extract gas tank.

monday 28th june

Remove muffler and exhaust parts. Remove rear engine mount. Remove engine. Remove transmission tunnel drive shaft and transmission. Remove both front inner fenders.

tuesday 29th june

Remove radiator, top wire harness, oil cooler, hood. Remove rear hubs,brake calipers, uprights and top suspension arms.

wednesday 30th june

Remove bottom "A" arms and steering links.  
Clean up distributor and front suspension parts. Mark and store in parts bins as needed.

thursday 1st july

remove all wood trim. Remove carpet and trim parts.

friday 2nd july

Remove both floors and inner rocker panels. Clean up debris.

**Job Subtotal: \$4,284.00**

**Job02 PARTS FOR ACECA Labor: \$0.00**

HYD01	BRAKE HOSE	4.0 @	66.99 =\$	267.96
-------	------------	-------	-----------	--------

Continued on the next page

**British Car Company**

Work Order No.  
**000005491**

**Order Date 07/07/04 10:19 am**  
**Started: 07/07/04 10:19 am**

BAR #: AB 198303  
EPA # CAL 000194101  
5830 Paradise Drive  
Corte Madera, CA 94925  
Phone: 415-927-2995 FAX: 415-927-2996

*SALES \* SERVICE \* RESTORATIONS*

**Job02 PARTS FOR ACECA**

SUS437	OUTER A ARM BUSHING	8.0 @	28.05 =\$	224.40	
SUS100	KINGPIN SET	1.0 @	420.75 =\$	420.75	
SUS840	SPRING EYE WASHER	8.0 @	19.38 =\$	155.04	
SUS125	SPRING EYE BUSHINGS	4.0 @	37.20 =\$	148.80	
PIN153	SPRING EYE PINS	4.0 @	90.33 =\$	361.32	
PIN156	FRNT OUTER A ARM PIN	2.0 @	109.72 =\$	219.44	
STR150	CENTER LINK KIT	1.0 @	8.70 =\$	8.70	
STR381	center link bushing	2.0 @	25.57 =\$	51.14	
STR439	thrust washer	2.0 @	11.50 =\$	23.00	
SEA 022	pinion seal	1.0 @	16.08 =\$	16.08	
SEA029	ouput shaft seal	2.0 @	16.25 =\$	32.50	1929.13
				<b>Job Subtotal: \$1,929.13</b>	

**Payments to British Car Company**

Status: In process Work Order

Payments:

**Cost Summary**

Labor	4,284.00
Parts	1,929.13
incomming freig	ht 18.65
Tax	139.86
Total	\$6,371.64
Payments	0.00
Bal Due	6,371.64

Thank you for choosing British Car Company

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control. A storage fee of \$25.00 per day will be added to repair bill if vehicle is not picked up within 3 working days of completion of work.

(Signature) \_\_\_\_\_





**British Car Company**

Invoice No.

**000005582**

**Page 3**

**Order Date 08/12/04 04:42 pm**

**Completed: 08/18/04 11:12 am**

BAR #: AB 198303

EPA # CAL 000194101

5830 Paradise Drive

Corte Madera, CA 94925

Phone: 415-927-2995 FAX: 415-927-2996

*SALES \* SERVICE \* RESTORATIONS*

**Payments to British Car Company**

**Cost Summary**

Status: Completed Work Order

Payments:

Labor	7,638.40
Parts	295.50
Sublet	528.00
INCOMMING FREIGHT	32.13
Tax	21.42
<b>Total</b>	<b>\$8,515.45</b>
Payments	0.00
Bal Due	8,515.45

Thank you for choosing British Car Company



**British Car Company**

Invoice No.  
**000005596**

**Order Date 08/21/04 08:30 am**  
**Completed: 10/27/04 02:42 pm**

**Page 2**

BAR #: AB 198303  
EPA # CAL 000194101  
5830 Paradise Drive  
Corte Madera, CA 94925  
Phone: 415-927-2995 FAX: 415-927-2996

*SALES \* SERVICE \* RESTORATIONS*

**Payments to British Car Company**

**Cost Summary**

Status: Completed Work Order

Payments:

Labor	0.00
Parts	2,130.67
Sublet	2,957.00
incomming freig	ht 15.75
Tax	154.47
Total	\$5,257.89
Payments	0.00
Bal Due	5,257.89

Thank you for choosing British Car Company

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA 94925

SERVICE ADVISOR **PETER BECK**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
17NOV04	24NOV04		BEX740	5801			24NOV04	18456
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY. LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
16:18	10:00	59	AC BRISTOL ACECA	5	110.00	01JAN59	150	150
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	CST/UNIT	NET/UNIT	TOTAL
<b>A REPAIR BODY DAMAGE CUT AND FIT NEW PANNELS</b>					
FAB FAB LEFT REAR FENDER					
	118 CRES	36.95		3140.75	3140.75
	5 MMM1406 50G 3" GRN DISC	3.64	3.64		18.20
	3 MMM7485 3" ROLOC DISC	4.69	4.69		14.07
FAB CUT OUT DAMAGED BODY PARTS, FAB NEW PIECES, WELD INTO PLAVE					
	162 CRES	11.05		939.25	939.25
SUBL TRANSPORTATION OF VEHICLE					
	PO#18456				
	CRES			348.00	348.00

**\*\* PRE-INVOICE \*\***

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT	4080.00		
PARTS AMOUNT	32.27		
GAS,OIL, LUBE	0.00	\$	\$
SUBLET AMOUNT	348.00		
MISC. CHARGES	0.00		
TOTAL CHARGES	4460.27		
LESS INS./ADJ.	0.00		
SALES TAX	2.50		
PLEASE PAY THIS AMOUNT ▶	4462.77 ▶		

OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.  
NOTICE TO CONSUMER  
PLEASE READ IMPORTANT INFORMATION ON BACK.  
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

CUSTOMER SIGNATURE \_\_\_\_\_  
CUSTOMER SIGNATURE \_\_\_\_\_

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

CUSTOMER COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA 94925

11455 Sorrento Valley Rd. • San Diego, CA 92121  
(858) 350-1393 • FAX (858) 350-1298  
BAR # AE194629 EPA # CAL000173132

SERVICE ADVISOR **PETER BECK**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
29NOV04	28DEC04		BEX740	5801			29DEC04	18493
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:58	08:23	59	AC BRISTOL ACECA	5	110.00	01JAN59	150	150
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST UNIT	NET/UNIT	TOTAL	SALE
A DISMANTLE CLEAN, SERVICE & RESEAL BRAKE RESERVOIR						
RES CUT AND FIT LOWER ROCKER						
	118 CRES	4.44		377.40	377.40	37740
	1 RDT10018 STEEL TUBE					
	1IN X 18GA		56.20	56.20	56.20	5620 0
	1 30SH050412 ALUMINUM SHEET 3003-H14		152.10	152.10	152.10	15210 0
	4 MMM1406 50G 3" GRN DISC		3.64	3.64	14.56	1456 0
	3 MMM7485 3" ROLOC DISC		4.69	4.69	14.07	1407 0
	1 RDTO5016 STEEL A513 TUBE		38.44	38.44	38.44	3844 0
	3 3MEPX MIXING NOZZLE		3.00	3.00	9.00	900 0
	1 9120K61 STEEL ROD 3/16		28.75	24.44	24.44	2444 0
	RES REPAIR WOOD ROLL FENDER EDGE					
	118 CRES	8.55		726.75	726.75	72675
	RES REMOVE REAR FENDER FAB AND INSTALL NEW FENDER					
	118 CRES	12.93		1099.05	1099.05	109905
	RES REPAIR WOOD IN DOORS STRAIGHTEN DOOR SKIN REPAIR LOWER ROCKER AND SILL PLATES					

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT ▶			

\*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.  
NOTICE TO CONSUMER  
PLEASE READ IMPORTANT INFORMATION ON BACK.  
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X \_\_\_\_\_  
CUSTOMER SIGNATURE

\_\_\_\_\_  
CUSTOMER SIGNATURE

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

ACCOUNTING COPY



**2005**

**SYMBOLIC**  
MOTOR CAR COMPANY

11455 Sorrento Valley Rd. • San Diego, CA 92121  
(858) 350-1393 • FAX (858) 350-1298  
BAR # AE194629 EPA # CAL000178152

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA 94925

SERVICE ADVISOR **BRUCE MARQUAND**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
06JAN05	31JAN05		BEX740	5801			31JAN05	18668
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:48	11:28	59	AC BRISTOL ACECA		110.00	01JAN59	167	167
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL	SALE
<b>A REPAIR BODY</b>						
	RES WELD L/H DOOR					
	118 CRES	1.50		127.50	127.50	12750
	RES CUT AND TRIM TUBE FOR L/REAR					
	162INTEX	3.38		(N/C)		16900
	RES RESHAPE LEFT FRONT FENDER FIT HOOD					
	118 CRES	6.25		531.25	531.25	53125

<b>** PRE-INVOICE **</b>		<b>DESCRIPTION</b>	<b>TOTALS</b>	<b>82775</b>	<b>0</b>
		LABOR AMOUNT	658.75	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
		PARTS AMOUNT	0.00		
		GAS,OIL, LUBE	0.00	\$	\$
		SUBLET AMOUNT	0.00	*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.	
		MISC. CHARGES	0.00	NOTICE TO CONSUMER	
		TOTAL CHARGES	658.75	PLEASE READ IMPORTANT INFORMATION ON BACK.	
		LESS INS./ADJ.	0.00	I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.	
		SALES TAX	0.00	X	CUSTOMER SIGNATURE
		PLEASE PAY THIS AMOUNT ▶	658.75 ▶		CUSTOMER SIGNATURE

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA 94925

SERVICE ADVISOR BRUCE MARQUAND

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.D. NO.	INVOICE PRINTED	INVOICE NO.
02FEB05	28FEB05		BEX740	5801			28FEB05	18816
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
08:39	15:03	59	AC BRISTOL ACECA		110.00	01JAN59	167	167
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL	SALE
A DISMANTLE CLEAN, SERVICE & RESEAL BRAKE RESERVOIR						
RES FIT SIDE WINDOWS WELD AND RELOCATE HOLES, FIT BUMPERS, STRAIGHTEN FRAME						
		118 CRES	12.10	1028.50	1028.50	102850
RES REPAIR RUST BEHIND DOORS, NAIL SKIN, FIT REAR BUMPER, FIT REAR LID						
		162 CRES	16.03	1362.55	1362.55	136255
RES CUT AND FIT TUBE						
		162INTEX	6.00	(N/C)		30000

** PRE-INVOICE **		DESCRIPTION	TOTALS	269105	0
		LABOR AMOUNT	2391.05	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
		PARTS AMOUNT	0.00		
		GAS, OIL, LUBE	0.00	\$	\$
		SUBLET AMOUNT	0.00	*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.	
		MISC. CHARGES	0.00	NOTICE TO CONSUMER	
		TOTAL CHARGES	2391.05	PLEASE READ IMPORTANT INFORMATION ON BACK.	
		LESS INS./ADJ.	0.00	ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE	
		SALES TAX	0.00	X	CUSTOMER SIGNATURE
		PLEASE PAY THIS AMOUNT ▶	2391.05 ▶	CUSTOMER SIGNATURE	

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

ACCOUNTING COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
26OCT05	30NOV05		BEX740	5801			30NOV05	20319
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
09:44	14:31	59	AC BRISTOL ACECA		5 110.00	02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST UNIT	NET UNIT	TOTAL
A FINISH FITTING BODY FOR PAINTWORK					
>					
	155 CRES	0.00		0.00	0.00
2	*MMM1408 24G GREEN DISC		1.16	1.04	2.08
2	*MMM7485 3" ROLOC DISC		4.76	4.28	8.56
1	*MMM2230 PSA LONG 80D GREEN		72.08	64.87	64.87
1	*MMM2596 2-3/4" GOLD PSA 150A		47.39	42.65	42.65
1	*MMM1506 6"PSA DISC 80D GREEN		139.74	125.77	125.77
1	*MMM1549 8"PSA 80D GREEN		134.18	120.76	120.76
1	*MMM1440 6"PSA DISC 150A GOLD		130.41	117.37	117.37
6	*FIB416 METAL GLAZE 300Z		45.65	41.08	246.48
50	*MMM0921 80G 3" HOOKIT DISC		0.80	0.72	36.00
50	*MMM0917 180G 3" HOOKIT DISC		0.77	0.69	34.50
4	*MMM1408 24G GREEN				

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT ▶			

\*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.  
NOTICE TO CONSUMER  
PLEASE READ IMPORTANT INFORMATION ON BACK.  
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X \_\_\_\_\_  
CUSTOMER SIGNATURE  
\_\_\_\_\_  
CUSTOMER SIGNATURE

**BILLED NOV 3 0 2005**

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

FILE COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
26OCT05	30NOV05		BEX740	5801			30NOV05	20319
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
09:44	14:31	59	AC BRISTOL ACECA		110.00	02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
	DISC		1.16	1.04	4.16
4	*MMM1406 50G 3" GRN				
	DISC		4.39	3.95	15.80
1	*10024Z UNDERHOOD BLACK		14.43	12.99	12.99
2	*770-1859 WEATHER STRIP		6.10	5.49	10.98
1	*MMM2231 40 GRIT LONG BLOCK		136.65	122.98	122.98
1	*MMM1550 8" 40 GRIT DISCS		168.22	151.40	151.40
>	WELD AND FILE BODY GAPS IN HOOD & DOORS				
	182 CRES	14.83		1260.55	1260.55
>	FIT HATCH, INSTALL RUBBER STOPS, REPAIR BODY DENTS, SAND BODY FOR PAINTING				
	182 CRES	10.41		884.85	884.85
>	REMOVE GLASS FROM DOORS, QUARTER WINDOWS, REMOVE HOOD AND BOTH DOORS, DISASSEMBLE DOORS				
	182 CRES	4.83		410.55	410.55
>	FIT REAR LID TO BODY, BODY FILL AND SAND HOOD, SAND R/H DOOR JAM, WELD BOTH SIDE DRIP RAILS AND FILE TO SIZE				
	182 CRES	12.68		1077.80	1077.80

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT ▶			

BILLED NOV 30 2005

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

FILE COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
26OCT05	30NOV05		BEX740	5801			30NOV05	20319
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
09:44	14:31	59	AC BRISTOL ACECA		110.00	02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST AMT	NET/UNIT	TOTAL
>	R/R REAR GATE, WELD AND FILE REAR GATE GAPS, BLOCK HOOD	182 CRES	6.53	555.05	555.05
>	REMOVE LEFT & RIGHT SIDE DOOR HINGES/LATCHES, SAND INNER DOORS AND CONTINUE TO BLOCK HOOD	182 CRES	7.75	658.75	658.75
>	BODY FILL & BLOCK BOTH L & R DOORS, BODY FILL & SAND RIGHT SIDE INNER FENDER	182 CRES	8.11	689.35	689.35
>	BODY FILL & SAND FRONT OF CAR, FRONT CLIP	182 CRES	15.60	1326.00	1326.00
SUBL EXPENSES INVOLVED WITH PICKING UP/TRANSPORTING CAR TO SHOP					
	CRES			287.36	287.36
FC:					
B RESTORATION PAINT					
>	-----	155 CRES	0.00	0.00	0.00

** PRE-INVOICE **		DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
		LABOR AMOUNT	6862.90		
		PARTS AMOUNT	1117.35		
		GAS,OIL, LUBE	0.00	\$	\$
		SUBLET AMOUNT	287.36	*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.	
		MISC. CHARGES	0.00	NOTICE TO CONSUMER	
		TOTAL CHARGES	8267.61	PLEASE READ IMPORTANT INFORMATION ON BACK.	
		LESS INS./ADJ.	0.00	ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.	
		SALES TAX	86.59	X _____ CUSTOMER SIGNATURE	
		PLEASE PAY THIS AMOUNT ▶	8354.20 ▶	_____ CUSTOMER SIGNATURE	

**BILLED NOV 3 0 2005**

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

FILE COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

SERVICE ADVISOR **ELIZABETH PEDEN**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
01DEC05	30DEC05		BEX740	5801			30DEC05	20540
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
12:23	12:30	59	AC BRISTOL ACECA	4	110.00	02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
<b>A RESTORATION FABRICATION</b>					
>	155 CRES	0.00		0.00	0.00
>	SND FRONT CLIP, BLOCK FRONT END, MOCK UP HOOD AND LEFT DOOR				
	182 CRES	18.06		1535.10	1535.10

<b>** PRE-INVOICE **</b>		<b>DESCRIPTION</b>	<b>TOTALS</b>	<b>ORIGINAL ESTIMATE</b>	<b>AUTHORIZED ADDITIONS</b>
		LABOR AMOUNT	1535.10		
		PARTS AMOUNT	0.00		
		GAS,OIL, LUBE	0.00	\$	\$
		SUBLET AMOUNT	0.00		
		MISC. CHARGES	0.00		
		TOTAL CHARGES	1535.10		
		LESS INS./ADJ.	0.00		
		SALES TAX	0.00		
		PLEASE PAY THIS AMOUNT ▶	1535.10 ▶		

OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.  
NOTICE TO CONSUMER  
PLEASE READ IMPORTANT INFORMATION ON BACK.  
ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X \_\_\_\_\_  
CUSTOMER SIGNATURE

\_\_\_\_\_  
CUSTOMER SIGNATURE

**BILLED DEC 30 2005**

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

FILE COPY

**2007**

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

# SYMBOLIC

MOTOR CAR COMPANY  
4455 Sorrento Valley Rd., San Diego, CA 92121  
Tel: 619-591-1291 Fax: 619-591-1292  
3774 Hillside Dr. San Diego, CA 92108-7352

WEST COAST ACQUISITIONS, LLC.  
dba

Bentley San Diego - Roll-Royce San Diego  
Lamborghini San Diego - Lotus of San Diego  
Soyker of San Diego

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
02JAN07	31JAN07		BEX740	5801			31JAN07	22882
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:48	15:51	59	AC BRISTOL ACECA	---	5	02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST UNIT	NET UNIT	TOTAL
A RESTORATION PAINT					
> METAL PREP ALL BARE METAL, MASK OFF FOR EPOXY PRIMER, SCUFF AND CLEAN SURFACES FOR ADHESION OF PRIMER					
	184 CRES			213.35	213.35
14	*MMM1547 40 GRIT ROUND STIK IT	3.65	3.28		45.92
10	*MMM0921 80G 3" HOOKIT DISC	0.85	0.76		7.60
5	*7447 SCOTCH BRITE RED	1.48	1.33		6.65
3	*FIB421 EASY SAND 30 OZ PUMP	54.18	48.76		146.28
1	*1F159 TAPE 3/4" ROLL	18.72	16.85		16.85
7	*MMM7185 N95 RESPIRATOR	2.68	2.41		16.87
15	*MMM2230 PSA LONG 80D GREEN	1.06	0.95		14.25
1	*BON354 SPREADER 3X5 YELLOW	0.77	0.69		0.69
1	*BON344 SPREADER 3X4 YELLOW	0.67	0.60		0.60
2	*FIB421 EASY SAND 30 OZ PUMP	54.18	48.76		97.52

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.  
NOTICE TO CONSUMER  
PLEASE READ IMPORTANT INFORMATION ON BACK.  
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X \_\_\_\_\_  
CUSTOMER SIGNATURE  
CUSTOMER SIGNATURE

**BILLED**  
JAN 31 2007

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

CUSTOMER COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

# SYMBOLIC

MOTOR CAR COMPANY  
1155 S. Camino Valley Rd. • San Diego, CA 92121  
TEL: 352-1333 • FAX: (619) 350-1266  
SAP # AE 94925 EPA # CAL000178152

WEST COAST ACQUISITIONS, LLC.  
dba

Bentley San Diego - Roll-Royce San Diego  
Lamborghini San Diego - Lotus of San Diego  
Spyker of San Diego

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
02JAN07	31JAN07		BEX740	5801			31JAN07	22882
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:48	15:51	59	AC BRISTOL ACECA	---	5	02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
2	*38203	GUIDE COAT	10.78	8.83	17.66
8	*MWASHER	METRIC			
	WASHER ALL		0.60	0.54	4.32
8	*SWASHER	STANDARD			
	WASHER ALL		0.35	0.31	2.48
2	*1157	BULB	0.88	0.79	1.58
2	*MNUT	METRIC NUT ALL	0.70	0.63	1.26
3	*MMM2038	P400			
	WETORDRY	9X11	1.13	1.02	3.06
60	*MMM2599	80G 2" PER			
	YARRD		2.65	2.38	142.80
3	*FIB112	RAGE GOLD			
	FILLER		72.74	65.47	196.41
15	*MMM2596	2-3/4" GOLD			
	PSA 150A		1.46	1.31	19.65
>	PREP FOR PRIMER, MASK AND EPOXY PRIME				
		189 CRES		100.30	100.30
>	CONTINUE BODYWORK TO ROOF, GLAZE COAT AND SAND FRONT OF CAR TO 150GRIT				
		184 CRES		381.65	381.65
>	BODYWORK TO ROOF AND 1/4 PANEL				
		169 CRES		260.95	260.95
>	BODYWORK TO FRONT FENDER AREA AND UPPER 1/4 PANEL, VALANCE PAN AND TAIL LENS				

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT ▶			

\*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.  
NOTICE TO CONSUMER  
PLEASE READ IMPORTANT INFORMATION ON BACK.  
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.

X \_\_\_\_\_  
CUSTOMER SIGNATURE  
\_\_\_\_\_  
CUSTOMER SIGNATURE

**BILLED** JAN 31 2007

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

CUSTOMER COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

# SYMBOLIC

MOTOR CAR COMPANY  
11411 San Diego Rd. San Diego, CA 92121  
619 451-1800 FAX 619 451-1800  
SALES 619-451-1800 SERVICE 619-451-1800

WEST COAST ACQUISITIONS, LLC.  
dba

Bentley San Diego - Roll-Royce San Diego  
Lamborghini San Diego - Lotus of San Diego  
Spyker of San Diego

SERVICE ADVISOR **ELIZABETH PEDEN**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
02JAN07	31JAN07		BEX740	5801			31JAN07	22882
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:48	15:51	59	AC BRISTOL ACECA			02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

AREA	TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
184 CRES					368.90	368.90
> BODYWORK TO REAR 1/4 PANEL LOWER HALF					349.35	349.35
184 CRES					282.20	282.20
> CONTINUE BODYWORK TO REAR 1/4					148.75	148.75
184 CRES					359.55	359.55
> PULL OUT RIGHT FRONT FENDER					298.35	298.35
189 CRES					111.35	111.35
> START ADJUSTING HOOD, CHECK HINGES, CHECK SHAPE AND LINES OF CAR					643.45	643.45
189 CRES					354.45	354.45
> SAND DOWN HIGH SPOTS AROUND FRONT GRILL AND HEADLAMP AREA, FIT GRILL, SAND DOWN FILLER AND START WORK TO BETTER FIT GRILL						
189 CRES					298.35	298.35
> WELD HOLES IN ALUMINUM GRILL AREA FOR RE-MOUNTING					111.35	111.35
139 CRES					643.45	643.45
> BODYWORK TO FRONT GRILL AREA, SHAPE OPENING FOR GRILL, FIT GRILL					354.45	354.45
189 CRES						
> PREP REAR 1/4 FOR PRIMER						
169 CRES						

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT		*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.	
MISC. CHARGES		NOTICE TO CONSUMER PLEASE READ IMPORTANT INFORMATION ON BACK.	
TOTAL CHARGES		I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.	
LESS INS./ADJ.		X _____ CUSTOMER SIGNATURE	
SALES TAX		_____	
PLEASE PAY THIS AMOUNT ▶		_____	

**BILLED**  
JAN 31 2007

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

CUSTOMER COPY

BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

# SYMBOLIC

MOTOR CAR COMPANY  
11455 Soranito Valley Rd • San Diego, CA 92121  
659 657-0300 • FAX 659 650-1296  
E-MAIL 659-6529 EPA # CAL000178132

WEST COAST ACQUISITIONS, LLC.  
dba

Bentley San Diego - Roll-Royce San Diego  
Lamborghini San Diego - Lotus of San Diego  
Spyker of San Diego

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
02JAN07	31JAN07		BEX740	5801			31JAN07	22882
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:48	15:51	59	AC BRISTOL ACECA			02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
>	PREP REAR END , ROCKER FOR PRIMER				
	169 CRES			132.60	132.60
>	PREP FRONT FENDER FOR PRIMER				
	169 CRES			219.30	219.30
>	PREP FRONT DOOR FOR PRIMER				
	169 CRES			283.90	283.90
>	PREP DOORS FOR PRIMER				
	169 CRES			352.75	352.75
>	GLAZE COAT REAR 1/4S AND SHAPE				
	184 CRES			342.55	342.55
>	REMOVE ALL PARTS FROM CAR INTERIOR AND MASK OFF INTERIOR, CHECK FIT OF REAR DECKLID, ADJUST AND FIT				
	165 CRES			123.25	123.25
>	FIT AND ADJUST DOORS, BEGIN PREPPING DOOR SEAMS, PULL LOW SPOTS, PUSH IN HIGH SPOTS, FILL AND SAND FRONT DFENDER TO DOOR OPENING FOR FIT				
	165 CRES			345.95	345.95
>	GLAZE COAT GRILL OPENING, RGHT AND LEFT SIDE HEADLAMPL OPENINGS, LOWER VALANCE AND FENDERS				
	189 CRES			752.25	752.25
>	GLAZE COAT DOORS AND SHAPE, SHAPE 1/4				

DESCRIPTION	TOTALS	ORIGINAL ESTIMATE	AUTHORIZED ADDITIONS
LABOR AMOUNT			
PARTS AMOUNT			
GAS,OIL, LUBE		\$	\$
SUBLET AMOUNT		*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED BY MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME.	
MISC. CHARGES		NOTICE TO CONSUMER PLEASE READ IMPORTANT INFORMATION ON BACK.	
TOTAL CHARGES		I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.	
LESS INS./ADJ.		X _____ CUSTOMER SIGNATURE	
SALES TAX		_____	
PLEASE PAY THIS AMOUNT ▶		_____	

**BILLED** JAN 31 2007

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

CUSTOMER COPY



BRITISH CAR CO  
5830 PARADISE DR  
CORTE MADERA, CA 94925

# SYMBOLIC

MOTOR CAR COMPANY  
455 S. Main St. San Diego, CA 92101  
TEL: 619-594-1234 FAX: 619-594-1235  
BAR # 45 1234 5678 9012 34567890123456

WEST COAST ACQUISITIONS, LLC.  
dba

Bentley San Diego - Roll-Royce San Diego  
Lamborghini San Diego - Lotus of San Diego  
Spyker of San Diego

SERVICE ADVISOR ELIZABETH PEDEN

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
02JAN07	31JAN07		BEX740	5801			31JAN07	22882
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
15:48	15:51	59	AC BRISTOL ACECA			02JAN59	155	155
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
11111	11111							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
		184	CRES	327.25	327.25
> BODYWORK TO ROOF AREA, BLOCK SAND ROUGH, FILL AND SAND DENTS IN WINDSHIELD FRAME & COWL, GLAZE COAT ROOF AND BLOCK TO 80 GRIT					
		165	CRES	353.60	353.60
> BODYWORK TO LEFT FENDER, GLAZE COAT, ROOUGH SAND					
		189	CRES	416.50	416.50

<b>** PRE-INVOICE **</b>		<b>DESCRIPTION</b>	<b>TOTALS</b>	<b>ORIGINAL ESTIMATE</b>	<b>AUTHORIZED ADDITIONS</b>
		LABOR AMOUNT	10285.00		
		PARTS AMOUNT	742.45		
		GAS,OIL, LUBE	0.00	\$	\$
		SUBLET AMOUNT	0.00		
		MISC. CHARGES	0.00		
		TOTAL CHARGES	11027.45		
		LESS INS./ADJ.	0.00		
		SALES TAX	57.54		
		PLEASE PAY THIS AMOUNT ▶	11084.99 ▶		
		<small>*OUR CHARGES ARE NOT BASED ON ACTUAL TIME BUT ARE ESTABLISHED MULTIPLYING OUR RETAIL LABOR RATE BY INDUSTRY FLAT RATE ALLOWANCES OR OUR OWN EXPERIENCE OF THE AVERAGE REQUIRED TIME NOTICE TO CONSUMER PLEASE READ IMPORTANT INFORMATION ON BACK. I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.</small>			
		X _____ CUSTOMER SIGNATURE			
		_____ CUSTOMER SIGNATURE			

**BILLED** JAN 31 2007

ALL PARTS LISTED ON SUPPLEMENTAL INVOICE ATTACHED  
ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED

CUSTOMER COPY

**2008**

# EDMUNDS AUTOMOTIVE RESTORATIONS

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.

**000000132**

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611 Work Phone: Cell Phone:	<b>59 AC ACECA silver</b> 53040 Mi. Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	---

### Quotes

1 07/29/08 05:17pm20000.00 i by phone
--

**Job01 Rebuild**

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

**Job02 Restoration July\August**

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

**Job03 Carburettors**

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

**Job04 Restoration August/September**

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48

-----&gt;-----&gt;-----&gt;-----Continued on the next page-----&gt;-----&gt;-----&gt;-----&gt;



# EDMUNDS AUTOMOTIVE RESTORATIONS

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.

**000000132**

Phone: 707-939-6600 FAX: 707-939-6606

## Job08 Tyres

GR-16	Tube-S	5.0 @	19.32 =\$	96.60	1921.60
-------	--------	-------	-----------	-------	---------

## Job09 Restoration Dec/Jan

Labor: \$3,200.00

Fit new tyres. found rims are bent and unservicable Order new rims. strip out old wiring loom and replace with new loom. make up small looms as required. Finish off front door assembly and trim panels found left door has problem at front edge fouling front wing, remove door to investigate a fix. left brake caliper leaking after bleeding brake system remove and investigate found leak at bleed nipple nipple is not sealing supply and fit different type of nipple assy.

MISC	Hardware kit-S	1.0 @	68.31 =\$	68.31	
P38	Brake Clean-N	1.0 @	6.99 =\$	6.99	
237486	#m Adehsive-S	2.0 @	10.35 =\$	20.70	
AC-453	Chrome wire wheels-S	4.0 @	432.43 =\$	1729.72	1825.72

## Job10 Restoration Jan/Feb.

Labor: \$3,200.00

Carry on with restoration re-fitting body and electrical component's refit all woodwork to interior and assemble dashboard. send Ign lock out for duplication of keys and refit on return. Order new seat belts and prepare seats for refitment.

2222341	seat belt-S	2.0 @	28.95 =\$	57.90	
1635501	key-S	4.0 @	5.25 =\$	21.00	78.90

## Job11 Keys

Sublet: \$28.00

Cut four key blanks using original Ign lock.

## Job12 Restoration March/april

Labor: \$3,200.00

Carry on with restoration re-fitting body and electrical component's refit all woodwork to interior and assemble dashboard. send Ign lock out for duplication of keys and refit on return. Order new seat belts and prepare seats for refitment. Refit Carburetors and refit throttle linkages make up new fuel lines and fit check over engine in preperation for starting. fit radiator and finish cooling system tests. Modify AC Greyhound air intake to fit under hood send for powdercoat. Front hubs found to have too much free play remove hubs strip for inspection and adjust wheel bearings and refit. final fit Dash assy after binicle back from trim shop. fit seat belts and seats mount tyres to new wheels and fit to

----->----->----->---Continued on the next page--->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 4

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job12 Restoration March/april

car. final bleed hydraulic systems.

CO 3053	radiator mount-S	4.0 @	2.14 =\$	8.56	
CO 6390	distance piece-S	2.0 @	5.34 =\$	10.68	
1055	Gas Hose-S	1.5 @	31.71 =\$	47.56	
617	STIK-S	1.0 @	30.06 =\$	30.06	
PRES	Coolant-N	2.0 @	17.95 =\$	35.90	
PFM201	Brake fluid-S	6.0 @	7.99 =\$	47.94	
P38	Brake Clean-N	2.0 @	6.99 =\$	13.98	
2860	matt black paint-S	2.0 @	9.99 =\$	19.98	
8352212504	Red Line Oil-N	8.0 @	13.56 =\$	108.48	
5/16STEEL	fuel pipe-S	1.0 @	9.99 =\$	9.99	
5/16HOSE	fuel hose-S	1.0 @	12.36 =\$	12.36	
3748904	1/12BSF bolt-S	2.0 @	14.69 =\$	29.38	374.87

## Job13 powder coat

Sublet: \$90.00

Powder coat air filter intake manifold

## Job14 Restorations April/May

Labor: \$1,800.00

Continue Restoration through April/May Supply and fit new spark plugs and wires check distributor points and regap reset Ign timing and change oil Rectify oil leak from transmission Remove heater assembly to gain access to windscreen washer jet supply and fit new jet and hoses. refit exhaust manifold and exhaust main silencer repair chassis frame at exhaust mount which was torn off weld in new mount fit main silencer. carry out compression test #1-130 #2-130 #3-130 #4-130 #5-100 #6-100 Engine is mis-firing and running on 4 cylinders this may clean up after road test. Paint inside nose area and refit grill assy. prepare and paint bumper mount irons and refit front and rear bumpers.

4490009	Adaptor-S	2.0 @	4.04 =\$	8.08	
6182505	Brake bleeder-S	1.0 @	2.96 =\$	2.96	
8711830	fuel hose-S	2.0 @	1.74 =\$	3.48	
HYD011	Brake hose-S	1.0 @	54.93 =\$	54.93	
50205	Engine oil-S	7.0 @	6.77 =\$	47.39	
7335	Battery-S	1.0 @	124.31 =\$	124.31	
72-G824-06D	Tee- AN6-S	1.0 @	13.36 =\$	13.36	
4628202	Batt cable-S	1.0 @	8.73 =\$	8.73	

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job14 Restorations April/May

4628210	Batt cable-S	1.0 @	10.48 =\$	10.48	
6228662	bullet connectors-S	22.0 @	4.04 =\$	88.88	
6228670	bullet sleeves-S	28.0 @	2.63 =\$	73.64	
734803	Plug wires-S	1.0 @	56.39 =\$	56.39	
37027	Plug connectors-S	6.0 @	2.36 =\$	14.16	
2120	spark plug-S	6.0 @	8.99 =\$	53.94	
3631801	defroster hose-S	4.0 @	8.99 =\$	35.96	
5460201	solonoid-S	1.0 @	31.56 =\$	31.56	628.25

## Job15 Restoration May/June

Labor: \$600.00

Carry on with restoration Work on engine missfire. Heater core started to leak remove heater assembly and strip box send core for repair. Clean out under front wheel arches and pain under fender area.

## Job16 Restoration June/July

Labor: \$850.00

Carry on with restoration. fit remaining wiring and trouble shoot some wiring problems remove dash assembly again to check on Revcounter cable (stopped working) requires new cable. Found small leak from fuel tank remove tank and test found small crack at mount stud repair crack and pressure test tank found multiple leaks repair all leaks and refit tank. advise customer that tank will leak at some future date but at this time no leaks aparent.

GAS	Gas-S	7.0 @	3.44 =\$	24.08	24.08
-----	-------	-------	----------	-------	-------

----->----->----->---Continued on the next page--->----->----->----->

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

**EDMUNDS AUTOMOTIVE RESTORATIONS**

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS Cost Summary**

Status: In process Work Order

Payments: \$29,292.49


1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???
4	11/29/08	6375.96	Check	2973
5	01/27/09	5396.30	Check	2980
6	03/01/09	3313.01	Check	2985
7	04/23/09	3693.93	Check	2988
8	06/02/09	2562.73	Check	

Labor	19080.00
Parts	6,886.82
Sublet	4,057.10
freight wheels	125.00
Subtotal	30148.92
Tax	619.81
Total	\$30768.73
Payments	29292.49
Bal Due	1,476.24

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

Hi -

Sorry not much done  
this month. Mainly the  
fuel tank & bits & pieces.  
Have got the heater core back  
so check for this week and then  
we can get it running again

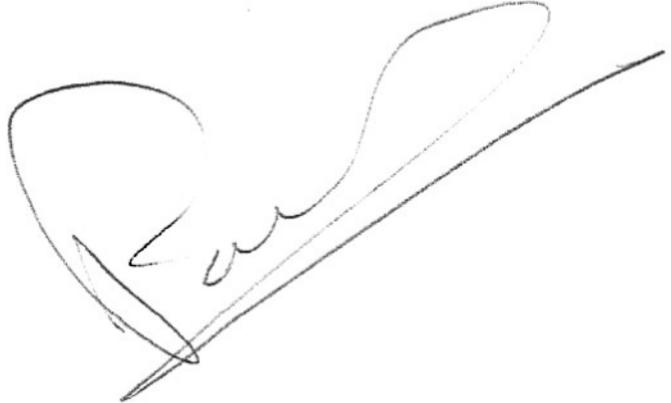

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611 Work Phone Cell Phone:	<b>59 AC ACECA silver</b> 53040 Mi.Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
--	--

Quotes  
1 07/29/08 05:17pm 20000.00  
by phone

## Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

## Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

## Job03 Carburetors

Sublet: \$1,002.30

Overhaul three single barrel Carburetors

## Job04 Restoration August/September

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90
1568981	Light kit-S	2.0 @	165.32 =\$	330.64

----->----->----->---Continued on the next page--->----->----->----->





# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 4

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job14 Restorations April/May

HYD011	Brake hose-S	1.0 @	54.93 =\$	54.93
50205	Engine oil-S	7.0 @	6.77 =\$	47.39
7335	Battery-S	1.0 @	124.31 =\$	124.31
72-G824-06D	Tee- AN6-S	1.0 @	13.36 =\$	13.36
4628202	Batt cable-S	1.0 @	8.73 =\$	8.73
4628210	Batt cable-S	1.0 @	10.48 =\$	10.48
6228662	bullet connectors-S	22.0 @	4.04 =\$	88.88
6228670	bullet sleeves-S	28.0 @	2.63 =\$	73.64
734803	Plug wires-S	1.0 @	56.39 =\$	56.39
37027	Plug connectors-S	6.0 @	2.36 =\$	14.16
2120	spark plug-S	6.0 @	8.99 =\$	53.94
3631801	defroster hose-S	4.0 @	8.99 =\$	35.96
5460201	solonoid-S	1.0 @	31.56 =\$	31.56
				628.25

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS Cost Summary

Status: In process Work Order

Payments: \$26,729.76

1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???
4	11/29/08	6375.96	Check	2973
5	01/27/09	5396.30	Check	2980
6	03/01/09	3313.01	Check	2985
7	04/23/09	3693.93	Check	2988

Labor	17630.00
Parts	6,862.74
Sublet	4,057.10
freight wheels	125.00
Subtotal	28674.84
Tax	617.65
Total	\$29292.49
Payments	26729.76
Bal Due	2,562.73

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000132

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

PIEDMONT CA 94611 Work Phone: Cell Phone:	<b>59 AC ACECA silver</b> 53040 Mi.Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

## Quotes

1 07/29/08 05:17pm20000.00  
35-

### Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

### Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

### Job03 Carburettors

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

### Job04 Restoration August/September

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90
1568981	Light kit-S	2.0 @	165.32 =\$	330.64

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job04 Restoration August/September

1627001	driving lamp-S	1.0 @	144.00 =\$	144.00	1130.64
---------	----------------	-------	------------	--------	---------

## Job05 Interior fitment

Sublet: \$2,500.00

Refit interior make up new trim panels as required.

## Job06 Restoration October/November

Labor: \$3,000.00

Restoration continues. Fit new roof arial.. refit bonnet hardware assemble front door window winder mechanism's and refit to doors shim and fit door frames into final position. Refit Headlamp assemblies front running lights refit rear lights and wire all lights. Stop work on electrics until new wiring loom arrives. fit trunk lock, body badges and mock fit bumpers and grill assy.

SEL0104	Antenna-S	1.0 @	32.05 =\$	32.05	
1686981	Light bucket assemble-S	2.0 @	115.36 =\$	230.72	
117420	washer jet-S	1.0 @	18.36 =\$	18.36	
BR2654	Wiring loom-S	1.0 @	621.62 =\$	621.62	902.75

## Job07 Flatbed

Sublet: \$436.80

Flatbed truck car to trimshop and return on completion of interior

## Job08 Tyres

Labor: \$0.00

Supply and fit 5 new Avon tyres and tubes.

165AVON	Tires-S	5.0 @	365.00 =\$	1825.00	
GR-16	Tube-S	5.0 @	19.32 =\$	96.60	1921.60

## Job09 Restoration Dec/Jan

Labor: \$3,200.00

Fit new tyres. found rims are bent and unservicable Order new rims. strip out old wiring loom and replace with new loom. make up small looms as required. Finish off front door assembly and trim panels found left door has problem at front edge fouling front wing, remove door to investigate a fix. left brake caliper leaking after bleeding brake system remove and investigate found leak at bleed nipple nipple is not sealing supply and fit different type of nipple assy.

MISC	Hardware kit-S	1.0 @	68.31 =\$	68.31	
P38	Brake Clean-N	1.0 @	6.99 =\$	6.99	
237486	#m Adehsive-S	2.0 @	10.35 =\$	20.70	
AC-453	Chrome wire wheels-S	4.0 @	432.43 =\$	1729.72	1825.72

## Job10 Restoration Jan/Feb.

Labor: \$3,200.00

Carry on with restoration re-fitting body and electrical component's refit all woodwork to interior and assemble dashboard. send Ign lock out for duplication of keys and refit on return. Order new seat belts and prepare seats for refitment.

2222341	seat belt-S	2.0 @	28.95 =\$	57.90	
---------	-------------	-------	-----------	-------	--

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job10 Restoration Jan/Feb.

1635501	key-S	4.0 @	5.25 =\$	21.00	78.90
---------	-------	-------	----------	-------	-------

## Job11 Keys

Sublet: \$28.00

Cut four key blanks using original Ign lock.

## Job12 Restoration March/april

Labor: \$3,200.00

Carry on with restoration re-fitting body and electrical component's refit all woodwork to interior and assemble dashboard. send Ign lock out for duplication of keys and refit on return. Order new seat belts and prepare seats for refitment. Refit Carburetors and refit throttle linkages make up new fuel lines and fit check over engine in preparation for starting. fit radiator and finish cooling system tests. Modify AC Greyhound air intake to fit under hood send for powdercoat. Front hubs found to have too much free play remove hubs strip for inspection and adjust wheel bearings and refit. final fit Dash assy after binicle back from trim shop. fit seat belts and seats mount tyres to new wheels and fit to car. final bleed hydraulic systems.

CO 3053	radiator mount-S	4.0 @	2.14 =\$	8.56	
CO 6390	distance piece-S	2.0 @	5.34 =\$	10.68	
1055	Gas Hose-S	1.5 @	31.71 =\$	47.56	
617	STIK-S	1.0 @	30.06 =\$	30.06	
PRES	Coolant-N	2.0 @	17.95 =\$	35.90	
PFM201	Brake fluid-S	6.0 @	7.99 =\$	47.94	
P38	Brake Clean-N	2.0 @	6.99 =\$	13.98	
2860	matt black paint-S	2.0 @	9.99 =\$	19.98	
8352212504	Red Line Oil-N	8.0 @	13.56 =\$	108.48	
5/16STEEL	fuel pipe-S	1.0 @	9.99 =\$	9.99	
5/16HOSE	fuel hose-S	1.0 @	12.36 =\$	12.36	
3748904	1/12BSF bolt-S	2.0 @	14.69 =\$	29.38	374.87

## Job13 powder coat

Sublet: \$90.00

Powder coat air filter intake manifold

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

### Cost Summary

Labor	15830.00
Parts	6,234.49
Sublet	4,057.10
freight wheels	125.00
Subtotal	26246.59
Tax	483.17
Total	\$26729.76
Payments	23035.83

----->----->----->---Continued on the next page--->----->----->----->

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

**EDMUNDS AUTOMOTIVE RESTORATIONS**

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

Cost Summary

Bal Due

3,693.93

Status: In process Work Order

Payments: \$23,035.83

1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???
4	11/29/08	6375.96	Check	2973
5	01/27/09	5396.30	Check	2980
6	03/01/09	3313.01	Check	2985

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 1

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.

000000132

Order Date 07/29/08 05:11 pm

Completed: 02/17/09 12:43 pm

**59 AC ACECA silver**

53040 Mi. Last in 7/29/2008

Lic: NONE 6Cyl 2.2 Eng

Vin: BEX 740

Eq:

Profile:

Quotes

1 07/29/08 05:17pm20000.00

PIEDMONT CA 94611

Work Phone:

Cell Phone:

**Job01 Rebuild**

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

**Job02 Restoration July\August**

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

**Job03 Carburettors**

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

**Job04 Restoration August/September**

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90
1568981	Light kit-S	2.0 @	165.32 =\$	330.64

-----&gt;-----&gt;-----&gt;-----Continued on the next page-----&gt;-----&gt;-----&gt;-----&gt;

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.

000000132

Order Date 07/29/08 05:11 pm

Completed: 02/17/09 12:43 pm

## Job04 Restoration August/September

1627001	driving lamp-S	1.0 @	144.00 =\$	144.00	1130.64
---------	----------------	-------	------------	--------	---------

## Job05 Interior fitment

Sublet: \$2,500.00

Refit interior make up new trim panels as required.

## Job06 Restoration October/November

Labor: \$3,000.00

Restoration continues. Fit new roof arial.. refit bonnet hardware assemble front door window winder mechanism's and refit to doors shim and fit door frames into final position. Refit Headlamp assemblies front running lights refit rear lights and wire all lights. Stop work on electrics until new wiring loom arrives. fit trunk lock, body badges and mock fit bumpers and grill assy.

SEL0104	Antenna-S	1.0 @	32.05 =\$	32.05	
1686981	Light bucket assemble-S	2.0 @	115.36 =\$	230.72	
117420	washer jet-S	1.0 @	18.36 =\$	18.36	
BR2654	Wiring loom-S	1.0 @	621.62 =\$	621.62	902.75

## Job07 Flatbed

Sublet: \$436.80

Flatbed truck car to trimshop and return on completion of interior

## Job08 Tyres

Labor: \$0.00

Supply and fit 5 new Avon tyres and tubes.

165AVON	Tires-S	5.0 @	365.00 =\$	1825.00	
GR-16	Tube-S	5.0 @	19.32 =\$	96.60	1921.60

## Job09 Restoration Dec/Jan

Labor: \$3,200.00

Fit new tyres. found rims are bent and unservicable Order new rims. strip out old wiring loom and replace with new loom. make up small looms as required. Finish off front door assembly and trim panels found left door has problem at front edge fouling front wing, remove door to investigate a fix. left brake caliper leaking after bleeding brake system remove and investigate found leak at bleed nipple nipple is not sealing supply and fit different type of nipple assy.

MISC	Hardware kit-S	1.0 @	68.31 =\$	68.31	
P38	Brake Clean-N	1.0 @	6.99 =\$	6.99	
237486	#m Adehsive-S	2.0 @	10.35 =\$	20.70	
AC-453	Chrome wire wheels-S	4.0 @	432.43 =\$	1729.72	1825.72

## Job10 Restoration Jan/Feb.

Labor: \$3,200.00

Carry on with restoration re-fitting body and electrical component's refit all woodwork to interior and assemble dashboard. send Ign lock out for duplication of keys and refit on return. Order new seat belts and prepare seats for refitment.

2222341	seat belt-S	2.0 @	28.95 =\$	57.90	
---------	-------------	-------	-----------	-------	--

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.

000000132

Order Date 07/29/08 05:11 pm

Completed: 02/17/09 12:43 pm

## Job10 Restoration Jan/Feb.

1635501	key-S	4.0 @	5.25 =\$	21.00	78.90
---------	-------	-------	----------	-------	-------

## Job11 Keys

Sublet: \$28.00

Cut four key blanks using original Ign lock.

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

## Cost Summary

Status: Completed Work Order


Payments: \$19,722.82

1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???
4	11/29/08	6375.96	Check	2973
5	01/27/09	5396.30	Check	2980

Labor	12630.00
Parts	5,859.61
Sublet	3,967.10
freight wheels	125.00
Subtotal	22581.71
Tax	454.12
Total	\$23035.83
Payments	19722.82
Bal Due	3,313.01

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

*Thanks Joe  
Car should be up & running  
this month!*

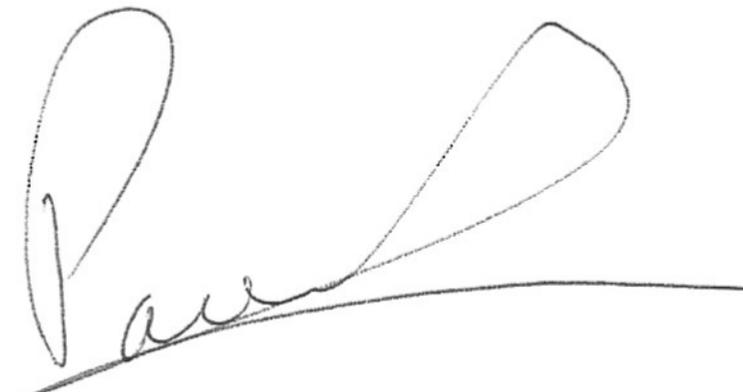

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 1

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.

000000132

Order Date 07/29/08 05:11 pm

Completed: 02/17/09 12:43 pm

PIEDMONT CA 94611 Work Phone: Cell Phone: }	<b>59 AC ACECA silver</b> 53040 Mi.Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

## Quotes

1 07/29/08 05:17pm20000.00

### Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

### Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration  
Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

### Job03 Carburettors

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

### Job04 Restoration August/September

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90
1568981	Light kit-S	2.0 @	165.32 =\$	330.64

-----&gt;-----&gt;-----&gt;-----Continued on the next page-----&gt;-----&gt;-----&gt;-----&gt;



# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.

000000132

Order Date 07/29/08 05:11 pm

Completed: 02/17/09 12:43 pm

## Job10 Restoration Jan/Feb.

1635501	key-S	4.0 @	5.25 =\$	21.00	78.90
---------	-------	-------	----------	-------	-------

## Job11 Keys

Sublet: \$28.00

Cut four key blanks using original Ign lock.

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS Cost Summary

Status: Completed Work Order

Payments: \$19,722.82

1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???
4	11/29/08	6375.96	Check	2973
5	01/27/09	5396.30	Check	2980

Labor	12630.00
Parts	5,859.61
Sublet	3,967.10
freight wheels	125.00
Subtotal	22581.71
Tax	454.12
Total	\$23035.83
Payments	19722.82
Bal Due	3,313.01

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 1

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

BAR #: ARD249851

EPA # CAL000305793

29741 ARNOLD DRIVE

SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000132

PIEDMONT CA 94611	59 AC ACECA silver
Work Phone: _____	53040 Mi. Last in 7/29/2008
Cell Phone: _____	Lic: NONE 6Cyl 2.2 Eng
	Vin: BEX 740
	Eq:
	Profile:

## Quotes

1 07/29/08 05:17pm 20000.00

### Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

### Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

### Job03 Carburetors

Sublet: \$1,002.30

Overhaul three single barrel Carburetors

### Job04 Restoration August/September

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90
1568981	Light kit-S	2.0 @	165.32 =\$	330.64

-----&gt;-----&gt;-----&gt;-----Continued on the next page-----&gt;-----&gt;-----&gt;-----&gt;

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Started: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job04 Restoration August/September

1627001	driving lamp-S	1.0 @	144.00 =\$	144.00	1130.64
---------	----------------	-------	------------	--------	---------

## Job05 Interior fitment

Sublet: \$2,500.00

Refit interior make up new trim panels as required.

## Job06 Restoration October/November

Labor: \$3,000.00

Restoration continues. Fit new roof arial.. refit bonnet hardware assemble front door window winder mechanism's and refit to doors shim and fit door frames into final position. Refit Headlamp assemblies front running lights refit rear lights and wire all lights. Stop work on electrics until new wiring loom arrives. fit trunk lock, body badges and mock fit bumpers and grill assy.

SEL0104	Antenna-S	1.0 @	32.05 =\$	32.05	
1686981	Light bucket assemble-S	2.0 @	115.36 =\$	230.72	
117420	washer jet-S	1.0 @	18.36 =\$	18.36	
BR2654	Wiring loom-S	1.0 @	621.62 =\$	621.62	902.75

## Job07 Flatbed

Sublet: \$436.80

Flatbed truck car to trimshop and return on completion of interior

## Job08 Tyres

Labor: \$0.00

Supply and fit 5 new Avon tyres and tubes.

165AVON	Tires-S	5.0 @	365.00 =\$	1825.00	
GR-16	Tube-S	5.0 @	19.32 =\$	96.60	1921.60

## Job09 Restoration Dec/Jan

Labor: \$3,200.00

Fit new tyres. found rims are bent and unservicable Order new rims. strip out old wiring loom and replace with new loom. make up small looms as required. Finish off front door assembly and trim panels found left door has problem at front edge fouling front wing, remove door to investigate a fix. left brake caliper leaking after bleeding brake system remove and investigate found leak at bleed nipple nipple is not sealing supply and fit different type of nipple assy.

MISC	Hardware kit-S	1.0 @	68.31 =\$	68.31	
P38	Brake Clean-N	1.0 @	6.99 =\$	6.99	
237486	#m Adehsive-S	2.0 @	10.35 =\$	20.70	
AC-453	Chrome wire wheels-S	4.0 @	432.43 =\$	1729.72	1825.72

----->----->----->---Continued on the next page--->----->----->----->

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 3

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

BAR #: ARD249851

EPA # CAL000305793

29741 ARNOLD DRIVE

SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000132

Payments to EDMUNDS AUTOMOTIVE RESTORATIONS	Cost Summary
---	--------------

Status: In process Work Order

Payments: \$14,326.52

1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???
4	11/29/08	6375.96	Check	2973

Labor	9,430.00
Parts	5,780.71
Sublet	3,939.10
freight wheels	125.00
Subtotal	19274.81
Tax	448.01
Total	\$19722.82
Payments	14326.52
Bal Due	5,396.30

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

**000000132**

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

Y	<b>59 AC ACECA silver</b>
PIEDMONT CA 94611	53040 Mi. Last in 8/21/2004
Work Phone	Lic: NONE 6Cyl 2.2 Eng
Cell Ph	Vin: BEX 740
	Eq:
	Profile:

## Quotes

1 07/29/08 05:17pm 20000.00

5-

### Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

### Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

### Job03 Carburettors

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

### Job04 Restoration August/September

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
1568781	Light kit-S	2.0 @	165.32 =\$	330.64
1627001	driving lamp-S	1.0 @	144.00 =\$	144.00

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000132

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

## Job04 Restoration August/September

2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90	1130.64
---------	-----------------	-------	----------	-------	---------

## Job05 Interior fitment

Sublet: \$2,500.00

Refit interior make up new trim panels as required.

## Job06 Restoration October/November

Labor: \$3,000.00

Restoration continues. Fit new roof arial.. refit bonnet hardware assemble front door window winder mechanism's and refit to doors shim and fit door frames into final position. Refit Headlamp assemblies front running lights refit rear lights and wire all lights. Stop work on electrics until new wiring loom arrives. fit trunk lock, body badges and mock fit bumpers and grill assy.

SEL0104	Antenna-S	1.0 @	32.05 =\$	32.05	
1686981	Light bucket assemble-S	2.0 @	115.36 =\$	230.72	
117420	washer jet-S	1.0 @	18.36 =\$	18.36	
BR2654	Wiring loom-S	1.0 @	621.62 =\$	621.62	902.75

## Job07 Flatbed

Sublet: \$436.80

Flatbed truck car to trimshop and return on completion of interior

## Job08 Tyres

Labor: \$0.00

Supply and fit 5 new Avon tyres and tubes.

165AVON	Tires-S	5.0 @	365.00 =\$	1825.00	
GR-16	Tube-S	5.0 @	0.00 =\$	0.00	1825.00

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

### Cost Summary

Status: In process Work Order

Payments: \$7,950.56

1	08/12/08	4000.00	Check	2479
2	09/19/08	1702.30	Check	
3	10/20/08	2248.26	Check	???

Labor	6,230.00
Parts	3,858.39
Sublet	3,939.10
Subtotal	14027.49
Tax	299.03
Total	\$14326.52
Payments	7,950.56
Bal Due	6,375.96

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000132

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

PIEDMONT CA 94611 Work Phone: Cell Phone: ---	<b>59 AC ACECA GREEN</b> 53040 Mi.Last in 8/21/2004 Lic: NONE 4Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	---

## Quotes

1 07/29/08 05:17pm20000.00

35-

### Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

### Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration

Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

### Job03 Carburettors

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

### Job04 Restoration August/September

Labor: \$2,530.00

Fit rear 1/4 windows and wood trim adjust wood as needed. Start fitment of door windows and frames. Start rebuild of dashboard and instrument's and wiring. Tow car to Interior shop for Refitment of interior Panels and carpet's fit front and rear windscreens. Order new Lamp unit's to replace damaged and poor condition originals.

RUB110	Windsheild rubber-S	1.0 @	120.99 =\$	120.99
RUB251	Rear window seal-S	1.0 @	133.65 =\$	133.65
LOC1526	lock strip-S	16.0 @	1.66 =\$	26.56
1591001	Pad tail lamp-S	2.0 @	4.24 =\$	8.48
1594001	Pad lamp base-S	2.0 @	4.23 =\$	8.46
1593001	Base tail lamp-S	2.0 @	23.99 =\$	47.98
1628001	foglamp-S	1.0 @	144.00 =\$	144.00
1707001	bulb-S	2.0 @	1.25 =\$	2.50
3234201	screw-S	4.0 @	2.11 =\$	8.44
1594001	gasket rubber-S	2.0 @	4.20 =\$	8.40
1438001	rear lamp base-S	2.0 @	48.32 =\$	96.64
1592001	lens-S	2.0 @	18.00 =\$	36.00
1568781	Light kit-S	2.0 @	165.32 =\$	330.64
1627001	driving lamp-S	1.0 @	144.00 =\$	144.00

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 2

Order Date 07/29/08 05:11 pm

Started: 07/29/08 05:11 pm

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Phone: 707-939-6600 FAX: 707-939-6606

## Job04 Restoration August/September

2801301	Rubber gasket-S	2.0 @	6.95 =\$	13.90	1130.64
---------	-----------------	-------	----------	-------	---------

## Job05 Interior fitment

Sublet: \$2,500.00

Refit interior make up new trim panels as required.

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

## Cost Summary

Status: In process Work Order

Payments: \$5,702.30

1 08/12/08 4000.00 Check 2479  
2 09/19/08 1702.30 Check

Labor	3,230.00
Parts	1,130.64
Sublet	3,502.30
Subtotal	7,862.94
Tax	87.62
Total	\$7,950.56
Payments	5,702.30
Bal Due	2,248.26

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

*pd # 2873*  
*\$ 2,248.26*  
*10/18/08*

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Invoice No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Completed: 07/29/08 05:11 pm

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611 Work Phone Cell Phone	<b>59 AC ACECA GREEN</b> 53040 Mi. Last in 8/21/2004 Lic: NONE 4Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

Quotes  
1 07/29/08 05:17pm 20000 00

## Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

## Job02 Restoration July\August

Labor: \$700.00

Carry out Restoration  
Remove all parts from storage sort and inventory, Remove Carbs and send for refurbishment.

## Job03 Carburettors

Sublet: \$1,002.30

Overhaul three single barrel Carburettors

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

### Cost Summary

Status: Completed Work Order

Payments: \$4,000.00

1 08/12/08 4000.00 Check 2479

Labor	700.00
Parts	0.00
Sublet	1,002.30
Subtotal	1,702.30
Total	\$1,702.30
Payments	4,000.00
Bal Due	-2,297.70

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.  
**000000132**

Order Date 07/29/08 05:11 pm  
Completed: 07/29/08 05:11 pm

PIEDMONT CA 94611  
Work Phone:  
Cell Phone:

**59 AC ACECA GREEN**  
53040 Mi. Last in 8/21/2004  
Lic: NONE 4Cyl 2.2 Eng  
Vin: BEX 740  
Eq:  
Profile:

### Quotes

1 07/29/08 05:17pm 20000.00

### Job01 Rebuild

Labor: \$0.00

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possible or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

### Job02 Restoration\August

Labor: \$300.00

Carry out Restoration

### Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

### Cost Summary

Status: Completed Work Order

Payments: \$4,000.00

1 08/12/08 4000.00 Check 2479

Labor	300.00
Parts	0.00
Subtotal	300.00
Total	\$300.00
Payments	4,000.00
Bal Due	-3,700.00

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS



I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

# EDMUNDS AUTOMOTIVE RESTORATIONS

Order Date: 07/29/08 05:11 pm

BAR #: AC249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000132**

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611	<b>59 AC ACECA GREEN</b> 53040 Mi.Last in 8/21/2004 Lic: NONE 4Cyl 2.5 Eng Vin: BEX 740 Eq: Profile:	<u>Quotes</u> 1 07/29/08 05:17pm20000.00
-------------------	---	---

**Job01 Rebuild** **Labor: \$0.00**

Finish rebuild started at British Car Co. Estimate of labour to be 180 to 200 hours. but estimate to be updated up or down as work progress is made. All parts needed are extra to estimate. Customer requests that we use as much of the original parts as possable or practicable, Labour and parts to be billed monthly on the 15th of the month. with written progress report of work done and still needed. Deposit of \$4000.00 to cover cost of parts to get started.

Payments to EDMUNDS AUTOMOTIVE RESTORATIONS	Cost Summary	
Status: New Work Order	Labor	0.00
	Parts	0.00
Payments:	Subtotal	0.00
	Total	\$0.00
	Payments	0.00
	Bal Due	0.00

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

**2009**

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
 EPA # CAL000305793  
 29741 ARNOLD DRIVE  
 SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.  
**000000209**

Order Date 07/27/09 02:14 pm  
 Started: 07/27/09 02:14 pm

*Shaw - Thomas Automotive  
 Bristol  
 Engineer*

PIEDMONT CA 94611  
 Work Phone:  
 Cell Phone:

**59 AC ACECA silver**  
 53040 Mi. Last in 7/29/2008  
 Lic: NONE 6Cyl 2.2 Eng  
 Vin: BEX 740  
 Eq:  
 Profile:

*Tow  
 Price  
 Deal  
 hand around  
 \$1000  
 vintag  
 racing  
 circuit*

**Job01 Continue restoration**

**Labor: \$6,500.00**

Restoration July/August/Sept.

Fabricate air filter housing bracket make up rubber seals for intake, strip and prepare housing for paint. Fit spare wheel carrier and clearance boot panels, finish off boot interior trim after fuel tank refit. Make up wiring loom for spot and foglamps fit new switches and lamps. Remove and strip left door for paint repair refit on completion. Drive car extensively to clear missfire strip distributor check bob weights and bearings check points and regap. remove spark plugs and recheck gaps set timing.

141400	Relay flasher-S	1.0 @	129.95 =\$	129.95
159300	tail lamp warranty-S	1.0 @	0.01 =\$	0.01
6748377	Number plate lamp-S	1.0 @	20.20 =\$	20.20
6479885	fuse pak-S	1.0 @	4.04 =\$	4.04
6539548	electrical wire-S	12.0 @	0.65 =\$	7.80
5623498	electrical terminals-S	14.0 @	0.30 =\$	4.20
1621001	fog switch-S	2.0 @	23.57 =\$	47.14
306992066728	hardware-S	1.0 @	25.42 =\$	25.42
				<b>238.76</b>

**Job02 Paint repair**

**Sublet: \$380.00**

Repair left door damage and repaint as required

**Job03 October/November**

**Labor: \$600.00**

Continue with restoration. Remove valve covers and strip and repaint, repair Oil filler tower Fit all new gaskets and rubbers

ENG105	valve cover gaskets-S	1.0 @	62.50 =\$	62.50
106	end plugs-S	4.0 @	22.30 =\$	89.20
496	serrated nut-S	1.0 @	55.00 =\$	55.00
				<b>206.70</b>

**Job04 Engine compartment**

**Labor: \$3,100.00**

Remove engine and strip ancillaries, remove all linkages and any parts in engine compartment for powder coating. Strip heater box and disassemble. remove all heater ducts and control flaps disassemble for powder coating. Strip out throttle pedal and linkage disassemble for powder coating. clean all parts prior to sending out.

Start reassembly of engine compartment and parts on engine.

----->----->----->---Continued on the next page--->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000209**

Order Date 07/27/09 02:14 pm  
Started: 07/27/09 02:14 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job04 Engine compartment

6808301	grommet-S	1.0 @	11.35 =\$	11.35	
899-B	clamp-S	3.0 @	1.99 =\$	5.97	
MNT040	engine mount-S	2.0 @	187.84 =\$	375.68	393.00

## Job05 Powder coat Sublet: \$617.50

Powder coat engine Various brackets and housings. Heat coat exhaust manifold

## Job06 Paint engine compartment Chassis Sublet: \$850.00

Strip out engine compartment power wash and degrease engine compartment. mask off car and engine compartment. Respray all chassis tube and steering strip and repaint radiator.

## Job07 Fuel tank Sublet: \$1,000.00

Fabricate new steel fuel tank change mounting system to include a soft mount.

## Job08 fuel tank powder coat Sublet: \$500.00

Powder coat new fuel tank before fitment.

## Job09 Brakes Labor: \$300.00

Rear brake cylinders leaking Supply and fit new wheel cylinder assemblies. Bleed hydraulic systems

0211601	Wheel cylinder-S	1.0 @	69.95 =\$	69.95	
0211581	Wheel cylinder L/H-S	1.0 @	69.95 =\$	69.95	
LMA	Brake fluid-N	5.0 @	6.99 =\$	34.95	
P38	Brake Clean-N	2.0 @	6.99 =\$	13.98	188.83

## Job10 Jan 2012 Labor: \$3,200.00

Continue with rebuild Reposition engine in frame to clear steering, fit front Fog/spot lights and wire up, Engine start and check over. Fabricate exhaust mounts. complete interior refit. rewire interior lights fit one new switch to passenger side.

RVB570	Hood/tailgate seal-S	25.0 @	6.75 =\$	168.75	
BLT410	fanbelt-S	1.0 @	33.11 =\$	33.11	
MISC	Hardware-S	1.0 @	18.92 =\$	18.92	
PRES	Coolant-N	1.0 @	21.99 =\$	21.99	
TR01	Trim adeshive-S	1.0 @	8.85 =\$	8.85	
8352280204	Water Wetter-N	1.0 @	12.50 =\$	12.50	
8352212504	Red Line Oil-N	9.0 @	13.56 =\$	122.04	
29783874	oil filter-S	1.0 @	25.66 =\$	25.66	
GAS	gas-S	20.0 @	4.36 =\$	87.20	
93429	switch-S	1.0 @	17.66 =\$	17.66	
MISC02	wire-S	13.0 @	3.59 =\$	46.67	
90-425	valve-S	4.0 @	3.66 =\$	14.64	577.99

## Job11 Feb 2012 Labor: \$550.00

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 3

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.**000000209**

Order Date 07/27/09 02:14 pm

Started: 07/27/09 02:14 pm

**Job11 Feb 2012**

Continue rebuild. drive and correct problems

**Job12 March restoration**

Labor: \$600.00

Finish restoration. Tidy up loose ends and check all systems carry out extensive road testing.

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS****Cost Summary**

Status: In process Work Order

Payments: \$13,967.25

1	11/01/09	2912.54	Check	2222
2	01/25/10	2025.30	Check	3338
3	03/24/10	2267.50	Cash	check
4	09/15/10	3934.20	Check	
5	11/23/11	2827.71	Check	4243

Labor	14850.00
Parts	1,605.28
Sublet	3,347.50
Subtotal	19802.78
Tax	144.48
Total	\$19947.26
Payments	13967.25
Bal Due	5,980.01

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 1

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.  
**000000209**

Order Date 07/27/09 02:14 pm  
Started: 07/27/09 02:14 pm

PIEDMONT CA 94611 Work Phone: Cell Phone:	<b>59 AC ACECA silver</b> 53040 Mi.Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

## Job01 Continue restoration

Labor: \$5,500.00

Restoration July/August/Sept.

Fabricate air filter housing bracket make up rubber seals for intake, strip and prepare housing for paint. Fit spare wheel carrier and clearance boot panels, finish off boot interior trim after fuel tank refit. Make up wiring loom for spot and foglamps fit new switches and lamps. Remove and strip left door for paint repair refit on completion. Drive car extensively to clear missfire strip distributor check bob weights and bearings check points and regap. remove spark plugs and recheck gaps set timing.

141400	Relay flasher-S	1.0 @	129.95 =\$	129.95	
159300	tail lamp warranty-S	1.0 @	0.01 =\$	0.01	
6748377	Number plate lamp-S	1.0 @	20.20 =\$	20.20	
6479885	fuse pak-S	1.0 @	4.04 =\$	4.04	
6539548	electrical wire-S	12.0 @	0.65 =\$	7.80	
5623498	electrical terminals-S	14.0 @	0.30 =\$	4.20	
1621001	fog switch-S	2.0 @	23.57 =\$	47.14	
306992066728	hardware-S	1.0 @	25.42 =\$	25.42	238.76

## Job02 Paint repair

Sublet: \$380.00

Repair left door damage and repaint as required

## Job03 October/November

Labor: \$600.00

Continue with restoration. Remove valve covers and strip and repaint, repair Oil filler tower Fit all new gaskets and rubbers

ENG105	valve cover gaskets-S	1.0 @	62.50 =\$	62.50	
106	end plugs-S	4.0 @	22.30 =\$	89.20	
496	serrated nut-S	1.0 @	55.00 =\$	55.00	206.70

## Job04 Engine compartment

Labor: \$3,100.00

Remove engine and strip ancillaries, remove all linkages and any parts in engine compartment for powder coating. Strip heater box and disassemble. remove all heater ducts and control flaps disassemble for powder coating. Strip out throttle pedal and linkage disassemble for powder coating. clean all parts prior to sending out.

Start reassembly of engine compartment and parts on engine.

-----&gt;-----&gt;-----&gt;-----Continued on the next page-----&gt;-----&gt;-----&gt;-----&gt;

# EDMUNDS AUTOMOTIVE RESTORATIONS

Order Date 07/27/09 02:14 pm

Started: 07/27/09 02:14 pm

BAR #: ARD249851

EPA # CAL000305793

29741 ARNOLD DRIVE

SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000209

## Job04 Engine compartment

6808301	grommet-S	1.0 @	11.35 =\$	11.35	
899-B	clamp-S	3.0 @	1.99 =\$	5.97	
MNT040	engine mount-S	2.0 @	187.84 =\$	375.68	393.00

## Job05 Powder coat

Sublet: \$617.50

Powder coat engine Various brackets and housings. Heat coat exhaust manifold

## Job06 Paint engine compartment Chassis

Sublet: \$850.00

Strip out engine compartment power wash and degrease engine compartment. mask off car and engine compartment. Respray all chassis tube and steering strip and repaint radiator.

## Job07 Fuel tank

Sublet: \$1,000.00

Fabricate new steel fuel tank change mounting system to include a soft mount.

## Job08 fuel tank powder coat

Sublet: \$500.00

Powder coat new fuel tank before fitment.

## Job09 Brakes

Labor: \$300.00

Rear brake cylinders leaking Supply and fit new wheel cylinder assemblies. Bleed hydraulic systems

0211601	Wheel cylinder-S	1.0 @	69.95 =\$	69.95	
0211581	Wheel cylinder L/H-S	1.0 @	69.95 =\$	69.95	
LMA	Brake fluid-N	5.0 @	6.99 =\$	34.95	
P38	Brake Clean-N	2.0 @	6.99 =\$	13.98	188.83

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

### Cost Summary

Status: In process Work Order

Payments: \$11,139.54

1	11/01/09	2912.54	Check	2222
2	01/25/10	2025.30	Check	3338
3	03/24/10	2267.50	Cash	check
4	09/15/10	3934.20	Check	

Labor	9,500.00
Parts	1,027.29
Sublet	3,347.50
Subtotal	13874.79
Tax	92.46
Total	\$13967.25
Payments	11139.54
Bal Due	2,827.71

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000209

Order Date 07/27/09 02:14 pm

Started: 07/27/09 02:14 pm

PIEDMONT CA 94611 Work Phone: Cell Phone:	<b>59 AC ACECA silver</b> 53040 Mi.Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

## Job01 Continue restoration

Labor: \$2,700.00

Restoration July/August/Sept.

Fabricate air filter housing bracket make up rubber seals for intake, strip and prepare housing for paint. Fit spare wheel carrier and clearance boot panels, finish off boot interior trim after fuel tank refit. Make up wiring loom for spot and foglamps fit new switches and lamps. Remove and strip left door for paint repair refit on completion. Drive car extensively to clear missfire strip distributor check bob weights and bearings check points and regap. remove spark plugs and recheck gaps set timing.

141400	Relay flasher-S	1.0 @	129.95 =\$	129.95	
159300	tail lamp warranty-S	1.0 @	0.01 =\$	0.01	
6748377	Number plate lamp-S	1.0 @	20.20 =\$	20.20	
6479885	fuse pak-S	1.0 @	4.04 =\$	4.04	
6539548	electrical wire-S	12.0 @	0.65 =\$	7.80	
5623498	electrical terminals-S	14.0 @	0.30 =\$	4.20	
1621001	fog switch-S	2.0 @	23.57 =\$	47.14	213.34

## Job02 Paint repair

Sublet: \$380.00

Repair left door damage and repaint as required

## Job03 October/November

Labor: \$600.00

Continue with restoration. Remove valve covers and strip and repaint, repair Oil filler tower Fit all new gaskets and rubbers

ENG105	valve cover gaskets-S	1.0 @	62.50 =\$	62.50	
106	end plugs-S	4.0 @	22.30 =\$	89.20	
496	serrated nut-S	1.0 @	55.00 =\$	55.00	206.70

## Job04 Engine compartment

Labor: \$3,100.00

Remove engine and strip ancillaries, remove all linkages and any parts in engine compartment for powder coating.Strip heater box and disassemble. remove all heater ducts and control flaps disassemble for powder coating. Strip out throttle pedal and linkage disassemble for powder coating. clean all parts prior to sending out.

Start reassembly of engine compartment and parts on engine.

6808301	grommet-S	1.0 @	11.35 =\$	11.35	
899-B	clamp-S	3.0 @	1.99 =\$	5.97	
MNT040	engine mount-S	2.0 @	187.84 =\$	375.68	393.00

## Job05 Powder coat

Sublet: \$617.50

Powder coat engine Various brackets and housings. Heat coat exhaust manifold

**Job06 Paint engine compartment Chassis**

Sublet: \$850.00

Strip out engine compartment power wash and degrease engine compartment. mask off car and engine compartment. Respray all chassis tube and steering strip and repaint radiator.

**Job07 Fuel tank**

Sublet: \$1,000.00

Fabricate new steel fuel tank change mounting system to include a soft mount.

**Job08 fuel tank powder coat**

Sublet: \$500.00

Powder coat new fuel tank before fitment.

**Job09 Brakes**

Labor: \$300.00

Rear brake cylinders leaking Supply and fit new wheel cylinder assemblies. Bleed hydraulic systems

0211601	Wheel cylinder-S	1.0 @	69.95 =\$	69.95	
0211581	Wheel cylinder L/H-S	1.0 @	69.95 =\$	69.95	
LMA	Brake fluid-N	5.0 @	6.99 =\$	34.95	
P38	Brake Clean-N	2.0 @	6.99 =\$	13.98	188.83

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS****Cost Summary**

Status: In process Work Order

Payments: \$7,205.34

1	11/01/09	2912.54	Check	2222
2	01/25/10	2025.30	Check	3338
3	03/24/10	2267.50	Cash	check

Labor	6,700.00
Parts	1,001.87
Sublet	3,347.50
Subtotal	11049.37
Tax	90.17
Total	\$11139.54
Payments	7,205.34
Bal Due	3,934.20

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

paid 3,934.20  
 # 3898  
 9/12/10

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000209

Order Date 07/27/09 02:14 pm

Started: 07/27/09 02:14 pm

PIEDMONT CA 94611 Work Phone: Cell Phone: 4	59 AC ACECA silver 53040 Mi. Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

## Job01 Continue restoration

Labor: \$2,300.00

Restoration July/August/Sept.

Fabricate air filter housing bracket make up rubber seals for intake, strip and prepare housing for paint. Fit spare wheel carrier and clearance boot panels, finish off boot interior trim after fuel tank refit. Make up wiring loom for spot and foglamps fit new switches and lamps. Remove and strip left door for paint repair refit on completion. Drive car extensively to clear missfire strip distributor check bob weights and bearings check points and regap. remove spark plugs and recheck gaps set timing.

141400	Relay flasher-S	1.0 @	129.95 =\$	129.95	
159300	tail lamp warranty-S	1.0 @	0.01 =\$	0.01	
6748377	Number plate lamp-S	1.0 @	20.20 =\$	20.20	
6479885	fuse pak-S	1.0 @	4.04 =\$	4.04	
6539548	electrical wire-S	12.0 @	0.65 =\$	7.80	
5623498	electrical terminals-S	14.0 @	0.30 =\$	4.20	
1621001	fog switch-S	2.0 @	23.57 =\$	47.14	213.34

## Job02 Paint repair

Sublet: \$380.00

Repair left door damage and repaint as required

## Job03 October/November

Labor: \$600.00

Continue with restoration. Remove valve covers and strip and repaint, repair Oil filler tower Fit all new gaskets and rubbers

ENG105	valve cover gaskets-S	1.0 @	62.50 =\$	62.50	
106	end plugs-S	4.0 @	22.30 =\$	89.20	
496	serrated nut-S	1.0 @	55.00 =\$	55.00	206.70

## Job04 Engine compartment

Labor: \$2,000.00

Remove engine and strip ancillaries, remove all linkages and any parts in engine compartment for powder coating. Strip heater box and disassemble. remove all heater ducts and control flaps disassemble for powder coating. Strip out throttle pedal and linkage disassemble for powder coating. clean all parts prior to sending out. + 800-

Start reassembly of engine compartment and parts on engine.

## Job05 Powder coat

Sublet: \$617.50

Powder coat engine Various brackets and housings. Heat coat exhaust manifold

## Job06 Paint engine compartment Chassis

Sublet: \$850.00

Strip out engine compartment power wash and degrease engine compartment. mask off car

# EDMUNDS AUTOMOTIVE RESTORATIONS

Page 3

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000209**

Order Date 07/27/09 02:14 pm  
Started: 07/27/09 02:14 pm

Phone: 707-939-6600 FAX: 707-939-6606

## Job06 Paint engine compartment Chassis

and engine compartment. Respray all chassis tube and steering strip and repaint radiator.

Payments to EDMUNDS AUTOMOTIVE RESTORATIONS		Cost Summary	
Status: In process Work Order		Labor	4,900.00
		Parts	420.04
		Sublet	1,847.50
Payments: \$4,937.84		Subtotal	7,167.54
1 11/01/09 2912.54 Check 2222		Tax	37.80
2 01/25/10 2025.30 Check 3338		Total	\$7,205.34
		Payments	4,937.84
		Bal Due	2,267.50

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

*paid 2,267.50  
3/13/2010  
# 3347*

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Work Order No.  
**000000209**

Order Date 07/27/09 02:14 pm  
Started: 07/27/09 02:14 pm

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611 Work Phone: Cell Phone:	<b>59 AC ACECA silver</b> 53040 Mi.Last in 7/29/2008 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

<b>Job01 Continue restoration</b>	Labor: \$2,300.00
-----------------------------------	-------------------

Restoration July/August/Sept.

Fabricate air filter housing bracket make up rubber seals for intake, strip and prepare housing for paint. Fit spare wheel carrier and clearance boot panels, finish off boot interior trim after fuel tank refit. Make up wiring loom for spot and foglamps fit new switches and lamps. Remove and strip left door for paint repair refit on completion. Drive car extensively to clear missfire strip distributor check bob weights and bearings check points and regap. remove spark plugs and recheck gaps set timing.

141400	Relay flasher-S	1.0 @	129.95 =\$	129.95	
159300	tail lamp warranty-S	1.0 @	0.01 =\$	0.01	
6748377	Number plate lamp-S	1.0 @	20.20 =\$	20.20	
6479885	fuse pak-S	1.0 @	4.04 =\$	4.04	
6539548	electrical wire-S	12.0 @	0.65 =\$	7.80	
5623498	electrical terminals-S	14.0 @	0.30 =\$	4.20	
1621001	fog switch-S	2.0 @	23.57 =\$	47.14	213.34

<b>Job02 Paint repair</b>	Sublet: \$380.00
---------------------------	------------------

Repair left door damage and repaint as required

<b>Job03 October/November</b>	Labor: \$600.00
-------------------------------	-----------------

Continue with restoration. Remove valve covers and strip and repaint, repair Oil filler tower Fit all new gaskets and rubbers

ENG105	valve cover gaskets-S	1.0 @	62.50 =\$	62.50	
106	end plugs-S	4.0 @	22.30 =\$	89.20	
496	serrated nut-S	1.0 @	55.00 =\$	55.00	206.70

<b>Job04 Engine compartment</b>	Labor: \$1,200.00
---------------------------------	-------------------

----->----->----->-----Continued on the next page----->----->----->----->

**EDMUNDS AUTOMOTIVE RESTORATIONS**

Order Date 07/27/09 02:14 pm

Started: 07/27/09 02:14 pm

BAR #: ARD249851

EPA # CAL000305793

29741 ARNOLD DRIVE

SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

**000000209**

**Job04 Engine compartment**

Remove engine and strip ancillaries, remove all linkages and any parts in engine compartment for powder coating. clean all parts prior to sending out.

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS Cost Summary**

Status: In process Work Order

Payments: \$2,912.54

1 11/01/09 2912.54 Check 2222

Labor	4,100.00	✓
Parts	420.04	✓
Sublet	380.00	✓
Subtotal	4,900.04	
Tax	37.80	
Total	\$4,937.84	
Payments	2,912.54	
Bal Due	2,025.30	

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

*pa. il 2025  
# 3333  
1/20/200*

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Work Order No.

000000209

Order Date 07/27/09 02:14 pm  
Started: 07/27/09 02:14 pm

Y	59 AC ACECA silver
PIEDMONT CA 94611	53040 Mi. Last in 7/29/2008
Work Phone: 4	Lic: NONE 6Cyl 2.2 Eng
Cell Phone:	Vin: BEX 740
	Eq:
	Profile:

## Job01 Continue restoration

Labor: \$2,300.00

Restoration July/August/Sept.

Fabricate air filter housing bracket make up rubber seals for intake, strip and prepare housing for paint. Fit spare wheel carrier and clearance boot panels, finish off boot interior trim after fuel tank refit. Make up wiring loom for spot and foglamps fit new switches and lamps. Remove and strip left door for paint repair refit on completion. Drive car extensively to clear missfire strip distributor check bob weights and bearings check points and regap. remove spark plugs and recheck gaps set timing.

141400	Relay flasher-S	1.0 @	129.95 =\$	129.95	
159300	tail lamp warranty-S	1.0 @	0.01 =\$	0.01	
6748377	Number plate lamp-S	1.0 @	20.20 =\$	20.20	
6479885	fuse pak-S	1.0 @	4.04 =\$	4.04	
6539548	electrical wire-S	12.0 @	0.65 =\$	7.80	
5623498	electrical terminals-S	14.0 @	0.30 =\$	4.20	
1621001	fog switch-S	2.0 @	23.57 =\$	47.14	213.34

## Job02 Paint repair

Sublet: \$380.00

Repair left door damage and repaint as required

## Payments to EDMUNDS AUTOMOTIVE RESTORATIONS

### Cost Summary

Status: In process Work Order

Payments:

Labor	2,300.00
Parts	213.34
Sublet	380.00
Subtotal	2,893.34
Tax	19.20
Total	\$2,912.54
Payments	0.00

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_

**2012**

**EDMUNDS AUTOMOTIVE RESTORATIONS**

Order Date 09/11/12 07:50 pm

Paid: 04/11/14 05:51 pm

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Invoice No.  
**000000426**

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611  Work Phone: _____ Cell Phone: _____	<b>59 AC ACECA silver</b> 53207 Mi.Last in 7/27/2009 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
---	--

<b>Job01 Wipers not working</b>	<b>Labor: \$400.00</b>
remove wipwr motor and strip. send out wiper motor for sublet repair	

<b>Job02 wiper motor</b>	<b>Sublet: \$425.66</b>
--------------------------	-------------------------

<b>Job03 battery switch</b>	<b>Labor: \$150.00</b>
Supply and fit battery cutoff switch	

85988	switch-S	1.0 @	34.66 =\$	34.66	
SS08587	Battery cable-S	1.0 @	10.12 =\$	10.12	
SK8430SS	Battery cable-S	1.0 @	11.51 =\$	11.51	56.29

<b>Job04 battery trickle charger</b>	<b>Labor: \$75.00</b>
supply and fit battery tender	

743342	tender-S	1.0 @	46.31 =\$	46.31	46.31
--------	----------	-------	-----------	-------	-------

<b>Job05 Alignment</b>	<b>Sublet: \$150.00</b>
Carry out front end alignment	

<b>Job06 Electronic ignition</b>	<b>Labor: \$150.00</b>
Supply and fit electronic ignition kit to distributor	

LU-168LSP12	Ignitor kit-S	1.0 @	258.41 =\$	258.41	258.41
-------------	---------------	-------	------------	--------	--------

<b>Job07 Right rear brake/hub seized</b>	<b>Labor: \$600.00</b>
Check rear hub found brake seized on investigation revealed hard line blockage to caliper remove and clean pipe and refit check hub bearings for damage all OK	

<b>Job08 Water pump</b>	<b>Labor: \$350.00</b>
Water pump leaking remove and overhaul pump/reseal	

636352KIT	water pump kit-S	1.0 @	516.22 =\$	516.22	
PRES	Coolant-N	2.0 @	21.99 =\$	43.98	560.20

----->----->----->-----Continued on the next page----->----->----->----->

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.  
**000000426**

Order Date 09/11/12 07:50 pm

Paid: 04/11/14 05:51 pm

**Job09 Clutch hydraulics** **Labor: \$575.00**

Clutch master cylinder has internal leak slave cylinder has minor external weep. Supply and fit new master and slave cylinder

LMA	Brake fluid-N	3.0 @	6.99 =\$	20.97	
60-01040	Master cyl.-S	1.0 @	165.11 =\$	165.11	
180720	slave cylinder-S	1.0 @	155.34 =\$	155.34	341.42

**Job10 Overdrive** **Labor: \$1,600.00**

Overdrive failed on road test R&R engine and gearbox send overdrive for overhaul

**Job11 overdrive** **Sublet: \$1,888.00**

overhaul overdrive as required

**Job12 Detail** **Sublet: \$350.00**

Detail car after completion

miles \_\_\_\_\_ -

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS** **Cost Summary**

Status: Paid Work Order		Labor	3,900.00
		Parts	1,262.63
		Sublet	2,813.66
		Freight	54.00
		freight overdrvie	214.11
Payments: \$8,345.41		Subtotal	8,244.40
1 12/10/12 3300.00 Cash		Tax	101.01
2 03/21/14 1888.00 Check		Total	\$8,345.41
3 04/11/14 3157.41 Check	4795	Payments	8,345.41
		Bal Due	0.00

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Invoice No.

000000426

Order Date 09/11/12 07:50 pm  
Completed: 04/05/14 10:42 am

PIEDMONT CA 94611	<b>59 AC ACECA silver</b> 53207 Mi.Last in 7/27/2009 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: Profile:
Work Phone: ---	
Cell Phone: ---	

**Job01 Wipers not working** Labor: \$400.00

remove wipwr motor and strip. send out wiper motor for sublet repair

**Job02 wiper motor** Sublet: \$425.66

**Job03 battery switch** Labor: \$150.00

Supply and fit battery cutoff switch

85988	switch-S	1.0 @	34.66 =\$	34.66	
SS08587	Battery cable-S	1.0 @	10.12 =\$	10.12	
SK8430SS	Battery cable-S	1.0 @	11.51 =\$	11.51	56.29

**Job04 battery trickle charger** Labor: \$75.00

supply and fit battery tender

743342	tender-S	1.0 @	46.31 =\$	46.31	46.31
--------	----------	-------	-----------	-------	-------

**Job05 Alignment** Sublet: \$150.00

Carry out front end alignment

**Job06 Electronic ignition** Labor: \$150.00

Supply and fit electronic ignition kit to distributor

LU-168LSP12	Ignitor kit-S	1.0 @	258.41 =\$	258.41	258.41
-------------	---------------	-------	------------	--------	--------

**Job07 Right rear brake/hub seized** Labor: \$600.00

Check rear hub found brake seized on investigation revealed hard line blockage to caliper remove and clean pipe and refit check hub bearings for damage all OK

**Job08 Water pump** Labor: \$350.00

Water pump leaking remove and overhaul pump/reseal

636352KIT	water pump kit-S	1.0 @	516.22 =\$	516.22	
PRES	Coolant-N	2.0 @	21.99 =\$	43.98	560.20

----->----->----->----->-----Continued on the next page----->----->----->----->

**EDMUNDS AUTOMOTIVE RESTORATIONS**

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Phone: 707-939-6600 FAX: 707-939-6606

Order Date 09/11/12 07:50 pm  
Completed: 04/05/14 10:42 am

Invoice No.  
**000000426**

**Job09 Clutch hydraulics** **Labor: \$575.00**

Clutch master cylinder has internal leak slave cylinder has minor external weep. Supply and fit new master and slave cylinder

LMA	Brake fluid-N	3.0 @	6.99 =\$	20.97	
60-01040	Master cyl.-S	1.0 @	165.11 =\$	165.11	
180720	slave cylinder-S	1.0 @	155.34 =\$	155.34	341.42

**Job10 Overdrive** **Labor: \$1,600.00**

Overdrive failed on road test R&R engine and gearbox send overdrive for overhaul

**Job11 overdrive** **Sublet: \$1,888.00**

overhaul overdrive as required

**Job12 Detail** **Sublet: \$350.00**

Detail car after completion

miles \_\_\_\_\_ -

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS** **Cost Summary**

Status: Completed Work Order

Payments: \$5,188.00

- 1 12/10/12 3300.00 Cash
- 2 03/21/14 1888.00 Check

Labor	3,900.00
Parts	1,262.63
Sublet	2,813.66
Freight	54.00
freight overdrive	214.11
Subtotal	8,244.40
Tax	101.01
Total	\$8,345.41
Payments	5,188.00
Bal Due	3,157.41

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

**2015**

# EDMUNDS AUTOMOTIVE RESTORATIONS

BAR #: ARD249851  
EPA # CAL000305793  
29741 ARNOLD DRIVE  
SONOMA, CA 95476

Invoice No.  
**000000545**

Order Date 01/04/15 01:37 pm  
Completed: 01/04/15 01:40 pm

Phone: 707-939-6600 FAX: 707-939-6606

PIEDMONT CA 94611	<b>59 AC ACECA silver</b> 53207 Mi.Last in 9/11/2012 Lic: NONE 6Cyl 2.2 Eng Vin: BEX 740 Eq: AT AC PS FI 4W TB DS DC Profile:
Work Phone: _____	
Cell Phone: _____	

**Job01 Non start****Labor: \$275.00**

Go to customers house pick up vehicle and return to shop. Inspection showed starter not engaging remove starter and send for repair.

**Job02 repair starter****Sublet: \$155.00**

repair starter

miles \_\_\_\_\_ -

**Payments to EDMUNDS AUTOMOTIVE RESTORATIONS****Cost Summary**

Status: Completed Work Order

Payments:

Labor	275.00
Parts	0.00
Sublet	155.00
Subtotal	430.00
Total	\$430.00
Payments	0.00
Bal Due	430.00

Thank you for choosing EDMUNDS AUTOMOTIVE RESTORATIONS

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) \_\_\_\_\_