

1999 BMW Z3 M Coupe

VIN: WBSCM9337XLC60282





Vehicle History Report™

1999 BMW M

VIN: WBSCM9337XLC60282
 HATCHBACK 2 DR
 3.2L I6 F
 GASOLINE
 REAR WHEEL DRIVE



Damage reported



25 Service history records



7 Previous owners



Personal vehicle



Last owned in California



118,432 Last reported odometer reading

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 10/30/23 at 3:40:15 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.



Ownership History

The number of owners is estimated

	Owners 1-5	Owner 6	Owner 7
Year purchased	1998	2011	2021
Type of owner	Personal	Personal	Personal
Estimated length of ownership	12 yrs. 3 mo.	10 yrs. 2 mo.	2 yrs. 7 mo.
Owned in the following states/provinces	See Details	Washington, California	California
Estimated miles driven per year	See Details	—	—
Last reported odometer reading	87,580	116,498	118,432



Title History

	Owners 1-5	Owner 6	Owner 7
Damage Brands Salvage Junk Rebuilt Fire Flood Hail Lemon	No Problem	No Problem	No Problem
Odometer Brands Not Actual Mileage Exceeds Mechanical Limits	No Problem	No Problem	No Problem



Additional History

Not all accidents / issues are reported to CARFAX

	Owners 1-5	Owner 6	Owner 7
Total Loss No total loss reported to CARFAX.	<input checked="" type="checkbox"/> No Issues Reported	<input checked="" type="checkbox"/> No Issues Reported	<input checked="" type="checkbox"/> No Issues Reported
Structural Damage CARFAX recommends that you have this vehicle inspected by a collision repair specialist.	<input checked="" type="checkbox"/> No Issues Reported	<input checked="" type="checkbox"/> No Issues Reported	<input checked="" type="checkbox"/> No Issues Reported
Airbag Deployment No airbag deployment reported to CARFAX.	<input checked="" type="checkbox"/> No Issues Reported	<input checked="" type="checkbox"/> No Issues Reported	<input checked="" type="checkbox"/> No Issues Reported
Odometer Check No indication of an odometer rollback.	<input checked="" type="checkbox"/> No Issues Indicated	<input checked="" type="checkbox"/> No Issues Indicated	<input checked="" type="checkbox"/> No Issues Indicated
Accident / Damage Damage reported: 01/07/2006.	Damage Reported	No New Issues Reported	No New Issues Reported
Manufacturer Recall No open recalls reported to CARFAX. Check with an authorized BMW dealer for any open recalls.	<input checked="" type="checkbox"/> No Recalls Reported	<input checked="" type="checkbox"/> No Recalls Reported	<input checked="" type="checkbox"/> No Recalls Reported
Basic Warranty Original warranty estimated to have expired.	Warranty Expired	Warranty Expired	Warranty Expired



Detailed History



Owner 1













Purchased: 1998



Low mileage! This owner drove less than the industry average of 15,000 miles per year.

Personal Vehicle
9,159 mi/yr


Date	Mileage	Source	Comments
09/23/1998	10	Service Facility	Vehicle serviced Pre-delivery inspection completed
09/23/1998	21	California Motor Vehicle Dept. Redlands, CA	Odometer reading reported
10/09/1998		California Motor Vehicle Dept.	Title issued or updated First owner reported Titled or registered as personal vehicle Loan or lien reported

11/24/1998	2,673	Service Facility		Vehicle serviced
01/26/1999	4,523	Service Facility		Vehicle serviced
02/11/1999	5,021	Service Facility		Vehicle serviced Rear compartment lock replaced
06/24/1999	9,178	Service Facility		Vehicle serviced Oil and filter changed Crankshaft position sensor replaced
08/24/1999	11,120	Service Facility		Vehicle serviced
09/03/1999	11,574	Service Facility		Vehicle serviced Rear compartment lock replaced
10/01/1999		California Motor Vehicle Dept. Redlands, CA		Title issued or updated
11/05/1999	13,558	Service Facility		Vehicle serviced Rear compartment lock replaced
04/21/2000	18,785	Service Facility		Vehicle serviced Maintenance inspection completed
04/25/2001	28,897	Service Facility		Vehicle serviced Oil and filter changed Steering/suspension lubricated
10/10/2002	42,574	Service Facility		Vehicle serviced Recommended maintenance performed Battery replaced Radio/sound system checked
04/09/2003	46,465	Service Facility		Vehicle serviced
09/26/2003	49,890	California Inspection Station		Passed emissions inspection
07/26/2004	55,391	Service Facility		Vehicle serviced Oil and filter changed
02/17/2005	58,297	California Inspection Station Riverside, CA		Passed emissions inspection
02/18/2005		Dealer Inventory		Vehicle offered for sale



Owner 2
Purchased: 2005

Personal Vehicle

Date	Mileage	Source	Comments
02/27/2005	58,320	California Motor Vehicle Dept. Murrieta, CA	Title issued or updated New owner reported Loan or lien reported
03/24/2005		Warrantech Automotive, Inc. Murrieta, CA	Service contract issued
01/07/2006		Damage Report	 Damage reported



Not all damage is caused by an accident. Get the car inspected before you buy. [Learn More](#)



Owner 3
Purchased: 2006

Personal Vehicle

Date	Mileage	Source	Comments
08/19/2006	74,900	California Motor Vehicle Dept. Los Angeles, CA	Title issued or updated New owner reported
08/22/2006		California Inspection Station Los Angeles, CA	Passed emissions inspection
04/27/2007		California Inspection Station	Passed emissions inspection



Owner 4
Purchased: 2007





Low mileage! This owner drove less than the industry average of 15,000 miles per year.


Personal Vehicle
3,049 mi/yr

Date	Mileage	Source	Comments
04/27/2007	76,997	California Motor Vehicle Dept. San Diego, CA	Title issued or updated New owner reported Loan or lien reported
09/19/2008	82,081	California Inspection Station	Passed emissions inspection







09/11/2010 87,298 California
Inspection Station
San Diego, CA **Passed emissions inspection**



 **Owner 5** Personal Vehicle
Purchased: 2010

Date	Mileage	Source	Comments
12/17/2010		California Motor Vehicle Dept. San Diego, CA	Title issued or updated New owner reported
01/05/2011	87,568	Online Listing	Vehicle offered for sale
01/14/2011	87,580	DYNASPORT LLC Portland, OR 503-241-1717 ★ 4.8 / 5.0 49 Verified Reviews ♥ 37 Customer Favorites	 Vehicle serviced Maintenance inspection completed

 **Owner 6** Personal Vehicle
Purchased: 2011

Date	Mileage	Source	Comments
01/25/2011		Washington Motor Vehicle Dept. Seattle, WA Title #1102502738	Title issued or updated New owner reported Loan or lien reported Exempt from odometer reporting
10/28/2011	93,692	California Inspection Station San Francisco, CA	Failed emissions inspection
10/28/2011	93,693	California Inspection Station San Francisco, CA	Passed emissions inspection
11/21/2011		California Motor Vehicle Dept. Sebastopol, CA	Title issued or updated

11/28/2011	93,958	Bavarian Tuning BMW-MINI Santa Rosa, CA 707-575-3757 ★ 5.0 / 5.0 10 Verified Reviews ♥ 7 Customer Favorites		Vehicle serviced Rear brake pads replaced Fluids checked Cooling system checked Brakes checked Tire condition and pressure checked Oil and filter changed Lights checked
12/01/2011	93,992	North Bay Bavarian Santa Rosa, CA 707-545-0820 ★ 5.0 / 5.0 86 Verified Reviews ♥ 345 Customer Favorites		Vehicle serviced
12/02/2011		GS Tuning Santa Rosa, CA 707-284-2680 ♥ 24 Customer Favorites		Vehicle serviced Brakes checked
12/09/2011		GS Tuning Santa Rosa, CA 707-284-2680 ♥ 24 Customer Favorites		Vehicle serviced Spark plug(s) replaced Air filter checked Brake fluid flushed/changed Drivability/performance checked Rear shock absorber(s) replaced
06/29/2012	97,113	North Bay Bavarian Santa Rosa, CA 707-545-0820 ★ 5.0 / 5.0 86 Verified Reviews ♥ 345 Customer Favorites		Vehicle serviced Oil and filter changed Fluids checked Tire condition and pressure checked
09/27/2013		GS Tuning Santa Rosa, CA 707-284-2680 ♥ 24 Customer Favorites		Vehicle serviced Fluids checked Transmission fluid changed Oil and filter changed Antifreeze/coolant checked Tire(s) balanced Four tires balanced
10/17/2013	104,135	California Inspection Station Sebastopol, CA		Passed emissions inspection
07/29/2014		California Motor Vehicle Dept. Sebastopol, CA		Registration updated when owner moved the vehicle to a new location

10/12/2015	109,721	California Inspection Station Sebastopol, CA		Failed emissions inspection
10/23/2015	109,762	California Inspection Station Sebastopol, CA		Passed emissions inspection
09/06/2017	113,076	California Inspection Station Sebastopol, CA		Failed emissions inspection
09/12/2017	113,095	California Inspection Station Santa Rosa, CA		Passed emissions inspection
09/14/2017		North Bay Bavarian Santa Rosa, CA 707-545-0820 ★ 5.0 / 5.0 86 Verified Reviews ♥ 345 Customer Favorites		Vehicle serviced Oil and filter changed Brakes serviced Cooling system checked Drive belts checked Drivability/performance checked Tire condition and pressure checked Fuse(s) replaced Clutch hose replaced Spark plug(s) replaced Brake master cylinder replaced/repared Brake fluid flushed/changed Clutch slave cylinder replaced Emissions inspection performed
08/24/2018	114,706	Hammond Autowerks Santa Rosa, CA 707-538-4325 ★ 5.0 / 5.0 43 Verified Reviews ♥ 20 Customer Favorites		Vehicle serviced Oil and filter changed Valve cover gasket(s) replaced Fog light bulb(s) replaced
10/01/2019	115,868	California Inspection Station Sebastopol, CA		Passed emissions inspection

11/24/2020 116,349 North Bay Bavarian
 Santa Rosa, CA
 707-545-0820
 ★ 5.0 / 5.0
 86 Verified Reviews
 ♥ 345 Customer Favorites



Vehicle serviced
 Oil and filter changed
 Two tires balanced
 Four tires balanced
 Rear brake pads replaced
 Brakes serviced
 Cooling system checked
 Drive belts checked
 Drivability/performance checked
 Tire condition and pressure checked
 Brake pads replaced

12/30/2020 116,498 California
 Inspection Station
 Windsor, CA

Passed emissions inspection

Owner 7
 Purchased: 2021

Personal Vehicle

Date	Mileage	Source	Comments
------	---------	--------	----------

03/30/2021		California Motor Vehicle Dept. Sebastopol, CA	Title issued or updated New owner reported
------------	--	-----------------------------------------------------	------------------------------------------------------

10/17/2022	118,127	California Inspection Station Sebastopol, CA	Passed emissions inspection
------------	---------	----------------------------------------------------	------------------------------------

07/11/2023	118,301	Bavarian Performance Santa Rosa, CA 707-545-2002	Vehicle serviced Maintenance inspection completed Tire(s) replaced Tire condition and pressure checked Engine idle/timing adjusted Oil and filter changed Brakes checked
------------	---------	--------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------



10/18/2023	118,432	Bavarian Performance Santa Rosa, CA 707-545-2002	Vehicle serviced Maintenance inspection completed Tire(s) replaced Tire condition and pressure checked
------------	---------	--------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------



Have Questions? Please visit our Help Center at www.carfax.com.



Glossary

Damage Indicator

Damage can be a result of many different types of events. Examples include contact with objects (other cars, trees, traffic signs, road debris, etc), vandalism, or weather-related events. Not every damage event is reported to CARFAX. As details about the damage event become available, those additional details are added to the CARFAX Vehicle History Report. CARFAX recommends that you have this vehicle inspected by a qualified mechanic.

- This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available

as of 10/30/23 at 3:40:15 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

Failed Emissions Inspection

The emissions check performed during a vehicle inspection indicated the vehicle was emitting more than allowable emissions standards and/or had missing or modified parts. Repeated failed emissions records can indicate engine problems and CARFAX recommends you have the vehicle inspected.

First Owner

When the first owner(s) obtains a title from a Department of Motor Vehicles as proof of ownership.

New Owner Reported

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

Ownership History

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

Title Issued

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:



facebook.com/CARFAX



[@CARFAXinc](https://twitter.com/CARFAXinc)



About CARFAX

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

© 2023 CARFAX, Inc., part of S&P Global. All rights reserved.
10/30/23 3:40:15 PM (CDT)

Bavarian Performance

3069 Wiljan Ct Suite D
 Santa Rosa, CA 95407
 (707) 545-2002

Invoice #0000450

10/18/2023
 10:47 am

1999 BMW Z3
 L6-3152CC 3.2L DOHC S52
 VIN : WBSCM9337XLC60282
 Mileage : 118432
 Trans :
 License : 6TNU681

Sebastopol, CA 95472
 Cell
 Home:(7

Your Service Writer Today Is: KEN STANFEL

Service Requests:

Category Summary	Parts	Labor	Job Total
Miscellaneous	\$1,426.96	\$891.00	\$2,317.96
OTHER	\$0.00	\$0.00	\$0.00
TIRE SERVICE	\$0.00	\$0.00	\$0.00

Technician	Service Description	Parts	Labor	Job Total
------------	---------------------	-------	-------	-----------

Mileage In: 118428 Mileage Out: 118432

JG	Perform Courtesy Check.			0.00	
JG	CARB Tire Pressure Regulation Requirement: Tire Pressure set to: { } LF (psi) { } RF (psi) { } LR (psi) { } RR (psi)			0.00	
JG	cust reports battery was dead advise		261.95	148.00	409.95
	<u>Part Number</u> <u>Part Description</u> <u>Part Price Each</u> <u>Quantity</u> <u>Extended</u>				
	MTX 48 H6 48H6 BATTERY	259.95	1	259.95	
	STATE BATT FEE	2.00	1	2.00	
	cust reports clunking noise from under the hood, possible ac system.		657.01	703.00	1360.01
	Technicians: JG,SA				
	<u>Part Number</u> <u>Part Description</u> <u>Part Price Each</u> <u>Quantity</u> <u>Extended</u>				
	64 52 8 391 474 A/C Compressor New w	607.01	1	607.01	
	R134A REFRIGERANT	25.00	2	50.00	
JG	cust requests we repair rear wheels - wheels refinished balanced and replaced		508.00	40.00	548.00
	stickers				
	<u>Part Number</u> <u>Part Description</u> <u>Part Price Each</u> <u>Quantity</u> <u>Extended</u>				
	REAR WHEEL REPAIRS REFINSIH BOTH REAR WHEELS COSMETIC	245.00	2	490.00	
	36 11 2 228 660 Emblem	9.00	2	18.00	

Payments:

VISA/MASTERCARD, \$2,468.47, on 10/18/23

| CardNo: [*****7692], AuthorizationNo: [70200001]

Authorizations

Approved By:	Approval Given To:	Date	Time	Difference	Total Authorized	Method
Rick Ricketts	KLS	10/11/23	2:49 pm	\$2,404.52	\$2,404.52	By Phone
Reason: AC AND WHEELS						
Rick Ricketts	KLS	10/17/23	11:20 am	\$63.95	\$2,468.47	By Phone
Reason: STICKERS AND BALANCE						

Repair Order Notes

Thank you for your business!

Bavarian Performance

3069 Wiljan Ct Suite D
Santa Rosa, CA 95407
(707) 545-2002

Invoice #0000450

10/18/2023
10:47 am

1999 BMW Z3
L6-3152CC 3.2L DOHC S52
VIN : WBSCM9337XLC60282
Mileage : 118432
Trans :
License : 6TNU681

Cell:(7
Home:(70

Your Service Writer Today Is: KEN STANFEL

Technician Service Description Parts Labor Job Total

I acknowledge prior notice and approval of the estimate price for the part(s) and/or service(s) on this invoice.

Customer Signature: _____ Date: _____

**All Parts are New unless
Otherwise Noted**

WARRANTY INFORMATION

All other products and workmanship are warranted for 24 months or 24,000 miles

from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. I acknowledge receipt of a copy of this repair order.

Thank you for your business!
Questions or comments? Call us at (707) 545-2002

Customer Signature: _____ Date: _____

TOTAL PARTS	\$1,424.96
TOTAL LABOR	\$891.00
SUBLET	\$0.00
SHOP SUPPLY	\$18.70
SUBTOTAL	\$2,334.66
OTHER FEES	\$2.00
SALES TAX	\$131.81
INVOICE TOTAL	\$2,468.47
PAID	\$2,468.47
DUE	\$0.00



Thank you for your business!

Bavarian Performance

3069 Wiljan Ct Suite D
 Santa Rosa, CA 95407
 (707) 545-2002

Invoice #0000190

Original Estimate #0000125

7/11/2023

3:44 pm

1999 BMW Z3

L6-3152CC 3.2L DOHC S52

VIN : WBSCM9337XLC60282

Mileage : 118301

Trans :

License : 6TNU681

Sebastopol, CA 95472

Cell: (707) _____

Home: (707) _____

Your Service Writer Today Is: KEN STANFEL

Service Requests:

<u>Category Summary</u>	<u>Parts</u>	<u>Labor</u>	<u>Job Total</u>
OIL CHANGES	\$95.95	\$40.00	\$135.95
OTHER	\$0.00	\$0.00	\$0.00
TIRE SERVICE	\$0.00	\$0.00	\$0.00

<u>Technician</u>	<u>Service Description</u>	<u>Parts</u>	<u>Labor</u>	<u>Job Total</u>
	Mileage In: 118301 Mileage Out: 118301			
SA	Perform Courtesy Check. frt brakes 10mm remain rear brakes 10mm remain tire 12/32 frt and rear all ok. no leaks - suspension ok completed short roadtest			0.00
SA	CARB Tire Pressure Regulation Requirement: Tire Pressure set to: set to factory specs			0.00
SA	perform oil change, top off fluids, lube latches.		95.95	40.00
				135.95
	<u>Part Number</u> <u>Part Description</u>	<u>Part Price Each</u>	<u>Quantity</u>	<u>Extended</u>
	11 42 7 833 769 Oil Filter Kit w/ O-	27.02	1	27.02
	5W-40 LIQUIMOLY LEICHTLAUF SYN	9.99	6.9	68.93

Payments:

VISA/MASTERCARD, \$145.99, on 07/11/23

| CardNo: [*****9614], AuthorizationNo: [70200004]

Authorizations

<u>Approved By:</u>	<u>Approval Given To:</u>	<u>Date</u>	<u>Time</u>	<u>Difference</u>	<u>Total Authorized</u>	<u>Method</u>
Rick Ricketts	KLS	7/11/23	2:34 pm	\$145.99	\$145.99	By Phone
Reason: SERVICE AND INSPECTION						

Repair Order Notes



Thank you for your business!

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 10/17/2022 @ 03:01 PM

Model-Year: 1999	Make: BMW	Model: M COUPE
License: 6TNU681	State: California	VIN: WBSCM9337XLC60282
Engine Size: 3.20 L	Type: Passenger	Transmission: Manual
GVWR: 0	Test Weight: 2950	Cylinders: 6
Odometer: 118127	Certification: California	VLT Record #: 01813
Fuel Type: Gasoline	Exhaust: Dual	Inspection Reason: High Emitter Profile (HEP)
		Engine Year: 0000

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Comprehensive Visual Inspection: **PASS** Functional Check: **PASS** Emissions Test: **PASS**

Smog Check Certificate Number: **SW161182C**

DMV ID Number: **8097W125S592**

Your Smog Check certificate will be electronically transmitted to DMV
Please keep this copy for your records

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of oxides of nitrogen, crankcase and cold start emission which are not measured during the ASM tests.)

<u>RESULT</u>	<u>ECS</u>	<u>RESULT</u>	<u>ECS</u>	<u>RESULT</u>	<u>ECS</u>
PASS-	PCV	N/A-	Thermostatic Air Cleaner	PASS-	Fuel Evaporative Controls
PASS-	Catalytic Converter	PASS-	Pump Air Injection		
N/A-	Visual EGR	PASS-	Ignition Spark Controls	N/A-	Carburetor
PASS-	Fuel Injection	PASS-	O2 Sensors and Connectors	PASS-	Wiring of Other
PASS-	Vacuum Line Connections	PASS-	Other Emission Related		Sensors or Switches
N/A-	Fuel Cap Functional	N/A-	Functional EGR	N/A-	Ignition Timing: TDC
PASS-	MIL	N/A-	Fill Pipe Restrictor	PASS-	Liquid Fuel Leaks
N/A-	Fuel Evap Test				

ASM Emission Test Results

Test	RPM	CO2 (%)		HC (PPM)			CO(%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1870	15.98	0.24	60	9	59	0.54	0.03	0.06	462	67	120	PASS
25 mph	1977	15.51	0.17	44	6	36	0.52	0.03	0.04	749	62	16	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information

DI SMOG CHECK
6050 SEBASTOPOL AVE
SEBASTOPOL 95472
707-3319365
Station Number: RC294642

Technician Name/Number: VARGAS, ROBERTO/EO638561
Repair Tech. Name/Number: N/A
Software Version/EIS Number: 2201/WP393199

I certify, under penalty of perjury under the laws of the State of California, that I inspected the vehicle described above, that I performed the inspection in accordance with all bureau requirements, and that the information listed on the vehicle inspection report is true and correct.

10/17/22

Date



Technician's Signature

Certificates are valid for 90 days from date of issuance

Bavarian Performance Inc

Invoice No.

Page 1

BAR #: ARD000254698

000014843

Order Date 04/18/22 10:03 am

EPA# CAL000332299

Completed: 04/18/22 01:25 pm

3069 Wiljan Ct Suite D

Suite D

Santa Rosa, CA 95407

Phone: 707/545.2002 FAX: 707/545.2022

121 e Sebastopol CA 95472 Home Phone: 707 Mobile: 707-	98 BMW M Coupe Red 118084 Mi. Lic: 6TNU681/CA 6Cyl 3.0 Vin: WBSCM9337XLC60282 08/98 Eq:	Quotes 1 04/18/22 10:17am 1136.50 Rick by phone 7
---------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------	---------------------------------------------------------

Job01 Change oil and filter Labor: \$72.50

5W40	Total Quartz 9000-N	7.0 @	10.73 =\$	75.11	
11427833769	oil filter kit-N	1.0 @	26.62 =\$	26.62	101.73

Clean K&N air filter. Check fluids, lights, wipers, belts, hoses, brakes and tires. reset service lights.

Job02 Set tire pressure Labor: \$0.00

Set tire pressure to manufacture specifications.

Job03 Replace four tires Labor: \$174.00

225/45/17	Conti DWS 06-S	2.0 @	139.77 =\$	279.54	
245/40/17	Conti DWS 06-S	2.0 @	166.80 =\$	333.60	613.14

Dismount, mount and balance four tires.

Job04 Shipping Sublet: \$85.00

Payments to Bavarian Performance Inc	Cost Summary	
	Labor	246.50
	Parts	714.87
	Sublet	85.00
	Haz Waste	24.00
	Tax	66.13
	Total	\$1136.50
	Payments	0.00

----->----->----->-----Continued on the next page----->----->----->----->

Bavarian Performance Inc

Invoice No.

Page 2

BAR #: ARD000254698

000014843

Order Date 04/18/22 10:03 am

EPA# CAL000332299

Completed: 04/18/22 01:25 pm

3069 Wiljan Ct Suite D

Suite D

Santa Rosa, CA 95407

Phone: 707/545.2002 FAX: 707/545.2022

Payments to Bavarian Performance Inc

Cost Summary

Bal Due

1136.50

Status: Completed Work Order

Payments:

Thank you for choosing Bavarian Performance Inc

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

56608

Org. Est. # 151599
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 11/24/2020

1999 BMW - M Coupe - 3.2L, In-Line6 (192CI) VIN(3)
 Lic # : 6TNU681 Odometer In : 116349

Home 5 -- Office 0

VIN # : WBSCM9337 XLC60282

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
OIL FILTER S50/S52/S54- OX187D 11427833769	1.00	26.48	26.48	OIL AND FILTER CHANGE.	85.00
SEAL RING 07111963355	1.00	0.65	0.65	CHANGE ENGINE OIL AND FILTER, CHECK COOLING SYSTEM FOR LEAKS, CHECK ALL APPLICABLE FLUIDS. CHECK DRIVE BELTS, CHECK AND SET TIRE PRESSURES. ROAD TEST VEHICLE.	
MOBIL 1 5W40- LL01 83212365946	7.00	9.95	69.65	4 WHEEL ALIGNMENT - VEHICLE PULLS TO RIGHT AND STEERING WHEEL IS NOT STRAIGHT	170.00
REAR SUBFRAME MOUNT- E36 33311090946	2.00	71.35	142.70	ADJUST FRONT CAMBER, CASTER AND TOE.	
BRAKE CLEAN 01B	1.00	9.60	9.60	BALANCE FRONT AND REAR TIRES	68.00
AKEBONO BRAKE PAD SET EUR396	1.00	79.55	79.55	CHECK TEAR IN DRIVERS SEAT AND ADVISE REPAIR.	n/c
BRAKE PAD SENSOR- E36 318ti REAR 34351182533	1.00	18.03	18.03	CHECK NOISE WHEN SHIFTING GEARS, CUSTOMER FEELS A CLUNK WHEN LETTING OUT CLUTCH	n/c
REAR BRAKE ROTOR M3 (RIGHT SIDE) 34212227178	1.00	159.52	159.52	REAR SUBFRAME MOUNTS ARE TORN CAUSING SUBFRAME TO SHIFT WHEN DISENGAGING CLUTCH.	
REAR BRAKE ROTOR M3 (LEFT SIDE) 34212227177	1.00	159.52	159.52	REPLACE REAR SUBFRAME MOUNTS	816.00
OWNERS MANUAL 01419791317	1.00	38.94	38.94	REPLACE REAR BRAKE PADS, ROTORS AND SENSOR.	340.00
				REMOVE REAR WHEELS, CALIPERS AND ROTORS. COAT PADS WITH ANTISQUEAL COMPOUND AND REPLACE ROTORS. INSTALL NEW BRAKE PAD SENSOR. CLEAN AND LUBRICATE CALIPERS AND INSTALL NEW PADS. TORQUE CALIPER BOLTS TO 110 Nm OR 65 Nm. TORQUE WHEELS AND ROAD TEST.	
				CHECK FOR RADIO CODE 63112	n/c
				Hazardous Materials	6.00

[Recommendations]
 FRONT TIRES 32PSI
 REAR TIRES 36PSI
 FRONT BRAKES 7MM
 REAR BRAKES 8MM
 CLUTCH WORN

*PACIFIC COAST
 CUSTOMER
 INVOLVED*

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

56608

Org. Est. # 151599
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 11/24/2020

1999 BMW - M Coupe - 3.2L, In-Line6 (192CI) VIN(3)
 Lic # : 6TNU681 Odometer In : 116349

Home : _____ -- Office 00

VIN # : WBSCM9337 XLC60282

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate 2,253.00 Revisions 0.00 Current Estimate 2,253.00

Labor:	1,479.00
Parts:	704.64
HazMat:	6.00
SubTotal:	2,189.64
Tax:	63.36
Total:	2,253.00
Bal Due:	\$2,253.00

[Payments -]

Vehicle Received: 11/24/2020

Customer Number : 6411

I hereby authorized the above repair work to be done along with the necessary material and hereby granted you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed at this location & cannot exceed the original cost of repair. No warranty on customer supplied parts. No warranty on aftermarket or modification parts that are not stock replacement.

Signature _____ Date _____



Visit us on the web: www.WWW.NORTHBAYBAVARIAN.COM

Email Address: northbaybavarian@yahoo.com

**North Bay Bavarian
Santa Rosa, CA 95403
707.545.0820**

Work Order: R000192
 Last Name: _____
 First Name: _____
 License: 6TNU681
 Year: 99
 Technician: RAGONA
 Mileage: 116349
 Date: 11/23/20 8:22 PM

BMW : Z3 - E36 (1996 - 2002) : M Coupe

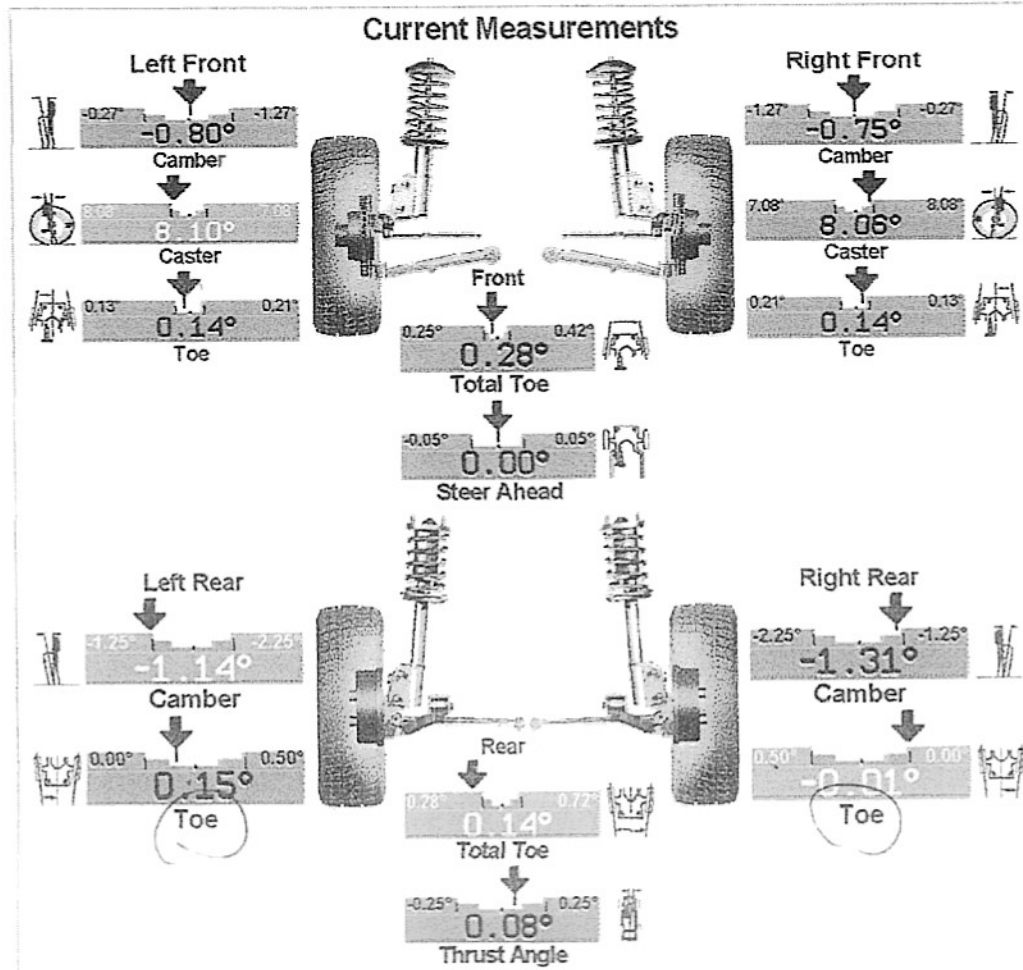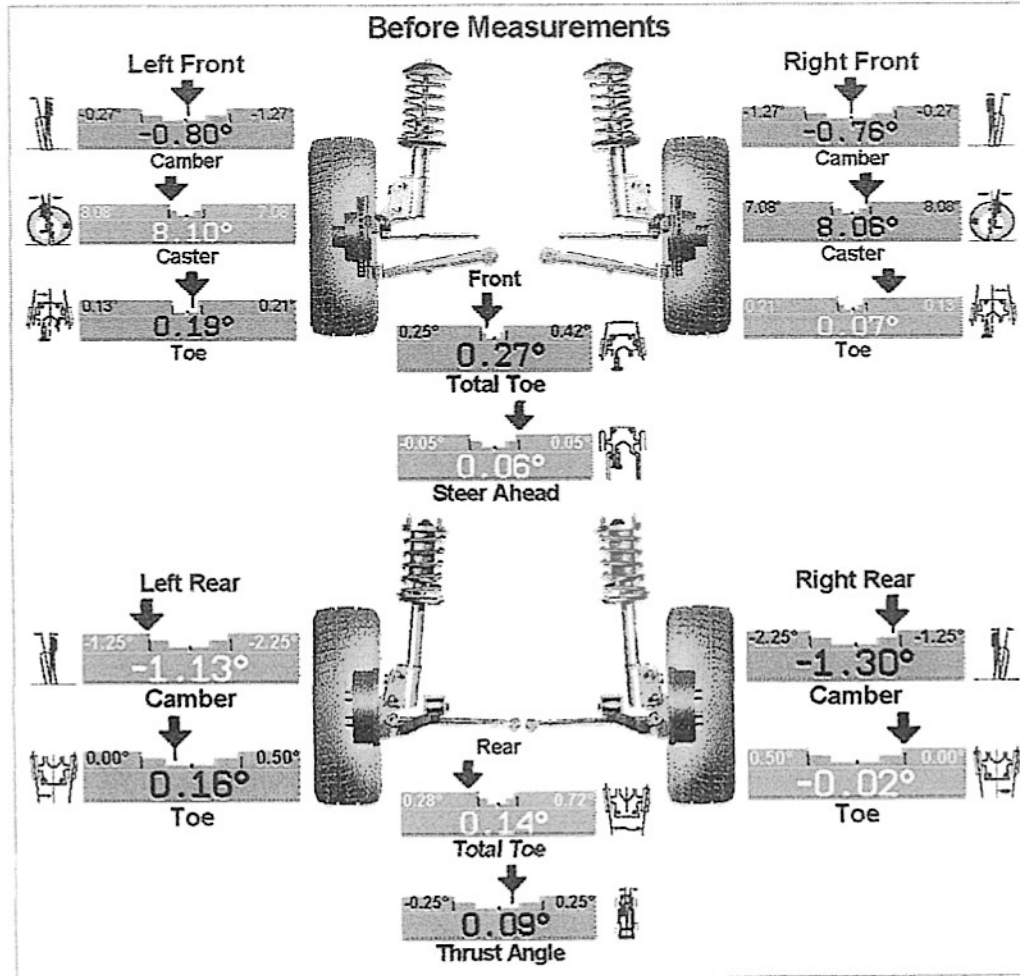



Handwritten initials/signature

INVOICE

Invoice Date
30 Dec 2020

Invoice Number
INV-45169

Reference
1999 BMW Z3

Pacific Coast Custom Interiors
Attention: 707-799-2995
1232 Cleveland Ave
SANTA ROSA CA 95401
USA (ARD285752)
707-799-2995

Description	Quantity	Unit Price	Tax	Amount USD
Labor-Repair-Install, Driver seat bottom insert repair-Removal of seat and current material-New material patterned, scrimed, sewn-Installation of new material and seat (2.5 - 3 hours)	3.00	120.00	Tax Exempt	360.00
Mat-Leather, (IN STOCK) SL1400 Doe Skin Black	1.00	50.00	9%	50.00
Mat-Findings, Adhesive, staples, rivets, scrim, and hogrings	1.00	5.00	9%	5.00
Labor-Auto Body-Paint Labor, Roof paint repair	1.00	450.00	Tax Exempt	450.00
12/15/20 installation date-Drop off from 8AM - 9AM				
NEW OWNER: Rick Ricketts:707-329-6709				
Subtotal				865.00
Total 2019 Sales Tax 9%				4.95
Total No Tax 0%				0.00
Invoice Total USD				869.95
Total Net Payments USD				869.95
Amount Due USD				0.00

Due Date: 30 Dec 2020

College
 left on Cleveland
 1232 on right



ESTIMATE

Pacific Coast Custom Interiors
 Attention: 707-799-2995
 1232 Cleveland Ave
 SANTA ROSA CA 95401
 USA (ARD285752)

Date
 02 Dec 2020

Expiration
 15 Dec 2020

Quote Number
 QU-14530

Reference
 1999 BMW Z3

Ryan
Memo 7

12.28.00

Description	Quantity	Unit Price	Tax	Amount USD
Labor-Repair-Install, Driver seat bottom insert repair-Removal of seat and current material-New material patterned, scrimed, sewn-Installation of new material and seat (2.5 - 3 hours)	3.00	120.00	Tax Exempt	360.00
Mat-Leather, (IN STOCK) SL1400 Doe Skin Black	1.00	50.00	9%	50.00
Mat-Findings, Adhesive, staples, rivets, scrim, and hogrings	1.00	5.00	9%	5.00
Labor-Auto Body-Paint Labor, Roof paint repair	1.00	450.00	Tax Exempt	450.00
12/15/20 installation date-Drop off from 8AM - 9AM				
			Subtotal	865.00
			Total 2019 Sales Tax 9%	4.95
			Total No Tax 0%	0.00
			TOTAL USD	869.95

Terms

EMISSION CONTROL WORK ORDER



KILLER OIL COMPANY
 7101 Wilton Ave.
 SEBASTOPOL, CA 95472
 (707) 829-5098
 ARD 00232581 EPA# CAL000-033-659

059078

Date: 10/1/2019
 Time Received: _____
 AM P.M.
 Promised: _____
 AM P.M.
 Written By: _____



BILLING
 CASH \$53.00
 BANK CARD NO.
 OIL CO CARD NO.
 CHECK NO.
 OTHER

Address: [Redacted]
 City: 26
 Year - Model: 99 BMW
 Vin No: _____
 Apt. No: _____
 Odometer: 115600
 License No: 91NV681

Phone when ready: Yes No
 Res: _____
 Bus: _____
 Inspector: _____
 Mech: _____

ALL PARTS ARE NEW UNLESS OTHERWISE DESIGNATED		REPAIR ORDER LABOR INSTRUCTION	
QTY. *	PART NO. OR DESCRIPTION	PRICE	AMOUNT
	* CODE N-NEW U-USED R-REBUILT		
	I/M SMOG INSPECTION		
	I/M SMOG CERTIFICATE		
	We are a TEST ONLY facility & can NOT perform any repairs or adjustments to your vehicle if it fails.		
	Smog inspection fee is due whether your vehicle passes, fails, or aborts.		
	NO CHECKS ON FAILED INSPECTIONS		
	\$10.00 DISCOUNT ON RETESTS		
	VALID FOR 90 DAYS.		
	TOTAL PARTS		

THIS IS TO ADVISE YOU THAT SOME EMISSION CONTROL DEVICES MAY STILL BE COVERED UNDER MFG. S WARRANTY. BY LAW, YOU MAY CHOOSE ANOTHER LICENSED SMOG CHECK FACILITY TO PERFORM ANY NEEDED REPAIRS OR ADJUSTMENTS THAT THE SMOG CHECK TEST INDICATES ARE NECESSARY.

I hereby authorize the above repair work to be done along with the necessary material, and hereby grant you and/or your employees, permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event an attorney is retained to foreclose this lien or to bring suit for collection of any sums due I agree to pay costs of collection and reasonable attorney fees.

Authorized By: _____ CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF _____ DATE _____ TIME _____

ESTIMATE: 44.25
 INSPECTION FEE
 CERTIFICATE IF ISSUED 8.25

RETURN OLD PARTS Y N

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

TOTAL ESTIMATE 53.00

TOTAL LABOR
 PARTS
 OIL & FLUIDS
 SUB-TOTAL 53
 TAX
 GAS / GAL.
TOTAL AMOUNT 53.00

ESTIMATED COST \$ OF ADDITIONAL REPAIR _____
 X INITIALS _____
 IND. CONTACTED _____
 TIME _____ DATE _____
 PHONE NO. 217 2539
 ECO 674-3 (3)



Smog Check Vehicle Inspection Report (VIR)



Vehicle Information

www.esp-global.com

www.autorepair.ca.gov

Test Date/Time: 10/01/2019@12:07:35

Model Year:	1999	Make:	BMW	Model:	M COUPE
License:	6TNU681	State:	CA	VIN:	WBSCM9337XLC60282
Engine Size:	3.20 L	Type:	Passenger Car	Transmission:	Manual
GVWR:	N/A	Test Weight:	3431	Cylinders:	6
Odometer:	115,868	Certification:	California	VLT Record #:	28528
Fuel Type:	Gasoline	Exhaust:	Single	Inspection Reason:	High Emitter Profile

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: QY358533

DMV ID Number: 8392Y529Q642

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test.)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	Not applicable	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	Pass	OBD System Checks
Not applicable	EGR Visual	Pass	Vacuum Lines to Sensors / Switches	Pass	Carb. / Fuel Injection
Not applicable	EGR Functional	Not applicable	Ignition Timing	Pass	Other Emission Related Components
Not applicable	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Not applicable	Fuel Cap Visual	Not applicable	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls	Bypass	Fuel Evaporative Controls Functional		

ASM Emission Test Results

Test	RPM	%CO2		%O2		HC (PPM)		CO (%)			NO (PPM)			Results
		MEAS	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	
15 mph	1717	15.9	0.0	54	9	44	0.50	0.03	0.04	434	67	57	Pass	
25 mph	1909	15.8	0.0	38	6	20	0.48	0.03	0.03	721	62	20	Pass	

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information

MILLER OIL COMPANY
7101 Wilton Ave. Sebastopol, CA. 95472
707-829-5098
Station Number: TC239581

Technician Name/Number: NGUYEN, ANTHONY/EO149883
Repair Tech Name/Number:
Software Version/EIS Number: 1904 / EP729594

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

10/01/2019
Date

Technician's Signature

SMOG CHECK VEHICLE INSPECTION REPORT

(09/12/2017 @ 4:11:28 pm)

Vehicle Information

Model Year..... 1999	Make..... BMW	Model..... M COUPE
License..... 6TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
MPG..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Odometer..... 113095	Certification..... California	VLD Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Test BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(8369D020H512)
Smog Check Certificate Number..(HD117626)

Your Smog Check certificate has been electronically transmitted to the DMV.
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests.

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
Oil	Pass	Fuel Evaporative Controls	Pass	Catalytic Converter	Pass
Spark Controls	Pass	Fuel Injection	Pass	Pump Air Injection	Pass
Oxygen Sensor	Pass	Mixing to Sensors	Pass	Vacuum lines sensors/switches	Pass
Other related emis. components	Pass	Liquid Fuel Leak	Pass	Fuel Cap Visual	Pass
HO System Check	Pass	Ignition Timing	N/A		

ASM Emission Test Results

Test	RPM	%CO2		HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
ME: 15 MPH	1703	15.2	0.0	54	9	52	0.50	0.03	0.06	434	67	172	Pass
ME: 25 MPH	1947	15.3	0.0	38	6	11	0.48	0.03	0.01	721	62	24	Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured


Smog Check Station Information

BRINKLY SMOG 185 PINER RD #A SAN JOAQUIN, CA 95403 (916) 578-7864	Technician Name/Number..... COMMONS, RONNIE/EO635288 Repair Tech Name/Number..... N/A Software Version/EIS Number..... 1401/SX091061 Station Number..... RC259182
----------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.



 Date

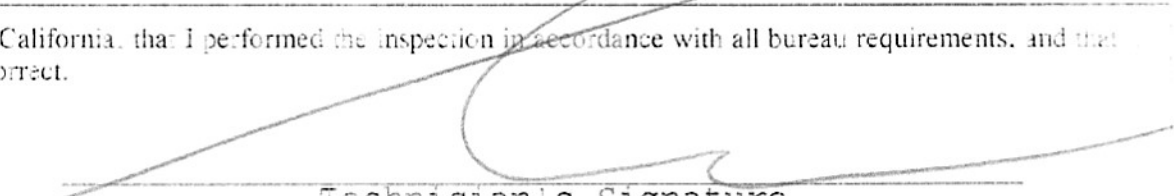

 Technician's Signature

Hammond Autowerks
 4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

19666

Org. Est. # 057697

INVOICE

Work Completed : 08/23/2018 Date: 08/24/2018

1999 BMW - M Coupe - 3.2L, In-Line6 (192CI) VIN(3)
 Lic # : 6TNU681 Odometer In : 114706

Sebastopol, CA 95472
 Cellular 70 39 -- Work 70

VIN# : WBSCM9337 **XLC60282**

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Oil Filter Kit - w/ O-Ring 11 42 7 833 769	1.00	24.13	24.13	Perform Basic Service *	72.50
ENGINE OIL M5w30	6.90	7.99	55.13	Front brake pads 9mm, rear brake pads 3mm, brake fluid >4% moisture, both say bar link boots torn, valve cover gasket leaking, front tires 7mm, rear tires 7mm, all tires have inner edge wear, recommend alignment	
Halogen H-1 - 55w H1/55W H1	1.00	12.87	12.87	* Includes: Oil and filter change, basic brake inspection and fluid testing (rotor measuring may be extra), lamp inspection and bulb replacement (most vehicles), suspension inspection, basic battery inspection and testing, top off washer fluid, check all fluids (if applicable), check wiper blades, check tire wear, check and adjust spare tire pressure, check engine air and cabin filters (on most vehicles), check for leaks, check drive belt.	
Valve Cover Seal Washer 11 12 1 437 395	15.00	1.15	17.25		
Valve Cover Gasket Set w/o Washers 11 12 0 034 108	1.00	49.95	49.95		
CRC Brakleen Size: 14 OZ. 05050	2.00	8.36	16.72	Check and adjust tire pressure to vehicle specification. Front tires 32psi, rear tires 35psi	n/c
				Per customer, needs radio on/off knob Knob is no longer available through BMW or aftermarket sources. Found a few options on Ebay coming from out of the country.	n/c
				Per customer, has head light bulb out - check and replace as needed Found connector for right low beam burnt and can longer make good contact. Removed wires from burnt connector. Ran wires directly to headlight and wrapped with heat shrink and zip tied in place. Also installed new bulb at this time.	72.50
				Per customer, estimate cost of new original shifter knob and hand brake pull Parts are available, quoted customer.	n/c
				VALVE COVER GASKET - Remove & Replace - All Applicable Models Removed ignition coils, removed valve cover, replaced all seals, Cleaned valve cover, re assembled.	261.00
				Alignment Toe Only Found front camber and toe uneven, rear camber and toe uneven. The only Stock adjust ability is with the front toe. Set front toe evenly within manufactures spec. Suggest replacing front upper strut mounts with adjustable mounts, rear control arm bushings and or adjustable arms for rear camber/toe adjustment.	72.50
				PROPELLER SHAFT COUPLING - Remove & Install- Front Removed exhaust, removed drive shaft, removed flex disc, with transmission in gear there is minor play in trans output shaft flange, checked flange nut but it was tight. Re assembled and engaged/disengaged clutch while car was in gear to listen for noise. Verified noise is inside and toward the output shaft side of the transmission.	290.00
				Hazardous Materials	5.00

Hammond Autowerks
 4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

19666

Org. Est. # 057697

INVOICE

Work Completed : 08/23/2018 Date: 08/24/2018

1 1999 BMW - M Coupe - 3.2L, In-Line6 (192CI) VIN(3)
 Lic # : 6TNU681 Odometer In : 114706
 Sebastopol, CA 95472
 Cellular : 9 -- Work : VIN# : WBSCM9337 XLC60282

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate 163.60 Revisions 832.15 Current Estimate 995.75

Revision # 1 Previous Estimate Amount 163.60 Additional Cost 460.67 Revised Estimate 624.27 Parts \$67.82 Labor \$377.00 Sublet \$0.00 Taxes & Fees \$15.85 Authorized by - Stamp James Date - 8/21/2018 Time - 9:41 AM, Initiated By - Shop Written By - Brady Marc Reason - valve cover leaks alignment for tire we. Phone Number - Cellular 707-217-2539
 Revision # 2 Previous Estimate Amount 624.27 Additional Cost 76.48 Revised Estimate 700.75 Parts \$12.87 Labor \$72.50 Sublet \$0.00 Taxes & Fees \$-8.89 Authorized by - Stamp James Date - 8/21/2018 Time - 9:41 AM, Initiated By - Shop Written By - Brady Marc Reason - valve cover leaks alignment for tire we. Phone Number - Cellular 707-217-2539
 Revision # 3 Previous Estimate Amount 700.75 Additional Cost 295.00 Revised Estimate 995.75 Parts \$0.00 Labor \$290.00 Sublet \$0.00 Taxes & Fees \$5.00 Authorized by - Stamp James Date - 8/23/2018 Time - 8:20 AM, Initiated By - Customer Written By - Brady Marc Reason - clunking noise in trans output. Phone Number - Customer Called In

Labor:	768.50
Parts:	176.05
HazMat:	5.00
SubTotal:	949.55
Tax:	15.18
Total:	964.73
Bal Due:	\$0.00

[Payments - Visa - \$964.73]

Vehicle Received: 8/17/2018

Customer Number : 8169

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Upon notification of completion of repairs, a \$50 per day storage fee will be charged

A \$150 per day fee will be charged should a Loaner Car not be returned on the agreed upon day.

Signature _____ Date _____

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

47044

Org. Est. # 141784
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 09/13/2017

1999 BMW - M Coupe - 3.2L, In-Line6 (192CI) VIN(3)
 Lic # :6TNU681 - CA Odometer In : 113041

Home : Office : VIN# : LC60282

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
OIL FILTER S50/S52/S54- OX187D 11427833769	1.00	18.67	18.67	CHECK POOR RUNNING.	155.00
SEAL RING 07111963355	1.00	0.65	0.65	ALL MONITORS ARE CLEAR. CHECK OXYGEN SENSORS. SENSORS ARE READING PROPERLY. CHECK FUEL ADAPTATIONS. FUEL ADAPTATIONS ARE GOOD. CHECK SPARK PLUGS AND IGNITION COILS. COILS ARE GOOD, SPARK PLUGS ARE BOSCH SUPER AND WORN. INSTALL NEW SPARK PLUGS AND RECHECK	
MOBIL 1 5W40- LL01 83212365946	7.00	9.95	69.65	SMOG TEST	75.00
FUSE 7.5 AMP 61131372630	1.00	0.92	0.92	OIL AND FILTER CHANGE.	77.50
FUSE 10 AMP 61131372631	2.00	0.92	1.84	CHANGE ENGINE OIL AND FILTER, CHECK COOLING SYSTEM FOR LEAKS, CHECK ALL APPLICABLE FLUIDS. CHECK DRIVE BELTS, CHECK AND SET TIRE PRESSURES. ROAD TEST VEHICLE.	
SPARK PLUG BKR6EQUP 3199 12129071003	6.00	20.43	122.58	CHECK ALL LIGHTS EXTERIOR.	77.50
BRAKE FLUID 01BF	1.00	15.40	15.40	RIGHT FRONT HEAD LIGHT IS OUT. FOUND BLOWN FUSE. INSTALL NEW FUSE. VEHICLE HAS SHORT AT RIGHT HEAD LIGHT. CHECK WIRING. FOUND CONNECTOR RUBBING ON FRAME RAIL. TAPE CONNECTION AND RECHECK. LIGHT IS WORKING AT THIS TIME	
BRAKE CLEAN 01B	1.00	9.60	9.60	CHECK AUXILLARY CONNECTION AND UPDATE FOR NEW IPHONE?	0.00
CLUTCH SLAVE CYLINDER 21526775924	1.00	99.45	99.45	NEED TO ORDER ADAPTER CABLE	
CLUTCH HOSE 21521159714	1.00	116.36	116.36	CHECK DASH LIGHTS	0.00
PEDAL BUSHING 35211158290	2.00	2.52	5.04	FOUND BLOWN FUSE. DASH LIGHTS ARE WORKING PROPERLY	
				CHECK STIFF SHIFT INTO FIRST WHEN COLD, LAST SHOP CHANGED OUT WITH 70W80MTL	0.00
				REPLACE SPARK PLUGS	124.00
				CLUTCH MASTER CYLINDER, REPLACE CLUTCH PEDAL BUSHINGS AT SAME TIME	372.00
				REMOVE LOWER DASH PANEL, UNBOLT MASTER CYLINDER FROM CLUTCH PEDAL AND MOUNT, REMOVE FEED HOSE, AND HYDRAULIC LINE. REPLACE MASTER CYLINDER, REINSTALL ALL OF THE ABOVE, REFILL SYSTEM AND BLEED, ROAD TEST.	
				Hazardous Materials	6.00
				[Recommendations] FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 7MM REAR BRAKES 8MM VALVE COVER GASKET SEEPING CLUTCH WORN	

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

47044

Org. Est. # 141784
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 09/13/2017

Home : _____ Office : _____ VIN# : LC60282
 ,411 1999 BMW - M Coupe - 3.2L, In-Line6 (192CI) VIN(3)
 Lic # :6TNU681 - CA Odometer In : 113041

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate 490.09 Revisions 980.23 Current Estimate 1,470.32

Revision # 1, Previous Estimate Amount: 490.09, Additional Cost: 980.23, Revised Estimate: 1470.32, Parts: \$363.39 Labor: \$573.50 Sublet: \$0.00 Taxes & Fees: \$43.34
 Authorized by - STAMP, JAMES, Date - 9/12/2017, Time - 2:36 PM, Initiated By - Shop, Written By - ROW, MATTHEW

Labor:	806.00
Parts:	460.16
Sublet:	75.00
HazMat:	6.00
SubTotal:	1,347.16
Tax:	39.63
Total:	1,386.79
Bal Due:	\$1,386.79

[Payments -]

Vehicle Received: 9/13/2017

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

049132

EMISSION CONTROL WORK ORDER

MILLER OIL COMPANY
 7101 Wilson Ave.
 SEBASTOPOL, CA 95472
 (707) 829-5098
 ARD 00239601 EPA# CAL000-000-558



BILLING CASH BANK CARD NO. OIL CO. CARD NO. CHECK NO. OTHER

Name: paid Apt. No. LA

Address: Sebastopol Zip: 95472

City: Sebastopol Odometer: 113076

Year - Model: 99 BMW License No.: 6-TNU081

Vin No.:

* CODE N-NEW U-USED R-REBUILT		PRICE	AMOUNT
QTY. *	PART NO. OR DESCRIPTION		
	<u>air</u>		
	<u>filter</u>		
	<u>oil</u>		
	<u>parts</u>		
	TOTAL PARTS		
	I/M SMOG INSPECTION		<u>49.75</u>
	I/M SMOG CERTIFICATE		<u>8.25</u>
	We are a TEST ONLY facility & can NOT perform any repairs or adjustments to your vehicle if it fails.		<u>coupon - 5.00</u>
	Smog inspection fee is due whether your vehicle passes, fails, or aborts.		
	NO CHECKS ON FAILED INSPECTIONS		
	\$10.00 DISCOUNT ON RETESTS		
	VALID FOR 90 DAYS.		

ALL PARTS ARE NEW UNLESS OTHERWISE DESIGNATED

REPAIR ORDER LABOR INSTRUCTION

INTERNAL

Time Received: 09/06/2017 A.M. P.M.

Promised: A.M. P.M.

Written By:

Phone when ready: Yes No

Bus: _____ Inspector: _____ Mech: _____

TOTAL LABOR: _____

PARTS: _____

OIL & FLUIDS: _____

SUB-TOTAL: 44.75

TAX: _____

GAS / GAL: _____

TOTAL AMOUNT: 844.75

THIS IS TO ADVISE YOU THAT SOME EMISSION CONTROL DEVICES MAY STILL BE COVERED UNDER MFG.'S WARRANTY. BY LAW, YOU MAY CHOOSE ANOTHER LICENSED SMOG CHECK FACILITY TO PERFORM ANY NEEDED REPAIRS OR ADJUSTMENTS THAT THE SMOG CHECK TEST INDICATES ARE NECESSARY.

I hereby authorize the above repair work to be done along with the necessary material, and hereby grant you and/or your employees, permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event an attorney is retained to foreclose this lien or to bring suit for collection of any sums due, I agree to pay costs of collection and reasonable attorney fees.

Authorized By: _____ DATE: _____ TIME: _____

CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF

ESTIMATE: INSPECTION FEE 49.75 RETURN OLD PARTS Y N

CERTIFICATE IF ISSUED 8.25

TOTAL ESTIMATE 8.00

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X INITIALS _____

ESTIMATED COST \$ OF ADDITIONAL REPAIR _____ DATE _____ TIME _____ CONTACTED _____

PHONE NO. 217 2539

ECO 674-3 FILE COPY (3)

Invoice No.

000040617

Order Date 03/23/16 05:23 pm
Completed: 03/24/16 10:33 am

Ref: Loaner

2728 Guerneville Road – Santa Rosa, CA 95401 –
707/546-3409 – Fax 707/546-7215 – www.tillmansgermancar.com

121_ _ _ _ _
SEBASTOPOL CA 95472

Home Phone: 7
Cell Phone: 707_ _ _ _ _

99 BMW M3 RED
Mileage in:111369 out:
Lic: 6TNU681/CA L6Cyl 3.2 Eng
Vin: WBSCM9337XLC60282 08/98
Eq: AC PS FI DC
Last in 10/13/2015

INVESTIGATE NO START **Labor: \$120.00**




CUSTOMER NOTES THE CAR HAS BEEN SITTING FOR THREE MONTHS. CHARGE AND TEST BATTERY. TEST BATTERY AND REPORT. INSTALL NEW BATTERY. TEST STARTING AND SHARGING SYSTEMS-OK. CHECK FLUIDS AND TIRE PRESSURE.

MTPH6	INTERSTATE BATTERY	1.0 @	149.00 =\$	149.00	149.00
					Job Subtotal: \$269.00

Recommendations: *Minor Service* E36 S52 / RADIO CODE 13212 / TIRE SIZE FRONT 225 45 R17, REAR 245 40 R17 / FRONT BRAKES 9mm / REAR BRAKES 4mm / TIRES @ 5/32" / NO SERVICE BOOK / DRY COOLANT RESIDUE @ THERMO HOUSING / DRIVE LINE HAS SMALL 'CLUNK' / THANK YOU

Payments to Tillman's German Car Specialists	Cost Summary	
Status: Completed Work Order	Labor	120.00
Payments:	Parts	149.00
	Enviro. Fee	1.99
	Subtotal	270.99
	Tax	12.29
	Total	\$283.28
	Payments	0.00
	Bal Due	283.28

Thank you for choosing Tillman's German Car Specialists

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE		ALL PARTS REMOVED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE <input type="checkbox"/> SAVE <input type="checkbox"/> DISCARD	
B.A.R. #AA122125	  	By signing below, I hereby authorize the repair work to be done along with the necessary material, and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing, inspection, and/or delivery. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this: these pages connected with this vehicle. I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. Customer is hereby notified that the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage.	
E.P.A. #CAL000004581	WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS	CUST. SIG	I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.
I acknowledge notice and oral approval of an increase in the original estimated price. <input checked="" type="checkbox"/>		CUSTOMER ACKNOWLEDGMENT	

SMOG CHECK VEHICLE INSPECTION REPORT

(10/23/2015 @ 4:42:04 pm)

Vehicle Information

Model Year..... 1999	Make..... BMW	Model..... M COUPE
License..... 6TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Odometer..... 109762	Certification..... California	VLT Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(8377Y129P372)
Smog Check Certificate Number..(PY516218)

Your Smog Check certificate has been electronically transmitted to the DMV.
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Visual.....	Pass
BP System Check.....	Pass	Ignition Timing.....	N/A		

ASM Emission Test Results

Test	RPM			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	%CO2	%O2	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1783	15.1	0.0	54	9	52	0.50	0.03	0.00	434	67	20	Pass
M2: 25 MPH	1925	14.9	0.0	38	6	20	0.48	0.03	0.02	721	62	6	Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

THE MILLER OIL COMPANY A
7101 WILTON AVE - TEST ONLY STATION
SEBASTOPOLE, CA 95472
707 829 5098

Technician Name/Number..... NGUYEN, ANTHONY/EO149883
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1401/SX031177
Station Number..... TE239581

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

10/23/2015

Date

Technician's Signature

POST CATALYTIC CONVERTER REPAIR.

SMOG CHECK VEHICLE INSPECTION REPORT

(10/12/2015 @ 11:54:04 am)

Vehicle Information

Year..... 1999	Make..... BMW	Model..... M COUPE
VIN..... 5TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
MPG..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Mileage..... 109721	Certification..... California	VLT Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Test BAR File #..... N/A		

Overall Test Results

Repairing your vehicle is necessary to help California reduce smog-forming emissions and reach our air quality goals.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Fail)

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

Visual Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests.

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
Spark Controls.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Oxygen Sensor.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Other related emis. components.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches.....	Pass
ECU System Check.....	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Visual.....	Pass
		Ignition Timing.....	N/A		

ASM Emission Test Results

Test	RPM			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1693	14.9	0.1	54	9	162	0.50	0.03	0.38	434	67	374	Fail
M2: 25 MPH	1949	14.9	0.0	38	6	38	0.48	0.03	0.07	721	62	44	Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Failed smog check? Financial assistance may be available. To get an application, visit the Bureau of Automotive Repair's website at www.smogcheck.ca.gov or call toll-free at 800.952.5210.

Si usted ha fallado el examen de smog, asistencia financiera puede estar disponible. Para obtener una solicitud, visite www.smogcheck.ca.gov o llamenos a BAR al 800.952.5210.


Smog Check Station Information

MILLER OIL COMPANY A 101 WILSON AVE - TEST ONLY STATION BAKERSFIELD, CA 93311 Phone: 805-338-8888	Technician Name/Number..... NGUYEN, ANTHONY/EO149883 Repair Tech Name/Number..... N/A Software Version/EIS Number... 1401/SX031177 Station Number..... TB239581
------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

10/12/2015

Date


Technician's Signature

REPAIR

EMISSION CONTROL WORK ORDER



MILLER OIL COMPANY
 7101 Wilton Ave.
 SEBASTOPOL, CA 95472
 (707) 829-5098
 APID 00239581 EPA# CAL000-033-659



039258

Date: 10/23/2015
 Time Received: 10:23 AM
 Promised: AM
 Written By: AM
 P.M.

CASH
 BANK CARD NO. USA
 OIL CO. CARD NO.
 CHECK NO.
 OTHER

Name: _____ Address: _____ City: Sebastopol Zip: 95472
 Year - Model: 99 BMW Odometer: 109762
 License No.: 6FNU681

Phone when ready: Yes No
 Res: _____ Bus: _____ Inspector: _____
 Mech: _____

ALL PARTS ARE NEW UNLESS OTHERWISE DESIGNATED

QTY. *	PART NO. OR DESCRIPTION	PRICE	AMOUNT	REPAIR ORDER LABOR INSTRUCTION	INTERNAL
				I/M SMOG INSPECTION	49.75
				I/M SMOG CERTIFICATE	8.25
				<u>104084</u>	-10.00
				<u>YDC</u>	
				<u>AW</u>	
				<u>193173</u>	
				TOTAL PARTS	

THIS IS TO ADVISE YOU THAT SOME EMISSION CONTROL DEVICES MAY STILL BE COVERED UNDER MFG.'S WARRANTY. BY LAW, YOU MAY CHOOSE ANOTHER LICENSED SMOG CHECK FACILITY TO PERFORM ANY NEEDED REPAIRS OR ADJUSTMENTS THAT THE SMOG CHECK TEST INDICATES ARE NECESSARY.

I hereby authorize the above repair work to be done along with the necessary material, and hereby grant you and/or your employees, permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs hereon. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event an attorney is retained to foreclose this lien or to bring suit for collection of any sums due I agree to pay costs of collection and reasonable attorney fees.

Authorized By: _____ CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF: _____ DATE: _____ TIME: _____

TOTAL LABOR	
PARTS	
OIL & FLUIDS	
SUB-TOTAL	48
TAX	
GAS / GAL.	
TOTAL AMOUNT	48.00

ESTIMATE: INSPECTION FEE 39.75
 CERTIFICATE IF ISSUED 8.25
TOTAL ESTIMATE 48.00

RETURN OLD PARTS Y N

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

ESTIMATED COST \$ OF ADDITIONAL REPAIR: _____ DATE: _____ TIME: _____
 X INITIALS: _____
 IND. CONTACTED: _____ PHONE NO.: 217 2539

SMOG CHECK VEHICLE INSPECTION REPORT

(10/23/2015 @ 4:42:04 pm)

Vehicle Information

Model Year..... 1999	Make..... BMW	Model..... M COUPE
License..... 6TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Odometer..... 109762	Certification..... California	VLT Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason.... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(8377Y129P372)
Smog Check Certificate Number..(PY516218)

Your Smog Check certificate has been electronically transmitted to the DMV.
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Visual.....	Pass
OBD System Check.....	Pass	Ignition Timing.....	N/A		

ASM Emission Test Results

Test	RPM			%CO2			%O2			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1783	15.1	0.0	54	9	52	0.50	0.03	0.00	434	67	20	Pass						
M2: 25 MPH	1925	14.9	0.0	38	6	20	0.48	0.03	0.02	721	62	6	Pass						

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

THE MILLER OIL COMPANY A
7101 WILTON AVE - TEST ONLY STATION
SEBASTOPOL, CA 95472
1 707 829 5098

Technician Name/Number..... NGUYEN, ANTHONY/EO149883
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1401/SX031177
Station Number..... TE239581

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

10/23/2015

Date

Technician's Signature

Invoice No.
000039865

Order Date 10/13/15 02:41 pm
Completed: 10/20/15 09:03 am

Ref: Loaner

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

1 SEBASTOPOL CA 95472 Home Phone: Cell Phone: 707	99 BMW M3 RED Mileage in:109731 out: Lic: 6TNU681/CA L6Cyl 3.2 Eng Vin: WBSCM9337XLC60282 08/98 Eq: AC PS FI DC Last in 1/15/2015
----------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------

BMW MINOR SERVICE Labor: \$118.00

Vehicle Passenger Compartment Function Test: *Horn, Headlamp Flasher, Hazard Flasher, Turn Signals *Warning / Indicator Lamps, Illumination and Interior Lighting *Exterior Lighting including Headlamps *Headlamp Cleaning System *Windshield Wipers, Rear Window Wiper, Windshield Washer System *Check Seatbelts for Proper Function *Reset FSS Counter in Instrument Cluster *Inspect/Test Battery and Print Report Using Mid-tronics ED-18 Analyzer
 Wheels - Brakes: *Remove & Reinstall Wheels (if needed) to Inspect Brake Lining Thickness Front & Rear *Visually Inspect Brake Rotors *Inspect Tires for Damage & Condition *Measure Tread Depth in MM & Record *Correct Tire Inflation Pressure.
 Engine Compartment: *Engine Oil & Filter Change *Check & Correct Fluid Levels of the Following Systems: Engine Cooling System, Anti-Freeze & Corrosion Protection, Brake Hydraulic System, Windshield Washer *Lubricate Catch, Safety Catch & Hinges on Engine Hood
 Trunk: *Correct Tire Inflation Pressure in Spare Tire (if needed)
 *Check for Additional Vehicle Work Needed by Mileage / Time According to Factory Recommendations.

A	WINDSHIELD WASHER FLUID	1.0 @	2.79 =\$	2.79	
FE	ELF Total 5W/30 Synth.	7.0 @	8.39 =\$	58.73	
11 42 7 833 769	Oil Filter Kit Insert -	1.0 @	17.69 =\$	17.69	
007603-012110	Seal Ring	1.0 @	2.00 =\$	2.00	81.21
					Job Subtotal: \$199.21

INVESTIGATE FAILED SMOG \$120.00

CHECK OVER AND ADVISE. NEEDS CATALYTIC CONVERTERS.

Job Subtotal: \$120.00

REPLACE CATS Sublet: \$1,000.00
 INSTALL CATALYTIC CONVERTERS

INVESTIGATE 'CLUNK' NOISE \$60.00

INSPECT AND REPORT. DRIVELINE MAKES A LITTLE NOISE BUT NOT A RELIABILITY ISSUE, JUST AUDIBLE THIS TIME. WOULD NOT BE CONCERNED.

Job Subtotal: \$60.00

Recommendations: E36 S52 / RADIO CODE 13212 / TIRE SIZE FRONT 225 45 R17, REAR 245 40 R17 / FRONT BRAKES 9mm / REAR BRAKES 4mm / TIRES @ 5/32" / NO SERVICE BOOK / DRY COOLANT RESIDUE @ THERMO HOUSING / DRIVE LINE HAS SMALL 'CLUNK' / THANK YOU

----->----->----->---Continued on the next page--->----->----->----->

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE A.R. #AA122125 P.A. #CAL00004681 WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS I acknowledge notice and oral approval of increase in the original estimated price. <input checked="" type="checkbox"/>	ALL PARTS REMOVED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE <input type="checkbox"/> SAVE <input type="checkbox"/> DISCARD By signing below, I hereby authorize the repair work to be done along with the necessary material and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing, inspecting and/or delivery. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this page (page connected with this vehicle). I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. Customer is hereby notified that the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage. DUST <input checked="" type="checkbox"/> SIG <input checked="" type="checkbox"/>
CUSTOMER ACKNOWLEDGMENT I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.	

TILLMAN'S

GERMAN CAR SPECIALISTS

Invoice No.

000039865

AUDI BMW MERCEDES BENZ VW MINI COOPER
Page 2

Order Date 10/13/15 02:41 pm
Completed: 10/20/15 09:03 am

Ref: Loaner

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

Payments to Tillman's German Car Specialists

Status: Completed Work Order

Payments:

Cost Summary

Labor	298.00
Parts	81.21
Sublet	1000.00
Enviro. Fee	1.99
Subtotal	1381.20
Tax	6.70
Total	\$1387.90
Payments	0.00
Bal Due	1387.90

Thank you for choosing Tillman's German Car Specialists

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE

A.P. #44122125

P.A. #CAL000004581



WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS

I acknowledge notice and oral approval of
increase in the original estimated price.

X

CUSTOMER ACKNOWLEDGMENT

ALL PARTS PROVIDED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE SAVE DISCARD

By signing below, I hereby authorize the repair work to be done along with the necessary material, and hereby grant your employees permission to operate the vehicle
herein described on streets, highways or elsewhere for the purpose of testing, inspection, and/or delivery. If automobile is returned to customer before authorized service
is performed, a diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this three
pages connected with this vehicle. I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. Customer is hereby notified that
the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage.

CUSTOMER

SIGNATURE

I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.

READ IMPORTANT INFORMATION ON REVERSE SIDE

SMOG CHECK VEHICLE INSPECTION REPORT

(10/12/2015 @ 11:54:04 am)

Vehicle Information

Model Year..... 1999	Make..... BMW	Model..... M COUPE
License..... 6TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Odometer..... 109721	Certification..... California	VLT Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Repairing your vehicle is necessary to help California reduce smog-forming emissions and reach our air quality goals.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Fail)

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Visual.....	Pass
OED System Check.....	Pass	Ignition Timing.....	N/A		

ASM Emission Test Results

Test	RPM		%CO2	HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1693	14.9	0.1	54	9	162	0.50	0.03	0.38	434	67	374	Fail
M2: 25 MPH	1949	14.9	0.0	38	6	38	0.48	0.03	0.07	721	62	44	Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Failed smog check? Financial assistance may be available. To get an application, visit the Bureau of Automotive Repair's website at www.smogcheck.ca.gov or call toll-free at 800.952.5210.

Si usted ha fallado el examen de smog, asistencia financiera puede estar disponible. Para obtener una solicitud, visite www.smogcheck.ca.gov o llamenos a BAR al 800.952.5210.

Smog Check Station Information

THE MILLER OIL COMPANY A
7101 WILTON AVE - TEST ONLY STATION
SEBASTOPOL, CA 95472
1 707 829 5098

Technician Name/Number..... NGUYEN, ANTHONY/E0149883
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1401/SX031177
Station Number..... TE239581

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

10/12/2015
Date


Technician's Signature

000010

EMISSION CONTROL WORK ORDER

MILLER OIL COMPANY
 7101 Wilson Ave.
 SEBASTOPOL, CA 95472
 (707) 829-5098
 AND 00239581 EPA# CAL000-033-659



Date 10/12/2015
 Time Received
 A.M. P.M.
 Promised
 A.M. P.M.
 Written By

BILLING

CASH
 BANK CARD NO.
 OIL CO CARD NO.
 CHECK NO.
 OTHER

Name _____ Apt. No. _____
 Address _____
 City Sebastopol Zip 95472
 Year - Model 99 BMW Odometer _____
 Vin No. _____ License No. 9TNU681

Phone when ready Yes No
 Res. Bus. _____
 Inspector _____
 Mech. _____

ALL PARTS ARE NEW UNLESS OTHERWISE DESIGNATED

* CODE N-NEW U-USED R-REBUILT		PRICE	AMOUNT
QTY. *	PART NO. OR DESCRIPTION		
	I/M SMOG INSPECTION		49.75
	I/M SMOG CERTIFICATE		8.25
	We are a TEST ONLY facility & can NOT perform any repairs or adjustments to your vehicle if it fails.		
	Smog inspection fee is due whether your vehicle passes, fails, or aborts.		
	NO CHECKS ON FAILED INSPECTIONS		
	\$10.00 DISCOUNT ON RETESTS		
	TOTAL PARTS		

REPAIR ORDER LABOR INSTRUCTION

INTERNAL

TOTAL LABOR
 PARTS
 OIL & FLUIDS
 SUB-TOTAL
 TAX
 GAS / GAL.
 TOTAL AMOUNT

THIS IS TO ADVISE YOU THAT SOME EMISSION CONTROL DEVICES MAY STILL BE COVERED UNDER MFG.'S WARRANTY. BY LAW, YOU MAY CHOOSE ANOTHER LICENSED SMOG CHECK FACILITY TO PERFORM ANY NEEDED REPAIRS OR ADJUSTMENTS THAT THE SMOG CHECK TEST INDICATES ARE NECESSARY.

I hereby authorize the above repair work to be done along with the necessary material, and hereby grant you and/or your employees, permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event an attorney is retained to foreclose this lien, you agree to pay costs of collection and reasonable attorney fees.

Authorized By _____ DATE _____ TIME _____
 CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF

ESTIMATE: 49.75
 INSPECTION FEE
 CERTIFICATE IF ISSUED 8.25
TOTAL ESTIMATE 58.00

RETURN OLD PARTS Y N

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

ESTIMATED COST \$ OF ADDITIONAL REPAIR _____
 X INITIALS _____
 IND. CONTACTED _____
 DATE _____ TIME _____

PHONE NO. 217 2529

TILLMAN'S

GERMAN CAR SPECIALISTS

Invoice No.
000038353

AUDI BMW MERCEDES BENZ VW MINI COOPER
Page 1

Order Date 01/15/15 02:32 pm
Completed: 02/03/15 12:42 pm

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

IE SEBASTOPOL CA 95472 Home Phone: 707- Cell Phone: 707-	99 BMW M3 RED Mileage in:107272 out: Lic: 6TNU681/CA L6Cyl 3.2 Eng Vin: WBSCM9337XLC60282 08/98 Eq: AC PS FI DC Last in 1/14/2015
------------------------------------------------------------------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------

REPLACE LOCK CYLINDER Labor: \$216.00

INSTALL DOOR LOCK AND TRIM.

61216946333	DOOR LOCK	1.0 @	170.00 =\$	170.00	
51 21 1 977 669	Door Handle Gasket	1.0 @	4.65 =\$	4.65	174.65
				Job Subtotal: \$390.65	

REPLACE KEY Labor: \$0.00

PROVIDE KEY AND CODE TO CAR.

51218374064	KEY	1.0 @	170.00 =\$	170.00	170.00
				Job Subtotal: \$170.00	

REMOVE BUG INSIDE HEADLIGHT \$0.00

REMOVE BUG.

Job Subtotal: \$0.00

Recommendations: RADIO CODE 13212 / TIRE SIZE FRONT 225 45 R17, REAR 245 40 R17 / FRONT BRAKES 9mm / REAR BRAKES 4mm / TIRES @ 5/32" / NO SERVICE BOOK / DRY COOLANT RESIDUE AT THERMOSTAT HOUSING / THANK YOU

Payments to Tillman's German Car Specialists **Cost Summary**

Status: Completed Work Order

Payments:

Labor	216.00
Parts	344.65
Enviro. Fee	1.99
Subtotal	562.64
Tax	28.43
Total	\$591.07
Payments	0.00
Bal Due	591.07

Thank you for choosing Tillman's German Car Specialists

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE S.A.R. #AA122125 E.P.A. #CAL000004561 WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS I acknowledge notice and oral approval of an increase in the original estimated price <input checked="" type="checkbox"/>	ALL PARTS REMOVED WILL BE PROTECTED UNLESS NOTIFIED OTHERWISE - DO NOT SAVE OR DISCARD I acknowledge receipt of and agree to the terms and conditions of this contract CUSTOMER ACKNOWLEDGMENT
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

12 E
SEBASTOPOL CA 95472
Home Phone: _____
Cell Phone: 707-_____

99 BMW M3 RED
Mileage in:107041 out:
Lic: 6TNU681/CA L6Cyl 3.2 Eng
Vin: WBSCM9337XLC60282 08/98
Eq: AC PS FI DC
Last in 4/10/2014

BMW MINOR SERVICE Labor: \$141.60

Vehicle Passenger Compartment Function Test: *Horn, Headlamp Flasher, Hazard Flasher, Turn Signals
*Warning / Indicator Lamps, Illumination and Interior Lighting *Exterior Lighting including Headlamps
*Headlamp Cleaning System *Windshield Wipers, Rear Window Wiper, Windshield Washer System *Check
Seatbelts for Proper Function *Reset FSS Counter in Instrument Cluster *Inspect/Test Battery and Print
Report Using Mid-tronics ED-18 Analyzer
Wheels - Brakes: *Remove & Reinstall Wheels (if needed) to Inspect Brake Lining Thickness Front & Rear
*Visually Inspect Brake Rotors *Inspect Tires for Damage & Condition *Measure Tread Depth in MM & Record
*Correct Tire Inflation Pressure.
Engine Compartment: *Engine Oil & Filter Change *Check & Correct Fluid Levels of the Following Systems:
Engine Cooling System, Anti-Freeze & Corrosion Protection, Brake Hydraulic System, Windshield Washer
*Lubricate Catch, Safety Catch & Hinges on Engine Hood
Trunk: *Correct Tire Inflation Pressure in Spare Tire (if needed)
*Check for Additional Vehicle Work Needed by Mileage / Time According to Factory Recommendations.

11 42 7 833 769	Oil Filter Kit - w/ O-Ri	1.0 @	17.69 =\$	17.69
007603-012110	Seal Ring	1.0 @	2.00 =\$	2.00
A11	POWER SOLVENT	1.0 @	3.98 =\$	3.98
MO	MOTUL 5/40 SYNTHETIC	6.3 @	7.99 =\$	50.34
A	WINDSHIELD WASHER FLUI	0.5 @	2.79 =\$	1.40
				75.41
				Job Subtotal: \$217.01

REPLACE ENGINE COVER PLATE Labor: \$0.00

INSTALL VALVE COVER COVER PLATE. NO CHARGE.

11 12 1 726 089	Access Cover Plate on Va	1.0 @	2.42 =\$	2.42	2.42
				Job Subtotal: \$2.42	

CHECK FRONT SIDE LIGHT Labor: \$0.00

REPLACE FRONT SIDE LIGHT BULB AND REAR LICENSE LIGHT BULBS.

2825	12V 5W BULB	2.0 @	3.85 =\$	7.70	7.70
				Job Subtotal: \$7.70	

CHECK KEY-STICKEY \$24.00

----->----->----->---Continued on the next page--->----->----->----->

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE I.A.R. #AA122125 I.P.A. #CAL000004581 WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS I acknowledge notice and oral approval of an increase in the original estimated price. <input checked="" type="checkbox"/>	ALL PARTS REMOVED WILL BE STORED ON OUR INSURED SERVICE LIFT AND PLACED By signing below, I hereby authorize the repair work to be done along with the necessary material and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing, inspection, and/or delivery. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this these pages (connected with this vehicle). I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. Customer is hereby notified that the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage. JUST SIGN _____ I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

TILLMAN'S

GERMAN CAR SPECIALISTS

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

Invoice No.
000038348

AUDI BMW MERCEDES BENZ VW MINI COOPER
Page 2
Order Date 01/14/15 04:40 pm
Completed: 01/15/15 12:14 pm

CHECK KEY-STICKEY

LUBE LOCK CYLINDER. TRY KEY IN IGNITION, RIGHT DOOR AND TRUNK. RECOMMEND A NEW LOCK CYLINDER AND KEY.

Job Subtotal: \$24.00

RADIO KNOB

\$0.00

COULD NOT FIND A KNOB. WILL KEEP TRYING TO FIND A NEW ONE OR A GOOD USED.

Job Subtotal: \$0.00

Recommendations: RADIO CODE 13212 / TIRE SIZE FRONT 225 45 R17, REAR 245 40 R17 / FRONT BRAKES 9mm / REAR BRAKES 4mm / TIRES @ 5/32" / NO SERVICE BOOK / DRY COOLANT RESIDUE AT THERMOSTAT HOUSING / THANK YOU

Payments to Tillman's German Car Specialists

Status: Completed Work Order

Payments:

Cost Summary

Labor	165.60
Parts	85.52
Enviro. Fee	1.99
Subtotal	253.11
Tax	7.06
Total	\$260.17
Payments	0.00
Bal Due	260.17

Thank you for choosing Tillman's German Car Specialists

ALL PARTS REQUIRED WILL BE GUARANTEED OR REPLACED AT OUR OPTION UNLESS OTHERWISE NOTED

By signing below, I hereby authorize the repair work to be done along with the necessary material, and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing, inspection, and/or delivery. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this/these pages (connected with this vehicle). I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. Customer is hereby notified that the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage.

acknowledge notice and oral approval of an increase in the original estimated price. CUSTOMER ACKNOWLEDGMENT

I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.

REP REPAIR ORDER

SEEMAS AUTO CARE, 241130 BUDGET, 1116

051 Paluma Ave,
 Sebastopol, CA 95472-4746
 Phone (707) 823-8451

DESCRIPTION & PARTS NUMBER	AMOUNT
*PARTS INDEX A = Alternmarket N = New U = Used R = Rebuilt	

Name: _____ Date: 5/19/14
 Address: _____ City: _____
 Business Phone: _____ Home Phone: _____

Year: 1999 Make: Oldsmobile Model: 23 Color: Red License: 17W1181 VIN: 1G2B5E1M15337K126288
 OPER INSTRUCTIONS: Repair as Per Estimate Form

HOURS	AMOUNT

DESCRIPTION & PARTS NUMBER	AMOUNT
Sublet	
Total Parts	
Used Parts: <input type="checkbox"/> Return <input type="checkbox"/> Discard	

DESCRIPTION	AMOUNT
SUBLET muffler shop	
TAKE TO " " "	
PICK UP " " "	
ADJUST DOORS	
FIX CELL	
DUB RT DOOR	
CHUTE W/S Open Items	
PARTS	
LABOR	100
FRAME	
PAINT MAT	
BODY MAT	
TOWING	
STORAGE	
SUBLET	100
SUBTOTAL	
TAX	
EPA/WASTE DISPOSAL	
GRAND TOTAL	200

NOT RESPONSIBLE FOR ANY PARTS OR LABOR BEYOND THE ESTIMATE. I hereby authorize the above repair work to be done along with the repair materials. You and your employees may operate the above vehicle for any purpose of testing, inspection or delivery at my risk. I am aware that I am responsible for the knowledge on the above vehicle to ensure the proper use of repairs. I understand that I will be held responsible for loss or damage to vehicle or contents therein in case of fire, theft, accident or any other cause beyond your control. TO BE COMPLETED IN THE EVENT OF AN ACCIDENT OR DAMAGE TO THE VEHICLE. THIS CONTRACT I WILL PAY NEARBY ATTORNEY'S FEES AND COSTS.

SIGNED: _____ Terms: STRICTLY CASH Unless Arrangements Made

Written By	
Received	AM
Printed	PM
Ins. Co.	AM
Ins. Phone	PM
Claim No.	
Adjuster	
Odometer In	10000
Odometer Out	

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

SEBASTOPOL CA 95472	99 BMW M3 RED
Home Phone: 7	Mileage in:104731 out:
?	Lic: 6TNU681/CA L6Cyl 3.2 Eng
	Vin: WBSCM9337XLC60282 08/98
	Eq: AC PS FI DC
	Last in 4/25/2013

BMW MINOR SERVICE Labor: \$118.00

Vehicle Passenger Compartment Function Test: *Horn, Headlamp Flasher, Hazard Flasher, Turn Signals
 *Warning / Indicator Lamps, Illumination and Interior Lighting *Exterior Lighting including Headlamps
 *Headlamp Cleaning System *Windshield Wipers, Rear Window Wiper, Windshield Washer System *Check
 Seatbelts for Proper Function *Reset FSS Counter in Instrument Cluster *Inspect/Test Battery and Print
 Report Using Mid-tronics ED-18 Analyzer
 Wheels - Brakes: *Remove & Reinstall Wheels (if needed) to Inspect Brake Lining Thickness Front & Rear
 *Visually Inspect Brake Rotors *Inspect Tires for Damage & Condition *Measure Tread Depth in MM & Record
 *Correct Tire Inflation Pressure.
 Engine Compartment: *Engine Oil & Filter Change *Check & Correct Fluid Levels of the Following Systems:
 Engine Cooling System, Anti-Freeze & Corrosion Protection, Brake Hydraulic System, Windshield Washer
 *Lubricate Catch, Safety Catch & Hinges on Engine Hood
 Trunk: *Correct Tire Inflation Pressure in Spare Tire (if needed)
 *Check for Additional Vehicle Work Needed by Mileage / Time According to Factory Recommendations.

11 42 7 833 769	Oil Filter Kit	1.0 @	16.35 =\$	16.35	
007603-012110	Seal Ring	1.0 @	2.00 =\$	2.00	
MO	MOTUL 5/40 SYNTHETIC	7.0 @	7.99 =\$	55.93	
A11	POWER SOLVENT	1.0 @	3.98 =\$	3.98	78.26
					Job Subtotal: \$196.26

REPLACE BULBS IN A/C DISPLAY Labor: \$96.00

REMOVE A/C HEAD AND REPLACE 2 BULBS.

61138353797	BULB	2.0 @	12.08 =\$	24.16	24.16
					Job Subtotal: \$120.16

REPLACE EXHAUST BRACKET \$0.00

SEE MUFFLER SHOP FOR REPAIR.

Job Subtotal: \$0.00

CHECK RATTLE GLOVEBOX TRIM PIECE Labor: \$48.00

----->----->----->-----Continued on the next page----->----->----->----->

<p>ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE</p> <p>LA.R. #AA122125</p> <p>LA.PA. #CAL000004581</p> <p>WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS</p> <p>acknowledge notice and oral approval of increase in the original estimated price. <input checked="" type="checkbox"/></p> <p>CUSTOMER ACKNOWLEDGMENT</p>	<p>ALL PARTS PROVIDED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE</p> <p>SAVE TO BOARD</p> <p>I acknowledge receipt of and agree to the terms and conditions of this contract.</p>
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

CHECK RATTLE GLOVEBOX TRIM PIECE

SECURE TRIM PIECE AND ALIGN GLOVE BOX.

Job Subtotal: \$48.00

CHECK CLOCK AND RADIO

\$72.00

INTERMITTENTLY GOES OUT. SCAN FOR CODES. CLEAN AND TIGHTEN BATTERY CABLES.

Job Subtotal: \$72.00

CHECK CIGAR LIGHTER

\$0.00

CHECK POWER AND GROUND-OK. MUST BE A BAD ADAPTER.

Job Subtotal: \$0.00

REPLACE BULB AT LEFT FRONT

\$0.00

REPLACE BULB AT LEFT FRONT WITH OWNERS BULB.

Job Subtotal: \$0.00

REPLACE REAR WIPER BLADE

Labor: \$0.00

REPLACE REAR WIPER BLADE.

41 915	Window Wiper Blade	1.0 @	15.75 =\$	15.75	15.75
--------	--------------------	-------	-----------	-------	-------

Job Subtotal: \$15.75

REPLACE BACK UP LIGHT SWITCH

Labor: \$96.00

REPLACE BACK UP LIGHT SWITCH. CHECK FLUID LEVEL.

23 14 7 524 811	Back Up Light Switch	1.0 @	16.87 =\$	16.87	16.87
-----------------	----------------------	-------	-----------	-------	-------

Job Subtotal: \$112.87

REPLACE BELTS AND IDLER PULLEY


Labor: \$240.00

REPLACE FAN BELTS AND TENSIONERS.

11 28 7 841 228	Acc. Belt Idler Pulley	1.0 @	52.10 =\$	52.10	
5PK-0906	Multi Rib Belt	1.0 @	32.04 =\$	32.04	
6PK-1555	Multi Rib Belt	1.0 @	42.73 =\$	42.73	
11 28 1 717 210	A/C Belt Tensioner Hyd	1.0 @	99.99 =\$	99.99	
11 28 1 748 131	Acc. Belt Tension Pulley	1.0 @	51.13 =\$	51.13	277.99

Job Subtotal: \$517.99

----->----->----->---Continued on the next page--->----->----->----->

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE		ALL PARTS REMOVED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE	
A.R. #AA122125 PA #CAL600004581			
WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS		I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT	
I acknowledge notice and oral approval of increase in the original estimated price. X		CUSTOMER ACKNOWLEDGMENT	

728 Guerneville Road - Santa Rosa, CA 95401 -
07/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

BRAKE FLUID FLUSH

Labor: \$94.40

RENEW BRAKE FLUID AND POWER BLEED COMPLETE BRAKE SYSTEM. THIS SERVICE SHOULD BE DONE EVERY 2 YEARS OR WHEN MOISTURE CONTENT IS MORE THAN 2%.

A35	SUPER DOT 4 ATE	3.0 @	7.99 =\$	23.97	23.97
					Job Subtotal: \$118.37

Recommendations: radio code 13212 / FRONT BRAKES 10mm / REAR BRAKES 8mm / FRONT AND REAR TIRES @ 6/32" / NO SERVICE BOOK / REAR WINDSHIELD WASHER INOP / DRY COOLANT RESIDUE AT THERMOSTAT HOUSING / EXHAUST BRACKET AT REAR MISSING / THANK YOU

Payments to Tillman's German Car Specialists

Cost Summary

Status: Completed Work Order

Payments:


Labor	764.40
Parts	437.00
Enviro. Fee	1.99
Subtotal	1,203.39
Tax	36.05
Total	\$1,239.44
Payments	0.00
Bal Due	1,239.44

Thank you for choosing Tillman's German Car Specialists

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE

ALL PARTS REMOVED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE SAVE DISCARD

I.A.R. #AA122125



I.P.A. #CAL000004587

WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS

I acknowledge notice and oral approval of increase in the original estimated price

X

CUSTOMER ACKNOWLEDGMENT

By signing below, I hereby authorize the repair work to be done using all the necessary material and parts, grant my employee permission to operate the vehicle, and I understand that the vehicle is being repaired for the purpose of restoring it to its original condition and appearance. I understand that the vehicle is being repaired for the purpose of restoring it to its original condition and appearance. I understand that the vehicle is being repaired for the purpose of restoring it to its original condition and appearance. I understand that the vehicle is being repaired for the purpose of restoring it to its original condition and appearance.

Just

I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.

EMISSION CONTROL WORK ORDER



MILLER OIL COMPANY

7101 Wilton Ave.
SEBASTOPOL, CA 95472
(707) 829-5098
ARD 00239581 EPA# CAL000-033-653



027749

Date	
Time Received	
Promised	A.M. P.M.
Written By	

BILLING	<input type="checkbox"/> CASH	Name			PHONE	Phone when ready		
	<input type="checkbox"/> BANK CARD NO.	Address				Yes <input type="checkbox"/> No <input type="checkbox"/>	Res.	
	<input type="checkbox"/> OIL CO. CARD NO.	City				Zip	Bus.	
	<input type="checkbox"/> CHECK NO.	Year - Model				Odometer	Inspector	
	<input type="checkbox"/> OTHER	Vin No.				License No.	Mech.	

ALL PARTS ARE NEW UNLESS OTHERWISE DESIGNATED				REPAIR ORDER LABOR INSTRUCTION				INTERNAL	
* CODE N-NEW U-USED R-REBUILT				I/M SMOG INSPECTION					
I/M SMOG CERTIFICATE									
QTY.	*	PART NO. OR DESCRIPTION	PRICE	AMOUNT	<p>We are a TEST ONLY facility & can NOT perform any repairs or adjustments to your vehicle if it fails.</p> <p>Smog inspection fee is due whether your vehicle passes, fails, or aborts.</p> <p>NO CHECKS ON FAILED INSPECTIONS</p>				
		TOTAL PARTS							

THIS IS TO ADVISE YOU THAT SOME EMISSION CONTROL DEVICES MAY STILL BE COVERED UNDER MFG.'S WARRANTY.
BY LAW, YOU MAY CHOOSE ANOTHER LICENSED SMOG CHECK FACILITY TO PERFORM ANY NEEDED REPAIRS OR ADJUSTMENTS THAT THE SMOG CHECK TEST INDICATES ARE NECESSARY.

I hereby authorize the above repair work to be done along with the necessary material, and hereby grant you and/or your employees, permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event an attorney is retained to foreclose this lien or to bring suit for collection of any sums due I agree to pay costs of collection and reasonable attorney fees.

Authorized By _____ CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF _____ DATE _____ TIME _____

ESTIMATE:
INSPECTION FEE _____
CERTIFICATE IF ISSUED _____

TOTAL ESTIMATE _____

RETURN OLD PARTS Y N

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X INITIALS _____

ESTIMATED COST \$ OF ADDITIONAL REPAIR _____ DATE _____ TIME _____ IND. CONTACTED _____ PHONE NO. _____

TOTAL LABOR	
PARTS	
OIL & FLUIDS	
TAX	
GAS / GAL.	
TOTAL AMOUNT	

SMOG CHECK VEHICLE INSPECTION REPORT

(10/17/2013 @ 12:58:08 pm)

Vehicle Information

Model Year..... 1999	Make..... BMW	Model..... M COUPE
License..... 6TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Odometer..... 104135	Certification..... California	VLT Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Dual	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(8874A123P872)
Smog Check Certificate Number..(PA372228)

Your Smog Check certificate has been electronically transmitted to the DMV.
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Integrity Test.....	Pass
Fuel Cap Visual.....	Pass	Malfunction Indicator Light....	Pass	Ignition Timing.....	N/A

ASM Emission Test Results

Test	RPM	%CO2		HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1737	15.1	0.1	54	9	48	0.50	0.03	0.05	434	67	72	Pass
M2: 25 MPH	1947	15.0	0.1	38	6	11	0.48	0.03	0.00	721	62	22	Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information


THE MILLER OIL COMPANY A
7101 WILTON AVE - TEST ONLY STATION
SEBASTOPOL, CA 95472
1 (707) 829-5098

Technician Name/Number..... NGUYEN, ANTHONY/E0149883
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1201/SX031177
Station Number..... TE239581

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

10/17/13

Date

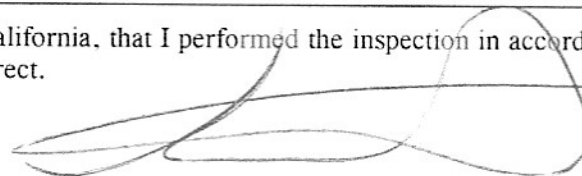

Technician's Signature

REPAIR ORDER

GS TUNING
 955 SANTA ROSA AVE.
 SANTA ROSA, CA 95404
 707-284-2680

BAR # ARD00257173

J _____
 1: _____
 Sebastopol, CA 95472
 Home: 82 _____
 Work: _____
 Other: _____

R/O # : 16125
 Name : _____
 Date : 09/27/2013
 License # : 6TNU681
 Make : BMW
 Model : M COUPE M Coupe
 Year : 1999
 Odometer In: 101414 Save Parts : NO
 Unit # : LC60282
 VIN : WBSCM9337XLC60282

Customer Complaint / Service to Perform
 Perform wheel balance.

LABOR	TECH	AMOUNT
Balanced all four wheels.	EL	35.00
	Job Sub-Total	35.00

Customer Complaint / Service to Perform
 Check fluid levels.

LABOR	TECH	AMOUNT
Checked rear-end, transmission fluid, engine oil, coolant, and washer fluid. All good and clean.	EL	.00
	Job Sub-Total	.00

Original Estimate : 35.00

	Increases to Estimate						
Date	Time	OK'd By	Phone	Emp.	Increase		

LABOR	35.00
PARTS	.00
SUBLETS	.00
Environmental Recycling	.00
FREIGHT	.00
SUB TOTAL	35.00
TAX	.00
TOTAL	35.00

Amount Received : 0.00 Balance : 35.00

Parts and labor warranty for 12 months or 12,000 miles which ever comes first

I hereby authorize the above named business to perform the repair work listed above along with necessary materials. You and your employees may operate the above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs. Thereto it is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, repair, or while road testing. Any vehicle left 48 hours after repairs completed are subject to \$40 a day storage fee unless arrangements have been made with manager. All estimated prices valid for 30 days only.

Authorized by : _____ Date : _____



MEMBER PURCHASE INVOICE

Date: 05/08/13 Invoice #: 6590127062
 Time In: 13:41:34
 Membership #: 303440223000

MEMBER INFORMATION	VEHICLE INFORMATION
1 SEBASTOPOL, CA 95472-4452	1999 BMW M Coupe Standard Front Color: RED License: Odometer: Wheel Torque: 88 Air Pressure: Front: 29 Rear: 29

ITEM#	DESCRIPTION	Qty	SLIP PRINT
476071	MICHELIN PILOT SPORT 2 ULTRA HIGH PERFORMANCE 225/45R17 91Y ZP BSW MSPN 83653 20,000 Mile Warranty	2	***SPECIAL ORDER*** * MEMBER #303440223000 * TIRESHIP ORDER # 0006590127062 * PRICE QTYRD 2 @ 245.99 * 476071 225/45R17PS2 491.98 * 2 @ 1.75 * CA STATE TIR 3.50 * PRICE QTYRD 2 @ 14.00 * INT/BALANCE 28.00 * PRICE QTYRD 2 @ 1.00 * TIRE DISPOSL 2.00 * BUS REPAIR 110.00 * @ 8.75% TAX 43.22 * TOTAL 618.70 * American Express 578.00 * CHANGE .00 * TOTAL NUMBER OF ITEMS SOLD = 2 * CASHIER: JOE B. (TIRES) REG# 95 * 5/08/2013 13:43 0659 95 0022 139
6850	Tire Installation	2	
7023	Disposal Fee	2	



NOTES:

<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	

*Inflation and Torque specifications are recommended by Manufacturer.

___ Best to Spare
 ___ Static ___ Dynamic
 ___ Blackwall ___ Whitewall

JOE B
 Sales Person



MEMBER PURCHASE INVOICE

Date: 05/08/13 Invoice #: 6590127062
 Time In: 13:41:34
 Membership #: 303440223000

MEMBER INFORMATION	VEHICLE INFORMATION
12 SEBASTOPOL, CA 95472-4452	1999 BMW M Coupe Standard Front Color: RED License: Odometer: Wheel Torque: 88 Air Pressure: Front: 29 Rear: 29

ITEM#	DESCRIPTION	Qty	SLIP PRINT
476071	MICHELIN PILOT SPORT 2 ULTRA HIGH PERFORMANCE 225/45R17 91Y ZP BSW MSPN 83653 20,000 Mile Warranty	2	***SPECIAL ORDER*** * MEMBERSHIP ORDER # 6590127062 * DATE PURD 2 @ 245.00 * 476071 225/45R17-10 401.95 @ * 2 @ 1.75 * CA STATE TAX 7.50 * WAREHOUSE 2 @ 14.00 * GRT-BALANCE 78.00 * FRI-DE WYRD 2 @ 1.00 * TIRE DISPOSAL 1.00 @ * 2-15 BLN-24 110.00 * @ 8.75% TAX 43.22 * TOTAL 618.70 * American Express 618.70 * CHANGE .00 * TOTAL NUMBER OF ITEMS SOLD = 2 * CASHIER: JOE B. (TTREB) REC# 95 * 5-08/2013 13:43 0609 95 0032 139
6850	Tire Installation	2	
7023	Disposal Fee	2	



NOTES:

*Inflation and Torque specifications are recommended by Manufacturer.

___ Best to Spare
 ___ Static ___ Dynamic
 ___ Blackwall ___ Whitewall

JOE B
 Sales Person

MEMBER INFORMATION	VEHICLE INFORMATION
1 SEBASTOPOL, CA 95472-4452	1999 BMW M Coupe Standard Front Color: RED License: 6TNU681 Odometer: 100800 Wheel Torque: 88 Air Pressure: Front: 29 Rear: 29

ITEM#	DESCRIPTION	Qty	
476071	MICHELIN PILOT SPORT 2 ULTRA HIGH PERFORMANCE 225/45R17 91Y ZP BSW MSPN 83653 20,000 Mile Warranty	2	***SPECIAL ORDER***
6850	Tire Installation	2	
7023	Disposal Fee	2	

Handwritten notes on invoice:
 new 225/45 2R17 91Y
 front 2 3/4 profile
 rear 2 1/2 profile
 245/40 2R17
 HANKOOK V12 EVO
 95Y
 Korea
 Extra load

D.O.T.#: 4M8A015X4512 4M8A015X4512

NOTES:

<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	

* Follow the direction in your vehicle's owner's manual for rotation and rebalance. In the absence of direction in your vehicle's owner's manual, rotate and rebalance your tires every 7,500 MILES or 12,000 KM.
 * Tires inflated with nitrogen. Nitrogen stabilizes a tires inflation pressure more efficiently than regular air. If needed, air and Nitrogen may be mixed; return to any Costco afterward for purge and refill to the proper Nitrogen purity level.
 * Tire rotation patterns may be limited if a tread depth difference of more than 2/32nds of an inch is present between the front and rear tires of a vehicle.
 * TWO NEW TO FRONT

*Inflation and Torque specifications are recommended by Manufacturer.

___ Best to Spare
 ___ Static ___ Dynamic
 ___ Blackwall ___ Whitewall

JOE B
 Sales Person

JOHNNY BARRAZA
 10-Point Vehicle Release



Click Below
To Live Chat

ORDER TOLL FREE
1.800.924.5172

SELECT YOUR VEHICLE

View Cart (0) My Account Login

Search by Part # or Keyword SEARCH

BMW Z3 M Coupe S54 3.2L > ES#74113 > Shopping Cart > Order Receipt

On Sale | Free Shipping | Clearance | New Items

Order#: 341-586-890

Status - Received
Shipment Tracking

Thank you for your order. Please print this page for your records.

You can track the status of your order from this page. If you have any questions please contact our sales department by email or via telephone (+1-800-924-5172).

Bill to:

Sebastopol, California 95472


Ship to:

SEBASTOPOL, CALIFORNIA

Sebastopol, California 95472

Order:

description



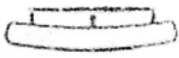
description	quantity	each	total
 Bumper Grille - Center ES#74113 Located in the center of the front bumper <u>51112268644</u>	1	\$68.05	\$68.05

Sub Total: \$68.05

Shipping - (FedEx - Ground): \$12.39

Total: \$80.44

Thanks for shopping with ECS Tuning.



ECS TUNING LINKS

- Home
- ECS News
- View Shopping Cart
- Career Opportunities
- E-News Signup
- Contact Us

MY ACCOUNT

- Email/Past Order
- Billing Information
- Shipping Information
- Order History
- My Account
- My Account Profile

CUSTOMER SERVICE

- Contact Us
- Returns and Exchanges
- Order Status Page
- Privacy Policy
- Terms of Use
- Gift Certificate

SOCIAL MEDIA

- Facebook
- My Tube
- Twitter

Have an ordering or technical question for ECS?

Our trained sales staff can be reached by using LiveChat or you can call toll free.

Invoice No.
000034597

Order Date 04/25/13 03:37 pm
Completed: 04/26/13 02:45 pm

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

SANTA ROSA CA 95401	99 BMW M3 RED
Home Phone:	Mileage in:100291 out:
Work Phone:	Lic: 6TNU681/CA L6Cyl 3.2 Eng
	Vin: WBSCM9337XLC60282 08/98
	Eq: AC PS FI DC
	Profile:

BMW MINOR SERVICE

Labor: \$118.00

Vehicle Passenger Compartment Function Test: *Horn, Headlamp Flasher, Hazard Flasher, Turn Signals *Warning / Indicator Lamps, Illumination and Interior Lighting *Exterior Lighting including Headlamps *Headlamp Cleaning System *Windshield Wipers, Rear Window Wiper, Windshield Washer System *Check Seatbelts for Proper Function *Reset FSS Counter in Instrument Cluster *Inspect/Test Battery and Print Report Using Mid-tronics ED-18 Analyzer
Wheels - Brakes: *Remove & Reinstall Wheels (if needed) to Inspect Brake Lining Thickness Front & Rear *Visually Inspect Brake Rotors *Inspect Tires for Damage & Condition *Measure Tread Depth in MM & Record *Correct Tire Inflation Pressure.
Engine Compartment: *Engine Oil & Filter Change *Check & Correct Fluid Levels of the Following Systems: Engine Cooling System, Anti-Freeze & Corrosion Protection, Brake Hydraulic System, Windshield Washer *Lubricate Catch, Safety Catch & Hinges on Engine Hood
Trunk: *Correct Tire Inflation Pressure in Spare Tire (if needed)
*Check for Additional Vehicle Work Needed by Mileage / Time According to Factory Recommendations.

11 42 7 833 769	Oil Filter Kit	1.0 @	16.35 = \$	16.35
007603-012110	Seal Ring	1.0 @	1.90 = \$	1.90
64150	Headlight Bulb - H1	1.0 @	8.16 = \$	8.16
A11	POWER SOLVENT	1.0 @	2.99 = \$	2.99
BMW SPECIAL	10/60 SYN	7.0 @	9.99 = \$	69.93
				99.33
				Job Subtotal: \$217.33

TRANSMISSION "CLUNKY"

Labor: \$47.20

ROAD TEST AND ADVISE. CHANGE TRANSMISSION OIL AND USE REDLINE SYN GEAR OIL. CAR DRIVE AND SHIFTS AS INTENDED.

50204	Gear Oil MTL 70W-80 GL	2.0 @	14.95 = \$	29.90
				29.90
				Job Subtotal: \$77.10

CIG LIGHTER FUSE INOP

\$0.00

CHECK FOR POWER AND GROUND-OK.

Job Subtotal: \$0.00

Recommendations: FRONT BRAKES 10mm / REAR BRAKES 8mm / FRONT AND REAR TIRES @ 7/32" / RIGHT FRONT TURN SIGNAL AND SIDE LIGHT INOP / GAUGE ON DASH LIGHT IS INOP / NO SERVICE BOOK /

----->----->----->---Continued on the next page--->----->----->----->

A.R. #AA122125 P.A. #CAL00004581		<p>By signing below, I hereby authorize the repair work to be done along with the necessary material, and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing, inspection, and/or driver's license repair. This vehicle is returned to customer before authorized service is performed. A diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this these pages connected with this vehicle. I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. Customer is hereby notified that the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage.</p>
<p>WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS</p> <p>acknowledge notice and oral approval of increase in the original estimated price</p> <p><input checked="" type="checkbox"/></p>	<p>CUSTOMER ACKNOWLEDGMENT</p>	<p>I ACKNOWLEDGE RECEIPT OF AND AGREE TO THE TERMS AND CONDITIONS OF THIS CONTRACT.</p>

TILLMAN'S

GERMAN CAR SPECIALISTS

Invoice No.
000034597

AUDI BMW MERCEDES BENZ VW MINI COOPER Page 2

Order Date 04/25/13 03:37 pm
Completed: 04/26/13 02:45 pm

2728 Guerneville Road - Santa Rosa, CA 95401 -
707/546-3409 - Fax 707/546-7215 - www.tillmansgermancar.com

Recommendations

REAR WINDSHIELD WASHER INOP / DRY COOLANT RESIDUE AT THERMOSTAT HOUSING / EXHAUST BRACKET AT REAR MISSING / BRAKE FLUID FLUSH / THANK YOU

Payments to Tillman's German Car Specialists

Status: Completed Work Order

Payments:

Cost Summary

Labor	165.20
Parts	129.23
Enviro. Fee	1.99
Subtotal	296.42
Tax	10.66
Total	\$307.08
Payments	0.00
Bal Due	307.08

Thank you for choosing Tillman's German Car Specialists

SANTA ROSA AVE - REAR
7000 RD
ATA w/tyler
SPE 60416

[Faint handwritten notes]

ALL PARTS TAKEN FROM VEHICLE ARE THE PROPERTY OF TILLMAN'S GERMAN CAR SPECIALISTS. ALL PARTS MUST BE RETURNED TO TILLMAN'S GERMAN CAR SPECIALISTS WITHIN 30 DAYS OF SERVICE.

A.R. #AA122125
P.A. #CAL000004581

WE RESERVE THE RIGHT TO REFUSE ANY PERSONAL CHECKS

By signing below, I hereby authorize the repair work to be done along with the necessary material and hereby grant your employee permission to operate the vehicle here described on streets, highways or elsewhere for the purpose of testing, inspection and in delivery. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the statements and estimates made on this side and the reverse of this these pages connected with this vehicle. I authorize service to be performed including sublet work and acknowledge receipt of this estimate. Customer is hereby notified that the said property is not insured or protected against loss occasioned by theft, fire or vandalism while the property remains with the Repair Garage.

I acknowledge receipt of and agree to the terms and conditions of this contract.

SMOG CHECK VEHICLE INSPECTION REPORT

(09/06/2017 @ 2:01:37 pm)

Vehicle Information

Model Year..... 1999	Make..... BMW	Model..... M COUPE
License..... 6TNU681	State..... California	VIN..... WBSCM9337XLC60282
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3431 lbs.	Cylinders..... 6
Odometer..... 113076	Certification..... California	VLT Record #..... 28528
Fuel Type..... Gasoline	Exhaust..... Dual	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Repairing your vehicle is necessary to help California reduce smog-forming emissions and reach our air quality goals.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Fail)

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Visual.....	Pass
OBD System Check.....	Pass	Ignition Timing.....	N/A		

ASM Emission Test Results

Test	RPM			%CO2			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS				
M1: 15 MPH	1706	15.3	0.0	54	9	193	0.50	0.03	0.48	434	67	300	Fail			
M2: 25 MPH	1959	14.6	0.0	38	6	24	0.48	0.03	0.02	721	62	17	Pass			

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Failed smog check? Financial assistance may be available. To get an application, visit the Bureau of Automotive Repair's website at www.smogcheck.ca.gov or call toll-free at 800.952.5210.

Si usted ha fallado el examen de smog, asistencia financiera puede estar disponible. Para obtener una solicitud, visite www.smogcheck.ca.gov o llamenos a BAR al 800.952.5210.


Smog Check Station Information

THE MILLER OIL COMPANY A
7101 WILTON AVE - TEST ONLY STATION
SEBASTOPOL, CA 95472
1 707 829 5098

Technician Name/Number..... NGUYEN, ANTHONY/EO149883
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1401/SX031177
Station Number..... TE239581

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

09/06/2017
Date



Technician's Signature

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820
 Independent BMW Specialists

INVOICE

31547
 Org. Est. # 102954
 EPA#000004766
 BAR#AB137993

INVOICE

Print Date : 06/29/2012

Home 7
 Cust ID : 6411 Ref # :

1999 BMW - M Coupe
 3.2L, In-Line6, VIN (3), 5SP
 Lic # : 6TNU681 Odometer In : 97113
 Unit # :
 Vin # : **LC60282**
 Hat # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
MOBILE ONE 5W-30 SYNTHETIC 07510017866	8.00	9.95	79.60	OIL AND FILTER - SYNTHETIC	60.00
OIL FILTER S50/S52/S54 11427833769	1.00	15.24	15.24	CHANGE ENGINE OIL AND FILTER, CK TIRE PRESSURES, CK FLUIDS, CK CONDITION OF VEHICLE	
SEAL RING 07111963355	1.00	0.65	0.65	***Discount*** \$35.00 off labor	
				Hazardous Materials	6.00
				**** Recommendations **** FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 10MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID THERMOSTAT HAS COOLANT STAINS BRAKE FLUID FLUSH	

Org. Estimate \$134.61 Revisions \$0.00 Current Estimate \$ 134.61 Additional Cost Revised Estimate

Labor:	66.00
Parts:	95.49
Sublet:	0.00
Discount:	-35.00
Sub:	126.49
Tax:	8.12
Total:	134.61
Bal Due:	\$134.61

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

REPAIR ORDER

GS TUNING
1264 LOTUS CT.
SANTA ROSA, CA 95404
707-284-2680

bar # ard00257173

R/O # : 13776
Name : Stamp
Date : 12/14/2011
License # : 6TNU681
Make : BMW
Model : M COUPE M Coupe
Year : 1999
Odometer In: 94138 Save Parts : NO

Sebastopol, CA 95472

Unit # : LC60282
VIN : WBSCM9337XLC60282

H
Work:
Other:

Customer Complaint / Service to Perform

Customer requests leaking rear shocks replaced

LABOR

Replaced rear shocks. Found that vehicle has upgrade Rogue Engineering shock mounts installed so they were reused. Also found that most of the rear interior panels are lined with Dynamat. All ok at this time. Cost of this job was covered by Metric Motors.

	TECH	HRS	AMOUNT
--	------	-----	--------

	EF		.00
--	----	--	-----

PARTS

33522228358	BILSTEIN SHOCK ABOSRBER		
-------------	-------------------------	--	--

	PRICE	QTY	AMOUNT
	.00	2	.00

	- Job Sub-Total	.00
--	-----------------	-----

- sticky RMS front
- DS side tire weak
not round

Customer Complaint / Service to Perform

Customer requests leaking shifter seal replaced.

LABOR

Replaced shifter rod seal and cleaned. All ok at this time. Cost of this repair was covered by Metric Motors.

	TECH	HRS	AMOUNT
--	------	-----	--------

	EF		.00
--	----	--	-----

PARTS

23 12 1 282 394	SHIFT SHAFT SEAL		
-----------------	------------------	--	--

	PRICE	QTY	AMOUNT
	.00	1	.00

	Job Sub-Total	.00
--	---------------	-----

TRY
ROAD
PURGE
Balance

Customer Complaint / Service to Perform

Customer requests cracked front control arm bushings replaced.

LABOR

Replaced front control arm bushings with upgraded 95 M3 solid offset bushings. Alignment performed after tie rod replacement. Cost of this repair was covered by Metric Motors.

	TECH	HRS	AMOUNT
--	------	-----	--------

	EF		.00
--	----	--	-----

PARTS

31129064875	CONTROL ARM BUSHING KIT		
-------------	-------------------------	--	--

	PRICE	QTY	AMOUNT
	.00	1	.00

	Job Sub-Total	.00
--	---------------	-----

Customer Complaint / Service to Perform

Customer requests both tie rod assemblies replaced and alignment performed.

LABOR

Replaced both tie rod assemblies and performed wheel alignment. Test drove. All ok at this time. Cost of this repair was covered by Metric Motors.

	TECH	HRS	AMOUNT
--	------	-----	--------

	EF		.00
--	----	--	-----

PARTS

32111139315	TIE ROD ASSEMBLY		
-------------	------------------	--	--

	PRICE	QTY	AMOUNT
	.00	1	.00

REPAIR ORDER

GS TUNING
1264 LOTUS CT.
SANTA ROSA, CA 95404
707-284-2680

bar # ard00257173

1
Sebastopol, CA 95472
Home:
Work:
Other:

R/O # : 13776
Name : Stamp
Date : 12/14/2011
License # : 6TNU681
Make : BMW
Model : M COUPE M Coupe
Year : 1999
Odometer In: 94138
Save Parts : NO

Unit # : LC60282
VIN : WBSCM9337XLC60282

32 11 1 139 316	TIE ROD ASSY	.00	1	.00
32111140464	TIE ROD LOCK PLATE	.00	2	.00
Job Sub-Total				.00

Customer Complaint / Service to Perform
Customer requests left front wheel straightened.

LABOR

	TECH	HRS	AMOUNT
Sent wheel out to be straightened and touched up. All ok at this time. Metric Motors to cover cost of this repair.			.00

	AMOUNT
SUBLETS Pacific Rim Repair	.00
Job Sub-Total	.00

Customer Complaint / Service to Perform
Customer requests leaking power reservoir, suction, and return hoses replaced.

LABOR

	TECH	HRS	AMOUNT
Replaced power steering reservoir and low pressure hoses. Replaced hose clamps and seals. Filled with new fluid and bled. All ok at this time.	EF		220.00

	PRICE	QTY	AMOUNT
PARTS 32 41 1 097 164 P/S RESERVOIR	39.95	1	39.95
32 41 1 138 419 P/S SUCTION HOSE	34.68	1	34.68
32411094558 P/S RETURN HOSE	34.11	1	34.11
ATF SWEPCO ATF	8.49	2	16.98
Parts Sub-Total			125.72
Job Sub-Total			345.72

Customer Complaint / Service to Perform
Customer requests brake fluid flush

LABOR

	TECH	HRS	AMOUNT
Performed brake fluid flush.	EF		110.00

	PRICE	QTY	AMOUNT
PARTS DOT 4 BRAKE FLUID	19.95	1	19.95
Parts Sub-Total			19.95
Job Sub-Total			129.95

REPAIR ORDER

GS TUNING
1264 LOTUS CT.
SANTA ROSA, CA 95404
707-284-2680

bar # ard00257173

Sebastopol, CA 95472

Home:

Work:

Other:

R/O # : 13776

Page : 3

Name : Stamp

Date : 12/14/2011

License # : 6TNU681

Make : BMW

Model : M COUPE M Coupe

Year : 1999

Odometer In: 94138

Save Parts : NO

Unit # : LC60282

VIN : WBSCM9337XLC60282

Customer Complaint / Service to Perform

Customer requests air filter cleaned.

LABOR

Cleaned K&N air filter.

	TECH	HRS	AMOUNT
--	------	-----	--------

	EF		27.50
--	----	--	-------

	Job Sub-Total		27.50
--	----------------------	--	-------

Customer Complaint / Service to Perform

Customer requests spark plugs replaced.

LABOR

Replaced all spark plugs.

	TECH	HRS	AMOUNT
--	------	-----	--------

	EF		110.00
--	----	--	--------

PARTS

7405	SPARK PLUG OEM BOSCH		
------	----------------------	--	--

	PRICE	QTY	AMOUNT
--	-------	-----	--------

	13.99	6	83.94
--	-------	---	-------

	Parts Sub-Total		83.94
--	------------------------	--	-------

	Job Sub-Total		193.94
--	----------------------	--	--------

Original Estimate : 687.77

Date	Time	Increases to Estimate OK'd By	Phone	Emp.	Increase
------	------	----------------------------------	-------	------	----------

LABOR	467.50
PARTS	229.61
SUBLETS	.00
Environmental Recycling	.00
HAZARDOUS MATERIALS	3.00
FREIGHT	0.00
SUB TOTAL	700.11
TAX	19.52
TOTAL	<u>719.63</u>

Parts and labor warranty for 12 months or 12,000 miles which ever comes first



I hereby authorize the above named business to perform the repair work listed above along with necessary materials. You and your employees may operate the above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs. Thereto it is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, repair, or while road testing. Any vehicle left 48 hours after repairs completed are subject to \$40 a day storage fee unless arrangements have been made with manager. All estimated prices valid for 30 days only.

Authorized by : _____ Date : _____

GS Tuning
1264 Lotus Ct.
Santa Rosa, CA 95403
707.284.2680

Work Order ID R000328
 Customer Number 307
 Name
 License 6TNU681
 Year: 99
 Technician EF
 Mileage 94138
 Time Printed 12/12/11 9:10 AM

BMW : Z3 - E36 (1996 - 2002) : M Coupe

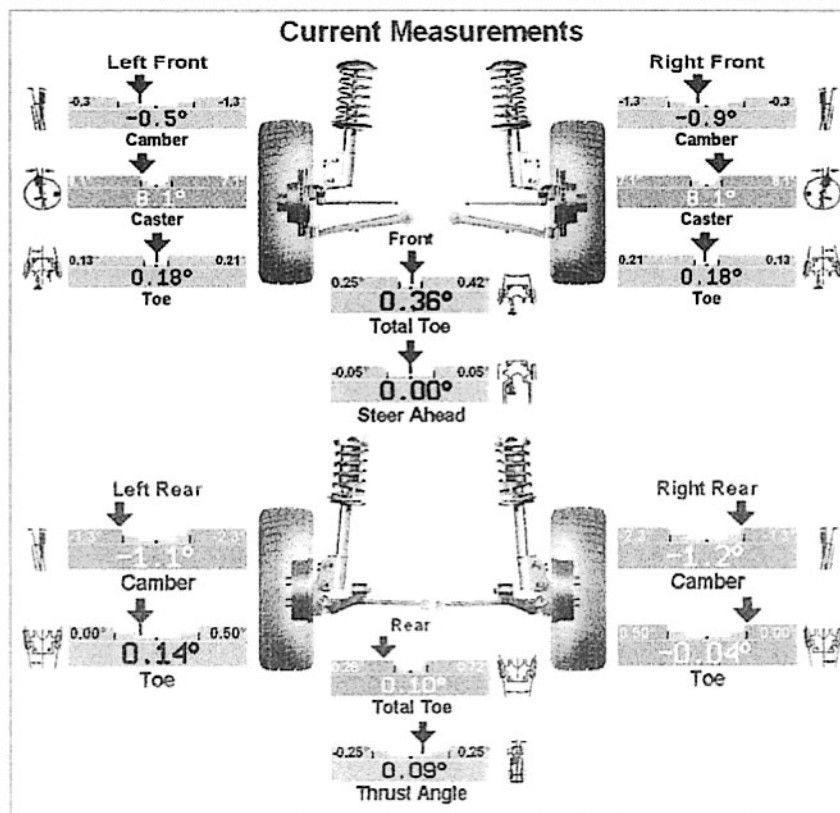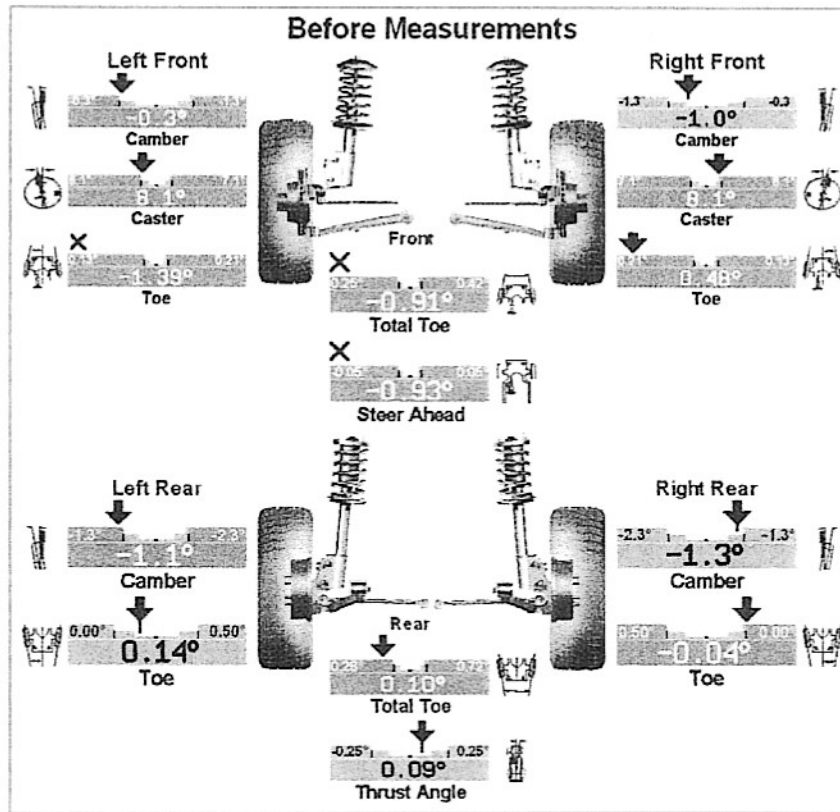

- The steering wheel was not level before the alignment. Toe adjustments are required.
- The steering wheel is currently level.

REPAIR ORDER

GS TUNING
1264 LOTUS CT.
SANTA ROSA, CA 95404
707-284-2680

bar # ard00257173

Sebastopol, CA 95472

Home: }

Work:

Other:

R/O # : 13760
Name : Stamp
Date : 12/02/2011
License # : 6TNU681
Make : BMW
Model : M COUPE M Coupe
Year : 1999
Odometer In: 94031 Save Parts : NO

Unit # : LC60282
VIN : WBSCM9337XLC60282

Customer Complaint / Service to Perform

Customer requests full vehicle inspection.

LABOR

Inspected vehicle and found K&N air filter dirty \$27.50. Transmission shifter seal leaking \$340. Rear shocks leaking \$730. Front control arm bushings cracking \$195. P/S suction line leaking \$415 (both lines and reservoir). Left inner tie rod has play \$290 w/ alignment. Left front wheel has slight bend \$450. Slight coolant leak at radiator vent line. Front lower grille has holes in it. Front brakes 80%, Rear brakes 30%.

TECH HRS AMOUNT

EF 110.00

Job Sub-Total 110.00

Customer Complaint / Service to Perform

Customer states that there is steering vibration at highway speeds.

LABOR

Verified concern. Found vehicle has slight steering shake. Found left inner tie rod has play and left front wheel is slightly bent.

TECH HRS AMOUNT

.00

Job Sub-Total .00

Customer Complaint / Service to Perform

Inspection discount

LABOR

TECH HRS AMOUNT

-110.00

Job Sub-Total -110.00

Customer Complaint / Service to Perform

During customer's visit vehicle's front bumper received damage to the right front. GS Tuning is available for repairs. Customer to make an appointment for repairs.

Job Sub-Total .00

REPAIR ORDER

GS TUNING
1264 LOTUS CT.
SANTA ROSA, CA 95404
707-284-2680

bar # ard00257173

Sebastopol, CA 95472

Home: _____
Work: _____
Other: _____

R/O # : 13760

Page : 2

Name : Stamp

Date : 12/02/2011

License # : 6TNU681

Make : BMW

Model : M COUPE M Coupe

Year : 1999

Odometer In: 94031

Save Parts : NO

Unit # : LC60282

VIN : WBSCM9337XLC60282

Original Estimate : 89.00

Time	OK'd By	Phone	Emp.	Increase
------	---------	-------	------	----------

LABOR	.00
PARTS	.00
SUBLETS	.00
Environmental Recycling	.00
FREIGHT	.00
SUB TOTAL	.00
TAX	.00
TOTAL	.00

or warranty for 12 months or 12,000 miles which ever comes first
I authorize the above named business to perform the repair work listed above along with necessary materials. You and your employees may operate the above vehicle
for testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs. Thereto it is
understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, repair, or while road testing. Any vehicle
repairs completed are subject to \$40 a day storage fee unless arrangements have been made with manager. All estimated prices valid for 30 days only.

Date : _____

REPAIR ORDER

GS TUNING
1264 LOTUS CT.
SANTA ROSA, CA 95404
707-284-2680

bar # ard00257173

R/O # : 13760
Name : Stamp
Date : 12/02/2011
License # : 6TNU681
Make : BMW
Model : M COUPE M Coupe
Year : 1999
Odometer In: 94031 Save Parts : NO

1 _____
Sebastopol, CA 95472
Home: { _____
Work: _____
Other: _____

Unit # : LC60282
VIN : WBSCM9337XLC60282

Customer Complaint / Service to Perform
Customer requests full vehicle inspection.

LABOR

TAX 10% (omit)

Inspected vehicle and found K&N air filter dirty \$27.50, Transmission shifter seal leaking \$340, Rear shocks leaking \$730, Front control arm bushings cracking \$195, P/S suction line leaking \$415 (both lines and reservoir), Left inner tie rod has play \$290 w/ alignment, Left front wheel has slight bend \$450, Slight coolant leak at radiator vent line, Front lower grille has holes in it, Front brakes 80%, Rear brakes 30%.

\$100 bill

TECH	HRS	AMOUNT
EF		110.00
Job Sub-Total		110.00

Customer Complaint / Service to Perform
Customer states that there is steering vibration at highway speeds.

LABOR

Verified concern. Found vehicle has slight steering shake. Found left inner tie rod has play and left front wheel is slightly bent.

TECH	HRS	AMOUNT
		.00
Job Sub-Total		.00

Customer Complaint / Service to Perform
Inspection discount

LABOR

*Robert sand - Fuel filter ok (new)
- Side the. Hugo - ok*

TECH	HRS	AMOUNT
		-21.00
Job Sub-Total		-21.00

Original Estimate : 89.00

Increases to Estimate

Date	Time	OK'd By	Phone	Emp.	Increase

LABOR	89.00
PARTS	.00
SUBLETS	.00
Environmental Recycling	.00
FREIGHT	.00
SUB TOTAL	89.00
TAX	.00
TOTAL	89.00

Parts and labor warranty for 12 months or 12,000 miles which ever comes first
I hereby authorize the above named business to perform the repair work listed above along with necessary materials. You and your employees may operate the above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs. Thereto it is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, repair, or while road testing. Any vehicle left 48 hours after repairs completed are subject to \$40 a day storage fee unless arrangements have been made with manager. All estimated prices valid for 30 days only.

Authorized by : _____ Date : _____

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820
 Independent BMW Specialists

INVOICE

30203

Org. Est. # 098164
 EPA#000004766
 BAR#AB137993

INVOICE

Print Date : 12/01/2011

1999 BMW - M Coupe
 3.2L, In-Line6, VIN (3), 5SP
 Lic # : 6TNU681 Odometer In : 93992
 Unit # :
 Vin # : **LC60282**
 Hat # :
 Home 7
 Cust ID : 6411 Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
				CHECK VIBERATION FROM FRONT END AT ABOUT 55 MPH AND ABOVE. CHECK CONDITION OF VEHICLE ROAD TEST VEHICLE AND CHECK VIBRATION AT 55MPH. VEHICLE HAS SLIGHT STEERING WHEEL VIBRATION. CHECK AND BALANCE FRONT WHEELSE, CHECK FRONT SUSPENSION FOR WORN COMPONENTS. **** Recommendations **** FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 5MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID	60.00

92535.33

[Technicians : MEDRANO, EVODIO]

Org. Estimate \$60.00	Revisions \$0.00	Current Estimate \$ 60.00	Additional Cost	Revised Estimate	Labor: 60.00
					Parts: 0.00
					Sublet: 0.00

					Sub: 60.00
					Tax: 0.00
					Total: 60.00
					Bal Due: \$60.00

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820

Sub Estimate For Order #

030203

EPA#000004766
 BAR#AB137993

Independent BMW Specialists

ESTIMATE FOR SERVICES

Estimate Date : 12/01/2011

Home 7
 Cust Id: 6,411

1999 BMW - M Coupe
 Lic # : 6TNU681
 Unit # :
 VIN # : LC60282
 Odometer In: 93992

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
SPARK PLUG BKR6EK **2288** 12129063428	6.00	10.43	62.58	REPLACE SPARK PLUGS	120.00
FUEL FILTER **KL66** 13321740985	1.00	46.16	46.16	REPLACE FUEL FILTER	36.00
CABIN AIR FILTER E36 64119069895	1.00	38.95	38.95	REPLACE CABIN AIR FILTER	72.00
<p>**** Recommendations ****</p> <p>FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 5MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID</p>					

Parts : \$ 147.69 Labor : \$ 228.00 Tax : \$ 12.55 Total : \$ 388.24

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.


TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts ____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

SIGNATURE..... Date..... Time.....

ROW, MATTHEW

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820

Sub Estimate



EPA#000004766
 BAR#AB137993

Independent BMW Specialists

ESTIMATE FOR SERVICES

Estimate Date : 12/01/2011

1999 BMW - M Coupe
 Lic # : 6TNU681
 Unit # :
 VIN # : LC60282

Odometer In: 93992

Home
 Cust Id: 6,411

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
P/S FILTER 32411097164	1.00	62.98	62.98	REPLACE POWER STEERING RESERVOIR HOSES AND FILTER.	264.00
SWEPCO 715 POWER STEERING FLUID 01715	1.00	18.65	18.65	DRAIN POWER STEERING FLUID, DISCONNECT RESERVOIR HOSES.	
COOLER HOSE 32411141714	1.00	104.02	104.02	REMOVE AND REPLACE FILTER RESERVOIR, REPLACE RESERVOIR HOSES.	
P/S RETURN HOSE 32411138419	1.00	39.22	39.22	FLUSH AND RENEW FLUID AND ROAD TEST VEHICLE.	
AT COOLING HOSE RING 17211742636	1.00	1.44	1.44	**** Recommendations **** FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 5MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID	

Parts : \$ 226.31

Labor : \$ 264.00

Tax : \$ 19.24

Total : \$ 509.55

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts ___. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

SIGNATURE..... Date..... Time.....

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820

Sub Estimate



EPA#000004766
 BAR#AB137993

Independent BMW Specialists

ESTIMATE FOR SERVICES

Estimate Date : 12/01/2011

Home 707
 Cust Id: 6,411

1999 BMW - M Coupe
 Lic # : 6TNU681
 Unit # :
 VIN # : LC60282

Odometer In: 93992

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
TIE ROD ASSEMBLY 32111139315	1.00	132.27	132.27	REPLACE TIE ROD ASSEMBLIES	180.00
TIE ROD ASSEMBLY 32111139316	1.00	132.27	132.27	ADJUST FRONT AND REAR CAMBER, CASTER AND TOE. **** Recommendations **** FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 5MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID	145.00

Parts : \$ 264.54 Labor : \$ 325.00 Tax : \$ 22.49 Total : \$ 612.03

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts ____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

SIGNATURE..... Date..... Time.....

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820

Sub Estimate



EPA#000004766
 BAR#AB137993

Independent BMW Specialists

ESTIMATE FOR SERVICES

Estimate Date : 12/01/2011

S' _____ 1999 BMW - M Coupe
 Lic # : 6TNU681 Odometer In: 93992
 Unit # :
 VIN # : LC60282

Home 7 _____
 Cust Id: 6,411

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
OUTPUT SHAFT SEAL 23121204209	1.00	18.41	18.41	RESEAL REAR OF TRANSMISSION	360.00
SHIFT SHAFT SEAL 23111204223	1.00	9.42	9.42	REMOVE EXHAUST SYSTEM, AND ASSOCIATED SHIELDS.REMOVE DRIVELINE AND REARFLANGE. PULL REAR SEAL, AND SHIFT SHAFT SEAL, AND DETENT COVER,CLEAN AND REINSTALL,REINSTALL ALL OF THE ABOVE	
				**** Recommendations **** FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 5MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID	

Parts : \$ 27.83 Labor : \$ 360.00 Tax : \$ 2.37 Total : \$ 390.20

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts ____ . NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

SIGNATURE..... Date..... Time.....

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820

Sub Estimate



EPA#000004766
 BAR#AB137993

Independent BMW Specialists

ESTIMATE FOR SERVICES

Estimate Date : 12/01/2011

Home 707-545-0820
 Cust Id: 6,411

1999 BMW - M Coupe
 Lic # : 6TNU681
 Unit # :
 VIN # : LC60282
 Odometer In: 93992

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
REAR SHOCK MOUNT 33521092362	2.00	35.20	70.40	REPLACE REAR SHOCKS AND MOUNTS	264.00
SHOCK ABSORBER 33522693756	2.00	134.69	269.38	**** Recommendations **** FRONT TIRES 32PSI REAR TIRES 36PSI FRONT BRAKES 5MM REAR BRAKES 6MM POWER STEERING HOSES LEAKING FRONT TIE RODS ASSEMBLIES HAVE PLAY SHIFT SHAFT SEAL LEAKING REAR SHOCKS LEAKING FLUID	
REAR SHOCK MOUNT GASKET 33526772864	2.00	1.22	2.44		

2535.33

Parts : \$ 342.22 Labor : \$ 264.00 Tax : \$ 29.09 Total : \$ 635.31

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts ____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

SIGNATURE..... Date..... Time.....

COPY TO SRINE S →
COMMERCIAL
OR RT

Oil used: MOBIL 100% fully Synthetic 5:30

Passed smog test on 10.28.11 (report attached)

Results of 10.27.11 pre purchase inspection (report attached)

- Right front running light needs new bulb
- Change brake fluid – dirty
- Change power steering fluid – dirty
- Power steering suction hose leaking fluid
- Exhaust system noisy: heat shield is noisy – bend to stop noise?
- Is K&N fuel filter a problem? Metric motors suggested replacing with MANN \$22 approx air filter. Said something to do with oil/lubrication?????
- Computer code: 074:A/C comp. relay

111

JUST
BEFORE
WEATHER
JOES

100 K service

- Replace fuel filter
- Replace spark plugs
- NOTE: Transmission fluid changed 88245
- NOTE: Differential fluid changed 88245
- Changed valve cover gaskets 90100
- Oil and filter changed 90155, 4.8.11

Other items

- Water pump recently replaced with GRAF water pump with metal impeller. Coolant replaced.
- Recharged AC system 91733.
- Fixed AC including compressor, switch, recharge and relay 93214
- LEMFOERDER tie rod assembly (left) installed at 3.2011. 90300
- CRP-CONITECH serpentine belt/ribbed drive belt: AC compressor installed 3.2011. 90300
- CRP-CONITECH serpentine belt/ribbed drive belt: Alternator/Power steering/water pump installed 3.2011. 90300
- Steering wheel vibration at 60-80mph prompted wheel balance at Firestone, SF on 10.23.11 (see report). This did not correct problem. Re-balanced at Larkin Bros, SF on 10.28.11. Vibration mostly gone.
- Alignment checked and remedied at Firestone on 10-XX-11. Not sure if this done properly (see printout).

Driving observations

Car seems to pull to right. Not sure if this real or imagined.
Some general rattling and road noise. Typical of car/older car??

Inspection II service due???

350-3113
Paint work
not installed

Paul
change

[Redacted]

AC
not
baked
in light

Δ VIBRATION – 60-75
Δ Peaking of tires.

– Both tie rod
ends shot
– Leaks from shifter
plays in sn-o joint.
U Joint

THANK YOU FOR CHOOSING FIRESTONE

JSCM9337XLC60282

10/23/11 5:04 PM

BMW 99-02 E36 Z3 M Coupe

Front : Left

Actual	Before	Specified Range
-0.9°	-0.8°	-1.3° -0.3°
7.4°	7.4°	7.1° 8.1°
0.18°	-0.09°	0.13° 0.21°
15.0°	15.0°	
14.2°	14.2°	
		-1.90° -0.90°

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-0.9°	-1.0°	-1.3° -0.3°
7.3°	7.3°	7.1° 8.1°
0.18°	0.50°	0.13° 0.21°
14.0°	14.0°	
13.0°	13.0°	
		-1.90° -0.90°

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
0.1°	0.2°	-0.5° 0.5°
0.1°	0.1°	-0.5° 0.5°
1.0°	0.9°	
0.35°	0.41°	0.25° 0.42°

Rear : Left

Actual	Before	Specified Range
-1.2°	-1.2°	-2.3° -1.3°
0.05°	0.08°	0.00° 0.50°

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-1.5°	-1.5°	-2.3° -1.3°
0.02°	0.02°	0.00° 0.50°

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	Before	Specified Range
0.2°	0.2°	-0.5° 0.5°
0.07°	0.07°	0.28° 0.72°
0.02°	0.02°	-0.25° 0.25°

Customer Invoice

089320

10/23/2011

FIRESTONE COMPLETE AUTO CARE
1501 MISSION ST
SAN FRANCISCO, CA. 94103-2512

Service Advisor:

01 EDDIE

415.621.4650

SAN FRANCISCO, CA 94103

1999 BMW M COUPE [RED]

Lic #: ACZ2950 CA Vin #: WBSCM9337XLC60282

In: 10/23/11 2:58PM

Mileage: 93,673

Out: 10/23/11 4:55PM

Store # 012645

RETAIL SALE

REG#ARD222593, EPA#CAD981964109

Description	Rev Hist /Article #	ID	Qty	Unit Price	Extended Price	Job Total
LIFETIME WHEEL BALANCE AND TIRE ROTATION (All 4)		01				71.96
Symptom:-						
TIRE ROTATION - NO CHARGE	7001119	06NN	1	N/C	N/C	
LIFETIME WHEEL BALANCE LABOR	7025186	06NN	4	14.00	56.00	
LIFETIME WHEEL BALANCE PARTS	7006038	06TN	4	3.99	15.96	
Rotate the vehicle's tires to a new location on the vehicle using accepted trade standards regarding vehicle and tire type/ check one wheel balance Computer spin balance each tire / wheel assembly						
ALIGNMENT SERVICE		01				89.99
Symptom:-						
ALIGNMENT SERVICE	7004578	06NN	1	89.99	89.99	
Inspect steering and suspension system including tire condition/ balance check one tire and air pressure check Print out final alignment readings to verify alignment is within specifications Road test vehicle before servicing Road test vehicle before and after completing the alignment Put vehicle on alignment rack, mount and compensate sensors, and print out the initial alignment readings Align all four wheels, using adjustments provided by manufacturer, to manufacturer's specification when applicable						
COURTESY CHECK		01				
COURTESY CHECK	7046930	06NN	1	N/C	N/C	
CC - See reverse side of invoice for details of the Courtesy Check						

Technician(s):

06 ERNESTO LOPEZ

Payment History:

American Expres 1000 163.31 520784

Total Tendered 163.31

Summary:

Parts 15.96

Labor 145.99

Shop Supplies 0.00

Sub-Total 161.95

Tax (8.50%) 1.36

Total \$163.31

All CFNA purchase(s) through December 31, 2011 of \$249 or more receive 6 month deferred interest. see www.CFNA.com for more details.

I have received the above goods and/or services. If this is a credit card purchase, I agree to pay and comply with my cardholder agreement with the issuer.

Customer Signature

All parts are new unless otherwise specified.

TELL US ABOUT YOUR EXPERIENCE AND RECEIVE \$10 OFF YOUR NEXT PURCHASE OF \$25 OR MORE!

- 1) For a short survey Call 1-800-859-9203 or logon to www.FirestoneSurvey.com; enter code 012645-089320
- 2) Write redemption code here: _____ Offer expires 6 months from date of invoice, good at all participating locations. Must have valid redemption code. May not be used to reduce existing debt. No copies accepted

COMMITTED TO PROVIDING A POSITIVE CUSTOMER EXPERIENCE

Bavarian Tuning Inc.

BAR #: ALI230718
112 Commercial Ct. #11
Santa Rosa, Ca 95407
Phone: 707 575 3757 FAX: 707 575 4953

Invoice No.
000009533

Page 1
Order Date 11/28/11 08:33 am
Paid: 11/28/11 04:13 pm

12	98 BMW Z3 RED 93958 Mi. Lic: 6TNV681/CA L6Cyl 3.2 Eng Vin: WBSCM9337XLC60282 08/98 Eq: AC PS FI DC Profile:
Home Phone: _____ Mobile: 707-2-_____	

Quotes
1 11/28/11 08:38am 129.88
n person.

Job01 Change Engine Oil and Filter S52 Labor: \$57.50

11421730389	Oil Filter-N	1.0 @	10.58 =\$	10.58	
5-30 SYN	Synthetic Oil-N	7.5 @	6.95 =\$	52.13	62.71

Drain engine oil, replace filter. Set tire pressures, check brakes. Check lights, belts, and hoses. Check fluids and top off as needed.

Job02 CK Condition of Vehicle, Ck List Labor: \$0.00

- Ck Vehicle:
- Lower Control Arm Bushings Weak \$220.77
 - Rear Shocks Leaking, Front Worn \$1686.
 - P/S Reservoir and Lines \$313.61
 - Insp II -O/F, Trans and Diff Fluid \$500.
 - Rear Brakes Pads, Rotors, Sens \$445.
 - Brake Fluid Change/Bleed \$125.
 - LF Wheel Bent, Repair, Approx \$150.

3440.38
~~*3440.38*~~

Slight Leak at Shift Shaft Seal
Coolant stain on Thermostat

Date: 11/28/2011 16:16 CC Type: VISA CC#: XXXXXXXXXXXXX8377

Approval: 09150C WO#: 000009533 Amount: 129.88

Signature: _____

Buyer agrees to pay total amount above according to Cardholder's agreement with Issuer.

----->----->----->---Continued on the next page--->----->----->----->

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) _____

Bavarian Tuning Inc.

BAR #: ALI230718

112 Commercial Ct. #11

Santa Rosa, Ca 95407

Phone: 707 575 3757 FAX: 707 575 4953

Invoice No.

000009533

Order Date 11/28/11 08:33 am

Paid: 11/28/11 04:13 pm

Page 2

Payments to Bavarian Tuning Inc.

Cost Summary

Status: Paid Work Order

Payments: \$129.88

1 11/28/11 129.88 Visa APP09150C

Labor	57.50
Parts	62.71
Haz Waste	4.00
Tax	5.67
Total	\$129.88
Payments	129.88
Bal Due	0.00

Thank you for choosing Bavarian Tuning Inc.

EMISSION CONTROL WORK ORDER



SMOG QUEEN
 160 10th Street
 SAN FRANCISCO, CA 94103
 (415) 252-0733
 BAR# ARD261775



043740

Date	
Time Received	
	A.M. P.M.
Promised	A.M. P.M.
Written By	

BILLING	<input type="checkbox"/> CASH	Name			PHONE	Phone when ready Yes <input type="checkbox"/> No <input type="checkbox"/>	
	<input type="checkbox"/> BANK CARD NO.	Address				Apt. No.	Res.
	<input type="checkbox"/> OIL CO. CARD NO.	City				Zip	Bus.
	<input type="checkbox"/> CHECK NO.	Year - Model	01 BMW M3			Odometer	Inspector
	<input type="checkbox"/> OTHER	Vin No.	WBSCM9339LGG000000			License No.	Mech.

ALL PARTS ARE NEW UNLESS OTHERWISE DESIGNATED				REPAIR ORDER LABOR INSTRUCTION			INTERNAL	
* CODE N-NEW U-USED R-REBUILT				I/M SMOG INSPECTION			60 75	
				I/M SMOG CERTIFICATE			8 75	
QTY.	*	PART NO. OR DESCRIPTION	PRICE	AMOUNT				
					-10%		-600	
				CA AIR				
				This Shop Cannot Be Held Responsible For Any Damages That May Occur To Your Vehicle When Performing The Dyno Emissions Test. Such As Engine Damages, Axle, Drivetrain, Front End, Overheating, Etc. This Is A				
				Test Only Station. By Law We Cannot Perform Any Diagnosis Or Repairs.				
TOTAL PARTS								

THIS IS TO ADVISE YOU THAT SOME EMISSION CONTROL DEVICES MAY STILL BE COVERED UNDER MFG'S WARRANTY.
 BY LAW, YOU MAY CHOOSE ANOTHER LICENSED SMOG CHECK FACILITY TO PERFORM ANY NEEDED REPAIRS OR ADJUSTMENTS THAT THE SMOG CHECK TEST INDICATES ARE NECESSARY.

I hereby authorize the above repair work to be done along with the necessary material, and hereby grant you and/or your employees, permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event an attorney is retained to foreclose this lien or to bring suit for collection of any sums due I agree to pay costs of collection and reasonable attorney fees.

Authorized By _____ DATE _____ TIME _____
 CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF

TOTAL LABOR	
PARTS	
OIL & FLUIDS	
SUB-TOTAL	
TAX	
GAS / GAL	
TOTAL AMOUNT	607

ESTIMATE:
 INSPECTION FEE 60.75
 CERTIFICATE IF ISSUED 75
TOTAL ESTIMATE 607

RETURN OLD PARTS Y N

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

X INITIALS _____

ESTIMATED COST \$ OF ADDITIONAL REPAIR _____ DATE _____ TIME _____ IND. CONTACTED _____ PHONE NO. _____

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 10/28/2011 @ 08:23

Model Year: 1999	Make: BMW	Model: M COUPE
License: ACZ2950	State: WA	VIN: WBSCM9337XLC60282
Engine Size: 3.2 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3431	Cylinders: 6
Odometer: 93693	Certification: California	VLT Record #: 28528
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Initial Registration

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: 01171302
DMV ID Number: **861713270422**

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	Pass	MIL/Check Engine Light
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/ Switches	Pass	Carb./Fuel Injection
N/A	EGR Functional	N/A	Ignition Timing:	Pass	Other Emission Related Components
N/A	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Fuel Cap Visual	Pass	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls				
N/A	Fuel Evaporative Controls Functional				

ASM Emission Test Results

Test	RPM	%CO ₂		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1750	15.1	0.0	54	9	19	0.50	0.02	0.03	434	57	0	PASS
25 mph	1960	15.1	0.0	38	7	12	0.48	0.03	0.03	721	50	0	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information

Smog Queen
160 10th San Francisco CA 94103
(415)252-0733
Station Number: TC261775

Technician Name/Number: ZIELIN, THOMAS/EA150576
Repair Tech Name/Number:
Software Version/EIS Number: 0903/ES419312

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

10/28/11
Date

Technician's Signature

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 10/28/2011 @ 08:23

Model Year: 1999	Make: BMW	Model: M COUPE
License: ACZ2950	State: WA	VIN: WBSCM9337XLC60282
Engine Size: 3.2 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3431	Cylinders: 6
Odometer: 93693	Certification: California	VLT Record #: 28528
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Initial Registration

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: 01171302
DMV ID Number: **861713270422**

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	Pass	MIL/Check Engine Light
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/ Switches	Pass	Carb./Fuel Injection
N/A	EGR Functional			Pass	Other Emission Related Components
N/A	Fuel Cap Functional	N/A	Ignition Timing:		Oxygen Sensor
Pass	Fuel Cap Visual	Pass	Wiring to Sensors	Pass	Liquid Fuel Leaks
Pass	Spark Controls	Pass	Fillpipe Restrictor	Pass	
N/A	Fuel Evaporative Controls Functional				

ASM Emission Test Results

Test	RPM	%CO ₂		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1750	15.1	0.0	54	9	19	0.50	0.02	0.03	434	57	0	PASS
25 mph	1960	15.1	0.0	38	7	12	0.48	0.03	0.03	721	50	0	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information

Smog Queen
160 10th San Francisco CA 94103
(415)252-0733
Station Number: TC261775

Technician Name/Number: ZIELIN, THOMAS/EA150576
Repair Tech Name/Number:
Software Version/EIS Number: 0903/ES419312

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

10/28/11
Date

Technician's Signature

necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. I agree to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If I decide to take legal action for any reason against Metric Motors, I agree to arbitration hearings to resolve any issues and I will pay any and all legal fees. If vehicle is returned to customer without repair service being performed, a diagnostic and

METRIC MOTORS of San Francisco

1480 Howard St. S.F Ca 94103

metric-motors@sbcglobal.net,

(415) 626-6234

BAR # ARD 129463

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee

p	1998 BMW Z3 Roadster	License #	Repair Order # 23004			
	VIN:	Mileage: 193694	Inv Date: October 27, 2011 @ 9:26am			
(707)	Engine: L6 2.8L, 2793cc, Gas, FI	Color:	Service Writer:			
Mobile	Transmission:	Unit #:	Status: Paid			
		PO #	Driver: Stamp, James			
		Mfg. Date:				
Vehicle Problems	Requests for Service	Services Performed	Hrs	Qty	Price	Ext
PPI		Labor Service - Inspect overall condition of vehicle. Please see printed report	1.00		125.00	125.00

TOM

Warranty

WORK GUARANTEED (EXCLUDING BRAKES), FOR 1 YEAR OR 12,000 MILES, WHICH EVER COMES FIRST.

LIMITED WARRANTY ON BRAKE WORK

10 MONTHS OR 8,000 MILES & 6 MONTHS OR 6,000 MILES FOR SUVs

WHICHEVER COMES FIRST

Posted 10/28/11 1:02PM:
 Visa

\$125.00

Repair Order Summary:

Labor \$125.00

X

Customer acknowledges receipt of merchandise and services.

Sub Total \$125.00

Sales Tax (DEF)

Larkins Brothers

370 So. Van Ness Avenue
 San Francisco, CA 94103
 BAR #AM 143743
 (415) 863-5730

Customer Copy

Invoice #338980

Estimated
 Time Due

San Francisco CA 94103

Friday, October 28, 2011
 2:28:28 PM

Ordered on
 Friday, October 28, 2011

Workorder # 101470

MAKE & MODEL	FLEET NO.	PHONE	REP	CSH	PO #	TERMS		
BMW			Martin L	1		Cash		
LICENSE NO.	MILES IN/OUT	VIN	TORQUE	ENGINE SIZE	TRANSMISSION	COLOR	PRD DATE	
ACZ2950	93707							
CATALOG	DESCRIPTION	QTY	PARTS	LABOR	DISC	FET	TOTAL	Code
ZZTWB	WHEEL BALANCE 18"	2		35.00			\$70.00	1

**FAMILY OWNED AND OPERATED SINCE 1950.
 THANK YOU FOR YOUR TRUST AND PATRONAGE!**

PAID BY	Parts	\$0.00	Taxable	\$0.00
VISA \$70.00	Labor	\$70.00	Non-Taxable	\$70.00
	Freight	\$0.00	Local 8.5%	\$0.00
	Other	\$0.00		
	FET	\$0.00		
	Supplies	\$0.00		
	TOTAL			\$70.00

Parts and Labor warranties for mechanical repairs is: 100 % for 180 days or 6000 mile whichever comes first. Alignment warranty for 90 days or 4000 miles this warranty limited to the work on this form only.

to honor warranty, vehicle must be returned to Larkins Bros. Tire or are second store Hanlons Tire Service located in San Bruno CA at customers expense. I hereby authorize the repair work to be done along with the necessary materials. You and your employees may operate vehicle for purposes of testing, inspection or delivery at my risk. An express Mechainc's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Because of the extent of the teardown and inspection, the vehicle may not perform as well as before.

No refunds on installed Tires and or Wheels, Special Orders or discontinued items. All returns are subject to 15% handling charge. Any deposits are subject to forfeit if cancelled. All used tires have a 30 day warranty with no road hazard.

Print Name _____ Signature _____ Date _____

Customer Invoice

089320
10/23/2011

**FIRESTONE COMPLETE AUTO CARE
1501 MISSION ST
SAN FRANCISCO, CA. 94103-2512**

Service Advisor:
01 EDDIE
415.621.4650

V
77
L
SAN FRANCISCO, CA 94103
3

1999 BMW M COUPE [RED]
Lic #: ACZ2950 CA Vin #: WBSCM9337XLC60282
In: 10/23/11 2:58PM Mileage: 93,673
Out: 10/23/11 4:55PM

Store # 012645 **RETAIL SALE** REG#ARD222593, EPA#CAD981964109

Description	Rev Hist /Article #	ID	Qty	Unit Price	Extended Price	Job Total
LIFETIME WHEEL BALANCE AND TIRE ROTATION (All 4)		01				71.96
Symptom:-						
TIRE ROTATION - NO CHARGE	7001119	06NN	1	N/C	N/C	
LIFETIME WHEEL BALANCE LABOR	7025186	06NN	4	14.00	56.00	
LIFETIME WHEEL BALANCE PARTS	7006038	06TN	4	3.99	15.96	
Rotate the vehicle's tires to a new location on the vehicle using accepted trade standards regarding vehicle and tire type/ check one wheel balance Computer spin balance each tire / wheel assembly						
ALIGNMENT SERVICE		01				89.99
Symptom:-						
ALIGNMENT SERVICE	7004578	06NN	1	89.99	89.99	
Inspect steering and suspension system including tire condition/ balance check one tire and air pressure check Print out final alignment readings to verify alignment is within specifications Road test vehicle before servicing Road test vehicle before and after completing the alignment Put vehicle on alignment rack, mount and compensate sensors, and print out the initial alignment readings Align all four wheels, using adjustments provided by manufacturer, to manufacturer's specification when applicable						
COURTESY CHECK		01				
COURTESY CHECK	7046930	06NN	1	N/C	N/C	
CC - See reverse side of invoice for details of the Courtesy Check						

Technician(s):
06 ERNESTO LOPEZ

Payment History:

American Expres 1000	163.31	520784
Total Tendered	163.31	

Summary:

Parts	15.96
Labor	145.99
Shop Supplies	0.00
Sub-Total	161.95
Tax (8.50%)	1.36
Total	\$163.31

All CFNA purchase(s) through December 31, 2011 of \$249 or more receive 6 month deferred interest, see www.CFNA.com for more details.

I have received the above goods and/or services. If this is a credit card purchase, I agree to pay and comply with my cardholder agreement with the issuer.

Customer Signature

All parts are new unless otherwise specified.

TELL US ABOUT YOUR EXPERIENCE AND RECEIVE \$10 OFF YOUR NEXT PURCHASE OF \$25 OR MORE!

1) For a short survey Call 1-800-859-9203 or logon to www.FirestoneSurvey.com; enter code 012645-089320
2) Write redemption code here: _____ Offer expires 6 months from date of invoice, good at all participating locations.
Must have valid redemption code. May not be used to reduce existing debt. No copies accepted

COMMITTED TO PROVIDING A POSITIVE CUSTOMER EXPERIENCE

Courtesy Check

Inspect All Items in Top Section

Year 99 Make BMW Model M coupe

Eng. Size SOHC OHV DIESEL DOHC HYBRID Trans. Auto Manual

Hubcap Missing Y N Windshield Cracked Y N Scratches/Dents Y N

MILEAGE: 93673

Lic. # _____ State Inspection Due Month _____ Year _____

Inspect	Visual			Sched. Maint.	Why Recommended
	OK	SUG	REQ		
Wiper Blades	<input checked="" type="checkbox"/>			<input type="checkbox"/> Front <input type="checkbox"/> Rear	
Head Lights	<input checked="" type="checkbox"/>				
Turn Signal Lights	<input checked="" type="checkbox"/>			<input type="checkbox"/> Brake <input type="checkbox"/> Turn Signal <input type="checkbox"/> License Plate <input type="checkbox"/> Parking	
Oil Filter	<input checked="" type="checkbox"/>				
Air Filter	<input checked="" type="checkbox"/>				
CV Valve	<input checked="" type="checkbox"/>				
Washer Fluid	<input checked="" type="checkbox"/>				
Oil Level	<input checked="" type="checkbox"/>				
Power Str. Aid Level	<input checked="" type="checkbox"/>				
Master Cyl. Fluid Level	<input checked="" type="checkbox"/>			<input type="checkbox"/> Brake Inspection	
Brake Fluid Flush	<input checked="" type="checkbox"/>			0 10 30 100 200 300 Copper parts per million	
Trans. Service	<input checked="" type="checkbox"/>			<input type="checkbox"/> Flush <input type="checkbox"/> Pan Service	
Differential Fluid / Flush	<input checked="" type="checkbox"/>			Type _____	
Differential Hoses	<input checked="" type="checkbox"/>			<input type="checkbox"/> Upper <input type="checkbox"/> Lower <input type="checkbox"/> Bypass <input type="checkbox"/> Heater	
Belts	<input checked="" type="checkbox"/>			<input type="checkbox"/> ALT <input type="checkbox"/> PS Belts 1 2 3 4 <input type="checkbox"/> A/C <input type="checkbox"/> AP	
Battery 5-18 Test	<input checked="" type="checkbox"/>			<input type="checkbox"/> Good <input type="checkbox"/> Marginal <input type="checkbox"/> Replace	
Battery Accessories	<input checked="" type="checkbox"/>			<input type="checkbox"/> Cable Ends / Cables <input type="checkbox"/> Pos <input type="checkbox"/> Neg <input type="checkbox"/> Hold Downs	
Battery Guard	<input checked="" type="checkbox"/>			<input type="checkbox"/> Corrosion <input type="checkbox"/> Preventive	

Tires and Tire Maintenance									
Tire Size:				Tread Depth		Speed Rating		Run Flat	
<u>225/45 R17</u>				<u>10 10</u>		<u>Y</u> <u>N</u>		<u>Y</u> <u>N</u>	
<u>245/40 R17</u>				<u>10 10</u>		<u>Y</u> <u>N</u>		<u>Y</u> <u>N</u>	
Inspect	Visual			Tread Depth		Drive Type			
	OK	SUG	REQ	Outer	Inner	<input checked="" type="checkbox"/> FWD <input checked="" type="checkbox"/> RWD <input type="checkbox"/> 4WD/AWD			
Left Front	<input checked="" type="checkbox"/>			<u>10</u>	<u>10</u>	<input type="checkbox"/> Edgewear <input type="checkbox"/> Cracking <input type="checkbox"/> Cupping <input type="checkbox"/> Nails <input type="checkbox"/> Cuts <input type="checkbox"/> Repairable <input type="checkbox"/> Irregularity <input type="checkbox"/> Non-Repairable			
Right Front	<input checked="" type="checkbox"/>			<u>10</u>	<u>10</u>	<input type="checkbox"/> Edgewear <input type="checkbox"/> Cracking <input type="checkbox"/> Cupping <input type="checkbox"/> Nails <input type="checkbox"/> Cuts <input type="checkbox"/> Repairable <input type="checkbox"/> Irregularity <input type="checkbox"/> Non-Repairable			
Right Rear	<input checked="" type="checkbox"/>			<u>9</u>	<u>9</u>	<input type="checkbox"/> Edgewear <input type="checkbox"/> Cracking <input type="checkbox"/> Cupping <input type="checkbox"/> Nails <input type="checkbox"/> Cuts <input type="checkbox"/> Repairable <input type="checkbox"/> Irregularity <input type="checkbox"/> Non-Repairable			
Left Rear	<input checked="" type="checkbox"/>			<u>9</u>	<u>9</u>	<input type="checkbox"/> Edgewear <input type="checkbox"/> Cracking <input type="checkbox"/> Cupping <input type="checkbox"/> Nails <input type="checkbox"/> Cuts <input type="checkbox"/> Repairable <input type="checkbox"/> Irregularity <input type="checkbox"/> Non-Repairable			
Spare	<input checked="" type="checkbox"/>					<input type="checkbox"/> Edgewear <input type="checkbox"/> Cracking <input type="checkbox"/> Cupping <input type="checkbox"/> Nails <input type="checkbox"/> Cuts <input type="checkbox"/> Repairable <input type="checkbox"/> Irregularity <input type="checkbox"/> Non-Repairable			
Tire Maintenance	<input checked="" type="checkbox"/>					<input type="checkbox"/> Rotation <input type="checkbox"/> Balance			
Alignment Check	<input checked="" type="checkbox"/>					<input type="checkbox"/> Maintenance <input type="checkbox"/> Tire Wear			

Complete Vehicle Inspection

In Addition to The Above Inspect All Items Below

Inspect	Visual			Sched. Maint.	Why Recommended
	OK	SUG	REQ		
Start / Charge	<input checked="" type="checkbox"/>			<input checked="" type="checkbox"/>	
Belt Tensioner	<input checked="" type="checkbox"/>				
Spark Plugs	<input checked="" type="checkbox"/>				
Oil Filter	<input checked="" type="checkbox"/>				
Electrical System Service	<input checked="" type="checkbox"/>				
Ignition Wires	<input checked="" type="checkbox"/>				
Drive Cover Basket	<input checked="" type="checkbox"/>				
Power Steering	<input checked="" type="checkbox"/>			<input type="checkbox"/> Pressure <input type="checkbox"/> Return	
Serpentine Belt	<input checked="" type="checkbox"/>				

Brakes									
Pads greater than 6mm (Disc) or Shoes greater than 2.4mm (Drum)									
Pads greater than 3mm or less than 6mm (Disc) or Shoes greater than 1.6mm or less than 2.4mm (Drum) Document vehicle specific measurements & minimum specifications below									
Pads less than 3mm (Disc) or Shoes less than 1.6mm (Drum) Document vehicle specific measurements & minimum specifications below									
LF Pad	LF Rotor				RF Rotor				RF Pad
		Actual Meas.			Actual Meas.				
MM Actual		Machine To			Machine To			MM Actual	
MM Spec		Discard At			Discard At			MM Spec	
LR Pad / Shoe	Drum	LR Rotor	RR Rotor	RR Pad / Shoe					
		Actual Meas.		Actual Meas.					
MM Actual		Machine To		Machine To					
MM Spec		Discard At		Discard At					
		Rear Clean / Adj							
		Brake Hose(s)							
		Parking Cables							
		Other Brake Services	Hardware	Caliper	Wheel Cylinder	Repack			

Exhaust				
Exhaust System	<input checked="" type="checkbox"/>			<input type="checkbox"/> Intermediate Pipe <input type="checkbox"/> Muffler <input type="checkbox"/> Tailpipe

Steering and Suspension				
Ball Joint	<input checked="" type="checkbox"/>			<input type="checkbox"/> Front <input type="checkbox"/> Rear
Steering / Pitman Arm	<input checked="" type="checkbox"/>			<input type="checkbox"/> Idler <input type="checkbox"/> Pitman
Control Link	<input checked="" type="checkbox"/>			
Shocks	<input checked="" type="checkbox"/>			<input type="checkbox"/> Control Arm <input type="checkbox"/> Sway Bar <input type="checkbox"/> Front <input type="checkbox"/> Rear
Shock Pins	<input checked="" type="checkbox"/>			<input type="checkbox"/> Front <input type="checkbox"/> Rear <input type="checkbox"/> Left <input type="checkbox"/> Right
Strut Rod Ends	<input checked="" type="checkbox"/>			<input type="checkbox"/> L Out <input type="checkbox"/> L In <input type="checkbox"/> R In <input type="checkbox"/> R Out <input type="checkbox"/> Sleeve(s)
Ball Joints	<input checked="" type="checkbox"/>			<input type="checkbox"/> L Upper <input type="checkbox"/> R Upper <input type="checkbox"/> L Lower <input type="checkbox"/> R Lower Spec _____ Actual _____
Steering Rack & Pinion Assembly	<input checked="" type="checkbox"/>			
CV Boots	<input checked="" type="checkbox"/>			<input type="checkbox"/> L Out <input type="checkbox"/> L In <input type="checkbox"/> R In <input type="checkbox"/> R Out
CV Joints	<input checked="" type="checkbox"/>			<input type="checkbox"/> L Out <input type="checkbox"/> L In <input type="checkbox"/> R In <input type="checkbox"/> R Out
CV Boots	<input checked="" type="checkbox"/>			<input type="checkbox"/> Front <input type="checkbox"/> Rear <input type="checkbox"/> Left <input type="checkbox"/> Right
CV Boots	<input checked="" type="checkbox"/>			<input type="checkbox"/> Front <input type="checkbox"/> Rear <input type="checkbox"/> Left <input type="checkbox"/> Right

Notes:

6

OK Checked & acceptable

Repair / Replacement Suggested

- 1) Close to end of useful life
- 2) Address customer request / need / convenience
- 3) Comply with manufacturer recommendation
- 4) Technician recommendation from experience

Repair / Replacement Required

- A) No longer performs intended purpose
- B) Does not meet design specification
- C) Missing

THANK YOU FOR CHOOSING FIRESTONE

VIN: **WBSCM9337XLC60282**
 Date **10/23/11 5:04 PM**

BMW 99-02 E36 Z3 M Coupe

Front : Left

Actual	Before	Specified Range
-0.9°	-0.8°	-1.3° -0.3°
7.4°	7.4°	7.1° 8.1°
0.18°	-0.09°	0.13° 0.21°
15.0°	15.0°	
14.2°	14.2°	
		-1.90° -0.90°

Front : Right

Actual	Before	Specified Range
-0.9°	-1.0°	-1.3° -0.3°
7.3°	7.3°	7.1° 8.1°
0.18°	0.50°	0.13° 0.21°
14.0°	14.0°	
13.0°	13.0°	
		-1.90° -0.90°

Camber
 Caster
 Toe
 SAI
 Included Angle
 Turning Angle Diff.

Front

Cross Camber
 Cross Caster
 Cross SAI
 Total Toe
 Cross Turn Diff.

Actual	Before	Specified Range
0.1°	0.2°	-0.5° 0.5°
7.1°	0.1°	-0.5° 0.5°
1.0°	0.9°	
0.35°	0.41°	0.25° 0.42°

Rear : Left

Actual	Before	Specified Range
-1.2°	-1.2°	-2.3° -1.3°
0.06°	0.06°	0.00° 0.50°

Rear : Right

Actual	Before	Specified Range
-1.5°	-1.5°	-2.3° -1.3°
0.02°	0.02°	0.00° 0.50°

Camber
 Toe

Rear

Cross Camber
 Total Toe
 Thrust Angle

Actual	Before	Specified Range
0.2°	0.2°	-0.5° 0.5°
0.07°	0.07°	0.28° 0.72°
0.02°	0.02°	-0.25° 0.25°